#### **TABLE OF CONTENTS**

## HYGROUND® IRREVERSIBLE COMPRESSION GROUNDING AND INSTALLATION TOOLING

	HYGROUND® Features and Benefits E-5 - E-6	16 B	Type <b>YGIB E-20 - E-21</b>
	Type <b>YGL-C E-7</b>		Type <b>GSTUD-HY E-22</b>
Service Control	Type <b>YGLR-C E-8</b>		Types YGT & YTTAG E-23
	Type <b>YGHP-C E-9</b>	e/s	Type <b>YG-B</b>
	Type <b>YGHP-C E-10</b>		MECHANICAL GROUNDING  Types KC, K2C E-25
U.S	Type <b>YGHC-C E-11</b>		Types KC22J12T13,
C	Type <b>YGC E-12</b>		EQC632C, KS-DB E-26
	Type <b>YSHG E-13</b>		Types <b>KS</b> , <b>GKA</b> , <b>KPB</b> , <b>CL50-1 E-26 - E-27</b>
	Type <b>YGHR-C E-14</b>		Type <b>GAR E-28 - E-29</b>
8	Type <b>YGHR-C E-15</b>	Q	Types GAR-BU & GAR 3900 Series & GAR-RB E-30
	Type <b>YGHA E-16</b>		Type <b>GAR-TC E-31</b>
	Type <b>YGHS E-16</b>	W116	GHTNING PROTECTION INFO.
100	Type <b>YGA E-17</b>	Basic 1. Mu 2. Two	rules for selection are: st be like material to the conductor. bo bolts to ground rod — minimum, for mechanical. ble to cable connections can be installed with – one
	Type <b>YGS E-18</b>	bol 4. Ca 5. He	t, two bolt, or compression.  able to steel structure must have 8 in. <sup>2</sup> contact with steel.  eavy duty stacks — mechanical only.  a all connectors with heavy duty stack rating, we must
	Type <b>YGF E-19</b>	offe est	er 1/16" thick lead plating as an option. Reason is clos- 25 ft. to stack opening must use lead coated product. 96 Listing.

#### **TABLE OF CONTENTS**

#### **MECHANICAL GROUNDING** (Continued)

A	Type <b>GD E-32</b>	99	Types <b>GC</b> , <b>GCM E-48</b>
350	Type <b>GP E-33</b>		Type <b>GL E-49</b>
	Type <b>GK E-33</b>		Type <b>GZ E-49</b>
00. 1	Type <b>BDT BONDIT</b> ™ <b>E-34</b>		Type <b>GC-CT E-50</b>
	Water Pipe Grounding E-35 - E-40	38	Type <b>GTC1AC34RA E-51</b>
	Type <b>GC-A E-41</b>		Type <b>GIE-G E-52</b>
8	Type <b>GG E-42</b>		Rail Connector E-53
	Type <b>GQ E-43</b>	-	Type <b>QGFL</b>
	Type <b>GX E-44</b>		Type <b>GA-H E-54</b>
0	Types GRC, GRL, GCRT1/0 E-45		Type <b>GRF E-55</b> Raised Floor Grounding
	Type <b>B E-46 - E-47</b>		Types <b>GP-G1, GPRT E-56</b>
War.	Types <b>GB, GBM E-48</b>	7 6	Raised Floor Grounding
		5	Type <b>BBB E-57 - E-58</b> Copper BusBar

#### E-3

#### **TABLE OF CONTENTS**

#### **BURNDYWeld®**

BURNDYWeld® Introduction E-60	Type <b>BCR-17 E-72</b>
Making a BURNDYWeld®  Connection E-61	Type <b>BCR-24 E-73</b>
WELD METAL E-62	Type <b>BCS-1 E-75</b>
Type <b>BCC-1 E-63</b>	Type <b>BCS-8 E-75</b>
Type <b>BCC-2 E-64</b>	Type <b>BCS-2 E-76</b>
Type <b>BCC-4 E-65</b>	Type <b>BCS-9 E-76</b>
Type <b>BCC-11 E-66</b>	Type <b>BCS-23 E-77</b> Type <b>BCS-23 E-78</b>
Type <b>BCC-6 E-67</b>	Type <b>BCS-4 E-79</b>
Type <b>BCC-14 E-67</b>	Type <b>BCS-6 E-79</b>
Type <b>BCC-7 E-68</b>	Type <b>BCS-7E-80</b>
Type <b>BCR-1 E-69</b>	Type <b>BCS-18 E-80</b>
Type <b>BCR-2 E-70</b>	Type <b>BCS-5 E-81</b>
Type <b>BCR-3 E-71</b>	Type <b>BCRE-1 E-82</b>
	Type <b>BCRE-2 E-83</b>

Grounding BURNDY®

### **TABLE OF CONTENTS**

<b>BURNDYWeld®</b>	(Continued)
--------------------	-------------

Type <b>BCRE-3 E-84</b>	Type <b>BCR-24 E-74</b>
Type <b>BCRE-4 E-85</b>	Type <b>BCR-25 E-74</b>
Type <b>BCRE-6 E-86</b>	ACCESSORIES  B38-0330-00 Cable Clamp E-92
BURNDY® GROUNDMAX™E-87 - E-88	Cable Cleaning Brush E-92
BURNDY GRIDMAX™ E-89	Card Cloth Brush E-92
Types B-106 & B-107 Handle Clamps E-90	Mold Cleaning Brush E-92
B40-0106-75 Handle Attachment E-90	Mold Cleaners E-92
Mold Support Clamp E-90	Packing Material E-92
Vertical Magnetic Clamps E-91	BURNDYWeld™ Tool Kit E-93
Clamps E-91	BURNDYWeld™ Tools E-93
Horizontal & Vertical Chain Clamps E-91	<b>▶ B38-0101-00</b> Rasp <b>E-93</b>
	<b>B38-0309-00</b> Flint Ignitor <b>E-93</b>
SINGLE SHOT MOLDS	₹ Ground Rod
Type <b>BCR-1 E-74</b>	Driving Sleeves E-94
Type <b>BCR-2 E-74</b>	Shim Stock and Adapter Sleeves E-94
	Tips E-95 - D96


E-4


# THE HYGROUND® IRREVERSIBLE COMPRESSION SYSTEM

BURNDY® has developed an irreversible compression ground system which meets the most stringent safety and performance requirements, including those of OSHA and nuclear power plant design. Performance excellence and long life expectancy are the system's basic design guidelines. It is a complete system which consists of connectors for grid cross connections, taps, splices, cable to ground rod, ground plates and terminations.

Our irreversible compression ground connectors employ well-proven design principles and technology that have been in existence for over 60 years.

Connectors are just one component of our Irreversible Compression Ground System. Installation tooling is also an integral part of this system. BURNDY® pioneered the compression connector principle and continues today to be the leader in compression technology. Our tooling package is the most extensive in the industry and affords the user many options.

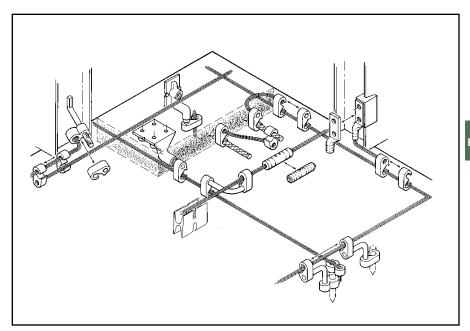

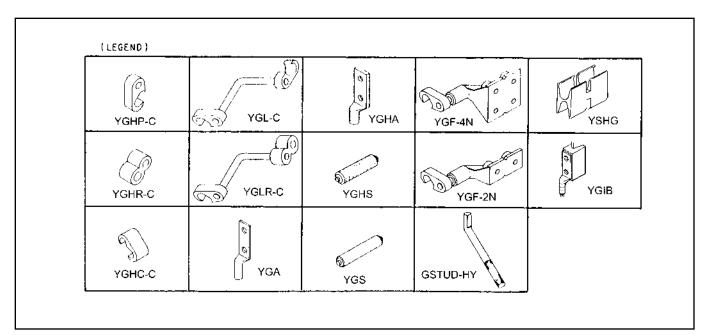

#### E 6

# THE HYGROUND® IRREVERSIBLE COMPRESSION SYSTEM

(Continued)

Canada: 1-800-387-6487

#### Features and Benefits

- Irreversible compression.
  - Meets 1999 NEC code, section 250-50 and 250-64.
- Material-pure wrought copper extrusions, rod and seamless tubing—identical material to the conductor.
- Completely eliminates the possibility of corrosion due to dissimilar metals.
- Heavy duty connector design.
  - All connectors will carry the equivalent or greater current carrying capacity of the conductor while maintaining high mechanical strength and electrical integrity.
- Range taking design—minimum number of connector combinations required to install a conductor range of #6 solid to 500 kcmil plus 1/2", 5/8", 3/4", and 1" ground rods and rebar.
  - Inventories are kept to a minimum and product selection is simplified.
- System engineered tooling.
- Each tooling recommendation has been designed to ensure reliability of the connection.
- Irreversible compression connectors can be installed in all kinds of weather.
- Eliminates costly construction delays and enables the installer to better schedule his job.
- May be installed without special training or special tools. Y750 crimps entire range.
- ♦ Low installed cost.♦ Simplified installation.
- Each connection can be made in less than 3 minutes.
  - ♦ Low installed cost.
- ♦ Simplified installation.
- Each connector is clearly marked with catalog number, conductor size and installation die information.
  - ♦ Easy and accurate identification.
- Inspection ports are provided to assure proper insertion of the conductor.
  - Built-in quality assurance.

- The die index number is embossed on the connector after completion of the crimp.
  - Facilitates speedy inspection of installed connectors to insure consistently reliable and sound connections.
- Most HYGROUND® irreversible compression elements are prefilled with PENETROX™ and individually sealed in clear polyethylene sheet.
- ♦ Ensures that all contact surfaces are in the proper condition for installation.
- Ensures the electrical integrity of the finished connection by inhibiting moisture and contaminates from entering the contact area.
- All HYGROUND® irreversible compression connectors are Listed in conformance with Underwriters Laboratories Standard UL467 and conform to applicable sections of the National Electrical Code.
- May be used in direct burial or concrete embedded grounding applications.
- All HYGROUND® irreversible connectors (with the exception of type YGA and YGS) have been tested successfully according to requirements of Standard IEEE 837.
  - Meets tough industry performance requirements.
  - ♦ UPRECRIMP dies give added mechanical strength. UPRECRIMP 34 for 3/4" rod, UPRECRIMP 12 for 1/2" rod, and UPRECRIMP 58 for 5/8" rod (now includes undersized U.S. market place rods).
- Allows connection to most sizes of structural steel with no drilling, tapping, or welding.
  - Safely installed at low cost. Hot work permits are not required to install in hazardous areas

#### **TYPE YGL-C**

#### **HYGRID CROSS CONNECTOR**

An irreversable compression ground grid cross connector which allows adjustment of the compression elements prior to installation. Only six connectors and four dies are required to install all combinations from #6 solid through 500 kcmil. UL467 Listed. Acceptable for direct burial in earth and concrete. Prefilled with PENETROX™ compound and strip sealed.









**IEEE-837** 

Catalog Number	В	В-В	C	C-C	D	ı	R
YGL2C2			1.09			_	••
			1.09	1.09	.313		.31
YGL29C2			1.66				
YGL29C29	.75	.75	1.00	1.66	.500	2.50	.50
YGL34C2			2.09	1.09	.313	2.50	.31
YGL34C29			2.09	1.66	.500		.50
YGL34C34	1.10	1.10	2.28	2.28	.750		.75

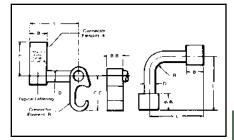

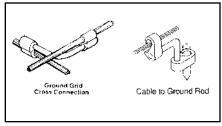

✓ UL96 Listed for Lightning Protection.



#### ORDERING INFORMATION

Catalog	Cable to	Cable Cable	Cable to	To Rebar		
Number	Element "A"	Element "B"	Element "A"	Element "B"	Element "A"	
YGL2C2	#6 Sol. (.162) – #2 Str. (.292) {59500} – {59500}	#6 Sol. (.162) – #2 Str. (.292)				
YGL29C2	#1 Str. (.332) – 250 kcmil (.575) {98500} – {131500}	{59500} - {59500}	1/2" – 5/8" Rod	#6 Sol. (.162) – #2 Str. (.292)	3/8" – 1/2"	
YGL29C29	#2 Str. (.292) – 250 kcmil (.575) {65500} – {131500}	#2 Str. (.292) – 250 kcmil (.575) {65500} – {131500}	1/2 – 5/6 NOU	#2 Str. (.292) – 250 kcmil (.575)	#3 – 4 Rebar	
YGL34C2		#6 Sol. (.162) – #2 Str. (.292)		#6 Sol. (.162) – #2 Str. (.292)	5/8" – 3/4"	
YGL34C29	250 kcmil (.575) – 500 kcmil (.813)	#2 Str. (.292) - 250 kcmil (.575)	5/8" - 3/4" Rod	#2 Str. (.292) - 250 kcmil (.575)	#5 – 6 Rebar	
YGL34C34	1	250 kcmil (.575) - 500 kcmil (.813)		250 kcmil (.575) - 500 kcmil (.813)	#3 - 0 nebai	

Dimensions in brackets { } represent lightning protection conductors.

			Installation To	ols, Die Set Cata	log Number (Nur	mber of Crimps)			
Catalog	Y750/Y35/Y39	9 HYPRESS™	PAT75	0-18V	Y45 HYF	PRESSTM	Y46 HYPRESS™		
Number	Element "A"	Element "B"	Element "A"	Element "B"	Element "A"	Element "B"	Element "A"	Element "B"	
YGL2C2	U-0 (1)	U-0 (1)	U-0 (1)	U-0 (1)	U-0 (1)	U-0 (1)	U-0 (1)	U-0 (1)	
YGL29C2	U997 (1)	U-0 (1)	③ U997P (1)	U-0 (1)	U997 (1)	U-0 (1)	U997 (1)	U-0 (1)	
YGL29C29	U997 (1)	U997 (1)	③ U997P (1)	③ U997P (1)	U997 (1)	U997 (1)	U997 (1)	U997 (1)	
YGL34C2*	PU998 (1)	U-0 (1)	PU998 (1)	U-0 (1)	S998 or PU998 (1)	U-0 (1)	P998 or PU998 (1)	U-0 (1)	
YGL34C29*	PU998 (1)	U997 (1)	PU998 (1)	③ U997P (1)	S998 or PU998 (1)	U997 (1)	PU998 or PU998 (1)	U997 (1)	
YGL34C34*	U1011 (3)	U1011 (3)	U1011 (3)	U1011 (3)	S1011 (3)	S1011 (3)	P1011 (3)	P1011 (3)	

- 1. Where a "U" or "PU" die is recommended with Y45 HYPRESS™, a PT6515 adapter must be used.
- 2. Where a "U" or "PU" die is recommended with the Y46 HYPRESS™, a PUADP-1 adapter must be used.
- 3 Polarized die for the PAT750-18V.

\* These connectors can only be installed using the Y750, Y45, or Y46 HYPRESS™ with the recommended dies. These connectors CANNOT be installed with the Y35 and Y39 HYPRESS™.

- · Before crimping, both connector elements can be turned on rod diameter "D" to any desired position.
  • Clean rust and/or protective coatings from rebar
- prior to installation.
- · When attaching connector to ground rod, ground rod must be embossed with appropriate PRECRIMP™ die. For connections that must meet IEEE 837 requirements UPRECRIMP - type PRE crimp dies must be used for maximum clamping retention.


Ground Rod		
Dia.	PRECRIMP	Dies
1/2"	UPRECRIMP 12	
5/8"	UPRECRIMP 58	U2CABT
3/4"	UPRECRIMP 34	


#### **TYPE YGLR-C**

#### **GRIDLOK**

High Strength Irreversible Compression Ground Rod to Grid Connector

Ground grid connector for a wide range of copper cable to ground rod. Provides high torque strength on ground rod. UL467 Listed. Acceptable for direct burial in earth and concrete. Prefilled with PENETROX<sup>TM</sup> compound and strip sealed.

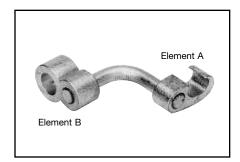

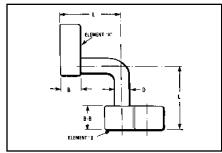







	Commercial										Installation To	ols, Die Set C	at. No. (Numb	er of Crimps)		
	Copper	Metric Copper	Copper Weld	Ground Rod					Y35/Y39 H	YPRESS™	Y750/P	50/PAT750 Y45		RESS™	Y46 HYP	RESSTM
Catalog	Cable Range	Cable Range	Cable Range	Dia.					Element	Element	Element	Element	Element	Element	Element	Element
Number	Element "A"	Element "A"	Element "A"	Element "B"	В	В-В	D	L	"A"	"B"	"A"	"B"	"A"	"B"	"A"	"B"
	#2 Str. (.292 Dia.)	35mm² (7.62mm Dia.)	91.65 kcmil (.343 Dia.)													
YGLR29C12	thru	thru	thru						U997 (1)	PU998 (1)	U997 (1)		U997 (1)		U997 (1)	
	250 kcmil (.575 Dia.)	120 mm² (14.40mm Dia.)	248.8 kcmil (.572 Dia.)	1/2"												
	250 kcmil (.575 Dia.)	120 mm² (14.40mm Dia.)	248.8 kcmil (.572 Dia.)	[12.7]							U1011		S998		P998	1
YGLR34C12	thru	thru	thru						_		or		or		or	
	500 kcmil (.813 Dia.)	240 mm² (20.35mm Dia.)	498.8 kcmil (.810 Dia.)				.313	2.53			PU998 (1)		PU998 (1)		PU998 (1)	
	#2 Str. (.292 Dia.)	35 mm² (7.62mm Dia.)	91.65 kcmil (.343 Dia.)				[7.9]	[64.3]								
YGLR29C58	thru	thru	thru						U997 (1)	PU998 (1)	U997 (1)		U997 (1)		U997 (1)	
	250 kcmil (.575 Dia.)	120 mm² (14.40mm Dia.)	248.8 kcmil (.572 Dia.)	5/8"												
	250 kcmil (.575 Dia.)	120 mm <sup>2</sup> (14.40mm Dia.)	248.8 kcmil (.572 Dia.)	[15.9]							U1011		\$998		P998	
YGLR34C58	thru	thru	thru						_		or	U1011 (2)	or	S1012 (2)	or	P1011(2)
	500 kcmil (.813 Dia.)	240 mm <sup>2</sup> (20.35mm Dia.)	498.8 kcmil (.810 Dia.)		.75	.88					PU998 (1)	or	PU998 (1)	or	PU998 (1)	or
	#2 Str. (.292 Dia.)	35 mm² (7.62mm Dia.)	91.65 kcmil (.343 Dia.)		[19.1]	[22.4]						PU998 (1)		PU998 (1)		PU998 (1)
YGLR29C34	thru	thru	thru						U997 (1)	PU998 (1)	U997 (1)		U997 (1)		U997 (1)	
	250 kcmil (.575 Dia.)	120 mm <sup>2</sup> (14.40mm Dia.)	248.8 kcmil (.572 Dia.)	3/4"												
	250 kcmil (.575 Dia.)	120 mm <sup>2</sup> (14.40mm Dia.)	248.8 kcmil (.572 Dia.)	[19.1]							U1011 (2)		U1011 (2)		U1011 (2)	
YGLR34C34	thru	thru	thru								or		or		or	
	500 kcmil (.813 Dia.)	240 mm² (20.35mm Dia.)	496.8 kcmil (.810 Dia.)				.500	2.63			PU998		PU998		PU998	
	#2 Str. (.292 Dia.)	35 mm² (7.62mm Dia.)	91.65 kcmil (.343 Dia.)	1"			[12.7]	[66.8]								
YGLR29C100	thru	thru	thru	[25.4]					_		U997 (1)		U997 (1)		U997 (1)	
	250 kcmil (.575 Dia.)	120 mm² (14.40mm Dia.)	248.8 kcmil (.572 Dia.)	[23.4]												
	250 kcmil (.575 Dia.)	120 mm <sup>2</sup> (14.40mm Dia.)	248.8 kcmil (.572 Dia.)	1"						-	U1011 (2)		U1011 (2)		U1011 (2)	
YGLR34C100	thru	thru	thru	[25.4]							or		or		or	
	500 kcmil (.813 Dia.)	240 mm² (20.35mm Dia.)	498.8 kcmil (.810 Dia.)	[23.4]							PU998 (1)		PU998		PU998	

#### NOTES:

- Before crimping, both connector elements can be turned on rod diameter 'D' to any desired position.
- 2. Grooves are filled with PENETROX $^{\text{TM}}$ .
- 3. Suitable for direct burial in earth or concrete.
- 4. The catalog numbers shown are for unplated copper connectors for use on copper clad or stainless steel ground rod. To order electro-tin plated connectors for use on galvanized steel ground rod add suffix "TN" to the catalog number, only if the Figure 8 connector (Element "B") is tin plated, the Figure 6 connector (Element "A") is unplated. Note: The ground rod hole diameter is larger for galvanized steel ground rod in the tin plated connector.
- 5. Ground rod must be pre-crimped with die U2CABT (Index No. 348) when crimping the ground rod element (Element "B") with the PU998 dies in the Y750, Y35, Y39, Y45, or Y46 tools. Pre-crimping is not required when the S1012, P1011 or U1011 dies are used. See precrimp die chart.
- Where a 'U' or 'PU' die is recommended with the Y45 HYPRESS™, a PT6515 adapter must be used.
- 7. Where a 'U' or 'PU' die is recommended with the Y46 HYPRESS™, a PUADP-1 adapter must be used
- 8. Dimensions in bracket [ ] are in millimeters.
- 9. Die "1011" appears on Element "B" of the connector only.

Ground Rod		
Dia.	PRECRIMP	Dies
1/2"	UPRECRIMP 12	
5/8"	UPRECRIMP 58	U2CABT
3/4"	UPRECRIMP 34	

When attaching connector to ground rod, ground rod must be embossed with appropriate PRE-CRIMP™ die. For connections that must meet IEEE 837 requirements UPRECRIMP - type PRE crimp dies must be used for maximum clamping retention.


#### **TYPE YGHP-C**


#### **HYTAP™ CONNECTOR**

Irreversible compression ground tap figure 6 can be used as a tap connector or as a tap splice connector. Four die sets and eight connectors can accommodate a conductor range from #8 solid through 500 kcmil plus 1/2", 5/8", and 3/4" copper bonded ground rods. UL467 Listed. Acceptable for direct burial in earth and concrete. Prefilled with PENETROX™ compound and strip sealed.



✓ UL96 Listed for Lightning Protection.

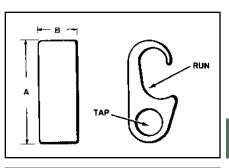



**IEEE-837** 







										Installatio	n Data	
					(5)		Die	Y750/Y35		3	4	
Catalog	Fig.	Accomm	odates	Cal	ble To Rebar		Index	Y39		Y45	Y46	No. of
Number	No.	Run	Тар	Run	Тар	В	No.	HYPRESS™	PAT750-18V	HYPRESS™	HYPRESS™	Crimps
YGHP2C2	1	#6 Sol. (0.162) {59500} – #2 Str. (0.292) {59500}	① #6 Sol. (0.162) {#2 Str.} – #2 Str. (0.292) {#2 Str.}	_	_			UO	110	UO	UO	
YGHP2C6W6W®	2	#6 Sol. (0.162) – #2 Str. (0.292)	#8 Sol. (0.128) – 6 Str. (0.184) Qty. 2	_	_		0	00	U0	00	UU	1
YGHP29C6W6W®	2		#8 Sol. (0.128) – 6 Str. (0.184) Qtr. 2	#3 Rebar	#8 Sol. – 6 Str.							
YGHP29C2	1	1/0 Str. (0.372) {98500} –	#4 Sol. (0.204) {#4 Sol.} – #2 Str. (0.292) {#2 Str.}	3/8	#2 Str.		997	U997	⑦ U997P	U997	U997	1
YGHP29C26	1	250 kcmil (0.575) {131500} 1/2" – 5/8" Rod	1/0 Str. (0.372) {98500} – 2/0 Str. (0.419) {98500}	thr0ugh 1/2	1/0 Str. – 2/0 Str.	.75 [19]	997					
YGHP29C29 ②	1		3/0 Str. (0.470) {131500} – 250 kcmil (0.575) {211500}	#4 Rebar	3/0 Str. – 250 kcmil							
YGHP34C2 ⑥	1	250 komil (0 575) (250 komil)	#4 Sol. (0.204) – #2 Str. (0.292)	#5 Rebar 5/8	_							
YGHP34C26 ©	1	250 kcmil (0.575) {250 kcmil} – 500 kcmil (0.813) {500 kcmil}	1/0 Str. (0.372) {98500} – 2/0 Str. (0.419) {98500}	3, 5	1/0 Str. – 2/0 Str.		998	PU998	PU998	PU998 or S998	PU998 or P998	1
YGHP34C29 ⑥	1	5/8" – 3/4" Rod	3/0 Str. (0.470) {131500} – 250 kcmil (0.575) {211500}	through	3/0 Str. – 250 kcmil							
YGHP34C34 ⑥	1	250 kcmil (0.575) – 500 kcmil (0.813) 5/8" – 3/4" Rod	350 kcmil (0.681) – 500 kcmil (0.843)	#6 Rebar	350 kcmil – 500 kcmil	1.10 [28]	1011	©U1011	U1011	\$1011	P1011	3

Dimensions in brackets  $\{\ \}$  represent lightning protection conductors.

#### NOTES:

- ① When using #6 Sol. in tap, fold conductor double to improve fill in YGHP2C2.
- ② For YGHP29C29 when using 3/0 in tap, minimum run conductor is 2/0 Str.
- ③ Where a 'U' or 'PU' die is recommended with the Y45 HYPRESS™, a PT6515 adapter must be used.
- Where a 'U or 'PU' die is recommended with the Y45 HYPRESS™, a P-UADP-1 adapter must be used.
- ⑤ Clean rust and protective coatings from rebar before connector installation to provide a proper ground connection. Precrimping is not required.
- ⑤ These connectors can only be installed using the Y750, Y45 or Y46 HYPRESS™ with the recommended dies. These connectors can not be installed with the Y35 and Y39 HYPRESS™.
- Polarized die for the PAT750-18V.
- ® Not UL96/CSA.

Ground Rod		
Dia.	PRECRIMP	Dies
1/2"	UPRECRIMP 12	
5/8"	UPRECRIMP 58	U2CABT
3/4"	UPRECRIMP 34	

For increased rotational resistance on ground rods, pre-crimp ground rod with U2CABT die Index 348 or uprecrimp dies may be used for even greater rotation and vibration resistance on ground rods.

CABLE TO GROUND ROD CABLE TO REBAR CABLE TO CABLE FOR CONCRETE ENCASED ELECTRODE GROUNDING APPLICATIONS

#### TYPE YGHP-C

#### HYTAP™ CONNECTOR

High Strength Copper Irreversible Compression

#### **Ground Rod Tap Connector**


Type YGHP-C irreversible compression ground tap figure 6 can be used as a ground rod tap connector for both continuous run and tapping applications. An open groove allows ground rod to be connected to a continuous run or tap. The second groove is for a tap only. Prefilled with PENETROX™ E and strip sealed. UL467 Listed for direct burial in earth or concrete.









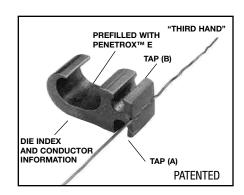

#### **Features and Benefits**

- Tap (A) accepts a continuous run on tap conductor
- Tap (B) accepts a tap conductor only.
- One connector style can be used for many applications, reducing number of connectors in inventory.
- Material is high conductivity wrought copper extrusion, identical material to the conductor.
  - High-conductivity copper minimizes resistance and voltage drop. Eliminates the possibility of corrosion due to dissimiliar metals.
- System engineered tooling.
- The tooling recommendation has been designed to ensure a reliable, dependable connection every time.
- The die index number is embossed on conductor after completion of crimp.
  - Faciliates speedy inspection of installed connectors to insure consistently reliable and dependable connections.

- Prefilled with PENETROX™ E and individually sealed in clear polyethylene sheet.
  - Ensures the electrical integrity of the finished connection by inhibiting moisture and contaminates from entering the contact area. Maintains long-term high-conductivity.
- UL467 Listed.
  - May be used in direct burial or concrete embedded grounding applications. Provides quality assurance to recognized industry NEC standards from an independent party.
- "Third Hand" constrains conductors while installer completes crimp. Included with each connector.
  - Simplifies installation, reducing installed cost.







**CONTINUOUS RUN** 



CONTINUOUS RUN AND TAP

							▲ Installation Tooling				
						Y35/Y7	750/PAT750	Y46	•		
Catalog	Ground		Di	mension	IS	Die	No. of	Die	No. of	Die	
Number	Rod Dia. ■	Tap Conductor +	Н	В	W	No.	Crimps	No.	Crimps	Index	
YGHP58C2W-2		#2 Sol #6 Sol. Copper									
YGHP58C2W-2TN	1/2" - 5/8"	(1) Continuous run and (1) Tap or up to (2) taps may be connected.	1.90"	.75″	.94"	U997	(1)	U997	(1)	997	

 $\textbf{NOTE:} \ A \ 12'' \ bend \ radius \ is \ recommended \ for \ the \ conductor.$ 

- Use PUADP-1 with 'U'-dies in Y46.
- ▲ See tooling section in Master Catalog for complete tool and die listing.
- + Either tap position may be left void when fewer than (2) conductors are used.
- Ground rod must be precrimped with die U2CABT (Index No. 348)
  - For even greater rotational resistance use UPRECRIMP
  - For Galvanized Steel Rods order YGHP58C2W-2TN.

## Grounding


HYGROUND® Compression

#### **TYPE YGHC-C**

#### **HYTAP™ CONNECTOR**

Irreversible compression ground tap figure "C" connectors. Accommodates all cable combinations from #6 solid through 500 kcmil. "C"- shaped opening permits placing two continuous parallel cables into conductor groove. UL 467 Listed. Acceptable for direct burial in earth or concrete. Prefilled with PENETROX™ compound and strip sealed. Certain sizes are also UL467 Listed and CSA Certified for wire to ground rod.

CS Direct

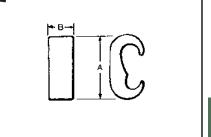

E-11

**IEEE-837** 







✓ UL96 Listed for Lightning Protection.

	Commercial Coppe	er Cable Range/						In	stallation Data		
Catalog	Ground F to Coppe	r Cable	Cable	d Copper Range			Die Index	Y750/Y35/ PAT750/Y39	① Y45	② Y46	No. of
Number	Run	Тар	Run	Тар	A	В	No.	HYPRESS™	HYPRESS™	HYPRESS™	Crimps
YGHC2C2	#6 Sol. (0.162) #2 Str. (0.292) 1/4" Rod ⑦	#6 Sol. (0.162) #2 Str. (0.292)	10 mm <sup>2</sup> (4.12 mm) 35 mm <sup>2</sup> (7.62 mm)	10 mm <sup>2</sup> (4.12 mm) 35 mm <sup>2</sup> (7.62 mm)	1.16 [30]	0.75 [19]	С	U-C	U-C	U-C	1
YGHC26C2	1 Str. (0.328) {98500} 2/0 Str. (0.419) {98500} 3/8" Rod ⑦	#6 Sol. (0.162) {#6 Sol.} #2 Str. (0.292) {#2 Str.}	35 mm <sup>2</sup> (7.62 mm) 70 mm <sup>2</sup> (10.9 mm)	10 mm <sup>2</sup> (4.12 mm) 35 mm <sup>2</sup> (7.62 mm)	1.41 [36]	0.75 [19]	0	U-0	U-0	U-0	1
YGHC26C26	1 Str. (0.328) {98500} 2/0 Str. (0.419) {98500} 3/8" Rod ⑦	1 Str. (0.328) {98500} 2/0 Str. (0.419) {98500}	35 mm <sup>2</sup> (7.62 mm) 70 mm <sup>2</sup> (10.9 mm)	35 mm <sup>2</sup> (7.62 mm) 70 mm <sup>2</sup> (10.9 mm)	1.54 [39]	0.75 [19]	0	U-0	U-0	U-0	1
YGHC29C26	3/0 Str. (0.470) {3/0 Str.} 250 kcmil (0.575) {250 kcmil} 1/2" or 5/8" Rod ⑦	2/0 Str. (0.419) {98500}	95 mm <sup>2</sup> (12.5 mm) 120 mm <sup>2</sup> (14.4 mm)	, ,	1.97 [50]	0.75 [19]	997	U997	U997	U997	1
YGHC29C29	3/0 Str. (0.470) 250 kcmil (0.575) 1/2" or 5/8" Rod ⑦	3/0 Str. (0.470) 250 kcmil (0.575)	95 mm <sup>2</sup> (12.5 mm) 120 mm <sup>2</sup> (14.4 mm)		2.06 [52]	0.88 [22]	997	U997	U997	U997	1
YGHC34C26 ®	300 kcmil (0.630) {300 kcmil} 500 kcmil (0.813) {500 kcmil} 3/4" Rod ⑦	#6 Sol. (0.162) {59500} 2/0 Str. (0.419) {98500}	150 mm <sup>2</sup> (16 mm) 240 mm <sup>2</sup> (20.35 mm)		2.42 [62]	0.88 [22]	1011	U1011	S1011	P1011	2
YGHC34C29 ®	300 kcmil (0.630) 500 kcmil (0.813)	250 kcmil (0.575)	240 mm <sup>2</sup> (20.35 mm)	95 mm <sup>2</sup> (12.5 mm) 120 mm <sup>2</sup> (14.4 mm)	2.67 [66]	0.88 [22]	1011	U1011	S1011	P1011	2
YGHC34C34 ®	300 kcmil (0.630) 500 kcmil (0.813)	300 kcmil (0.630) 500 kcmil (0.813)	150 mm <sup>2</sup> (16 mm) 240 mm <sup>2</sup> (20.35 mm)	150 mm <sup>2</sup> (16 mm) 240 mm <sup>2</sup> (20.35 mm)	2.91 [74]	1.1 [28]	1011	U1011	S1011	P1011	3

Dimensions in brackets  $\{\ \}$  represent lightning protection conductors.

#### NOTES:

- ① Where a "U" or "PU" die is recommended with the Y45 HYPRESS™, PT6515 adapter must be used
- ② Where a "U" or "PU" die is recommended with the Y46 HYPRESS™, a PUADP-1 adapter must be used.
- Listed under UL486A for copper wire connectors
- 4. Dimensions in brackets [ ] are in millimeters.
- In referencing connectors without PENETROX™
   oxide inhibitor add suffix "NP" to the end of the
   Catalog Number.
- ⑥ These connectors can only be installed using the Y750, Y45 or Y46 HYPRESS™ with the recommended dies.

These connectors cannot be installed with the Y35 and Y39 HYPRESS™.

⑦ Ground rod to copper cable is UL 467 Listed for direct burial in earth and concrete.

Ground Rod		
Dia.	PRECRIMP	Dies
1/2"	UPRECRIMP 12	
5/8"	UPRECRIMP 58	U2CABT
3/4"	UPRECRIMP 34	

Tor ground rod to wire applications, ground rod must be precrimped, see above table for appropriate precrimp dies.

#### **TYPE YGC**

#### **COPPER CRIMPIT™**

UL 467 Listed for direct burial in earth or concrete. Prefilled with PENETROX $^{\text{TM}}$  E2 oxide inhibitor.







Catalog	Copper Catalog Conductor							
Number	Run	Тар	Н	L	Index	OUR840	MD6/MD7	Crimps
YGC8C8	#8 Sol. #8 Str.	#8 Sol. #8 Str.	.46	.52	162	W162	W162	2
YGC6C8	#6 Sol. #6 Str.	#8 Sol. #8 Str.	.73	.62	BG	XBG	WBG	2
YGC6C6	#6 Sol. #6 Str.	#6 Sol. #6 Str.	.76	.62	BG	XBG	WBG	2

E- 12

#### **TYPE YSHG**

#### **HIGH STRENGTH COPPER IRREVERSIBLE COMPRESSION**

#### Double H-Tap Connector

Type YSHG Double H-Tap grounding series is comprised of five connectors designed to accommodate wire range sizes #14 through 500 kcmil, including ground rod sizes: 3/4", 1", and rebar sizes: #6, #8 and #9. Prefilled with PENETROX™ E2 and strip sealed.










#### **Features and Benefits**


- UL467 Listed.
- ♦ Suitable for direct burial in earth or concrete.
- Material is high conductivity copper extrusion.
  - ♦ Minimizes resistance, eliminates corrosion due to dissimilar metals.

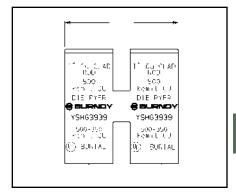

- $\bullet$  Grooves are prefilled with PENETROX  $^{\text{TM}}$  E2 oxide inhibitor and individually sealed.
- ♦ Inhibits moisture and contaminants ensuring electrical integrity.

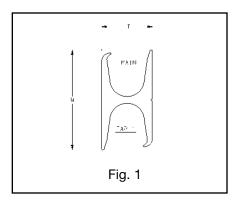

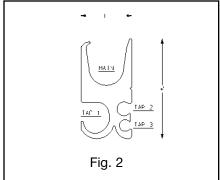

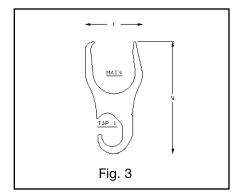

Catalog	Fig.	Conc	ductor Size	s			ooling er of crimps)	Index Emboss-	w	T	L
Number	No.	Main	Tap 1	Tap 2	Tap 3	PAT750/Y750	Y46	ment	±.06	$\pm .04$	±.06
YSHG4429	3	#9 & #8 Rebar, 1" [25] Ground Rod	250 - 2				PYFR (2)	K-R	3.22 [82]	1.70 [43]	2.44 [62]
* YSHG3931	2	#6 Rebar, 1" [25] Cu Clad Ground Rod, 3/4" Ground Rod 500 - 350 kcmil Copper	4/0 - 1/0	1 - 6	2 - 14		PYFR (2)	K-R	2.97 [75]	1.50 [38]	2.34 [59]
YSHG3434	1	#6 Rebar, 3/4" [19] Ground Rod 400 - 250 kcmil Copper	400 - 4/0			U1104 (4)	P1104 (2) †U1104 (4)	1104	2.43 [62]	1.15 [29]	2.44 [62]
YSHG3429	2	#6 Rebar, 3/4" [19] Ground Rod 400 - 4/0 kcmil Copper	3/0 - 1/0	1 - 4	8 - 14	U1104 (4)	P1104 (2) †U1104 (4)	1104	2.23 [57]	1.31 [33]	2.44 [62]

- \* NOTE: Not for use on 1" steel ground rod. † Use PUADP-1 adapter.


**TYPE YGHR-C** 

#### $HYTAIL^{\text{TM}}$

High Strength Irreversible Compression Ground Rod Tap Connectors

High torque strength ground rod connectors. Accommodates a wide range of copper conductors to ground rod. UL467 Listed. Acceptable for direct burial in earth or concrete. Prefilled with PENETROX™ compound and strip sealed.



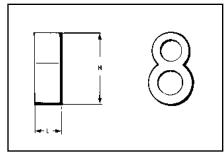







Catalog		
Number	Н	В
YGHR26C12	1.94" [49.3]	
YGHR26C58	1.97" [50.0]	
YGHR26C34	2.19" [55.6]	
YGHR26C100	2.55" [56.2]	
YGHR29C12	1.94" [49.3]	.88″
YGHR29C58	2.14" [54.4]	[22.4]
YGHR29C34	2.19" [55.6]	[22.4]
YGHR29C100	2.45" [62.2]	
YGHR34C58	2.14" [54.4]	
YGHR34C34	2.44" [62.0]	
YGHR34C100	2.70" [68.6]	

Catalog	Commercial Copper	Nominal Ground	Installation Tools, I	ools, Die Set Catalog Number (Number of Crimps)						
Number	Cable Range	Rod Dia.	PAT750/Y750/Y35/Y39 ①	Y45 HYPRESS ①	Y46 HYPRESS ①					
YGHR26C12		1/2" [12.7]		S1012 (2)						
YGHR26C58	#2 Str. (.292 Dia.)	5/8" [15.9]		4						
YGHR26C34	through	3/4" [19.0]		PU998 (1) ②						
YGHR26C100*	2/0 Str. (.419 Dia.)	1" [25.4]		S1011 (2) S1012 (2) PU998 (1)						
YGHR29C12		1/2" [12.7]	U1011 (2)	S1012 (2)	P1011 (2)					
YGHR29C58	#4/0 Str. (.528 Dia.)	5/8" [15.9]	4	<b>④</b>	4					
YGHR29C34	through	3/4" [19.0]	PU998 (1)	PU998 (1) ②	PU998 (1)					
YGHR29C100*	250 kcmil (.575 Dia.)	1" [25.4]		S1011 (2) S1012 (2) ④ PU998 (1)	3					
YGHR34C58	300 kcmil (.630 Dia.)	5/8" [15.9]	7	S1012 (2)						
YGHR34C34*	through	3/4" [19.0]		<sup>4</sup> PU998 (1) ②						
YGHR34C100*	500 kcmil (.813 Dia.)	1" [25.4]		S1011 (2)	P1011 (2)					

#### NOTES

- The catalog numbers shown are for unplated copper connectors for use on copper clad or stainless steel ground rod. To order electro-tin plated connectors for use on galvanized steel ground rod add suffix "TN" to the catalog number. Note: The ground rod hole diameter is larger for galvanized steel ground rod in the tin plated connector.
- ① Ground rod must be pre-crimped with die U2CABT (Index No. 348) when the PU998 dies are used in the Y750, Y35, Y39, Y45, or Y46 tools. Pre-crimping is not required when the P1011, S1011, S1012 or U1011 dies are used. UPRE-CRIMP dies may be used for additional mechanical resistance on ground rods.
- ② Where a PU998 die is recommended with the Y45 HYPRESS™, a PT6515 adapter must be used.
- ③ Where a PU998 die is recommended with the Y46 HYPRESS™, a PUADP-1 adapter must be used.
- These die numbers do not appear on the connector.
- These connectors can only be installed using the Y750, Y45 or the Y46 HYPRESS™ with the recommended dies. These connectors CAN NOT be installed with the Y35 and Y39 HYPRESS™. When attaching connector to ground rod, ground rod must be embossed with appropriate PRE-CRIMP™ die. For connections that must meet IEEE 837 requirements UPRECRIMP type PRE crimp dies must be used for maximum clamping retention.

Blue highlighted items are industry standard and most frequently ordered.

Canada: 1-800-387-6487 www.burndy.com US: 1-800-346-4175

#### TYPE YGHR-C

#### **HYTAIL**<sup>TM</sup>

#### High Strength Irreversible Compression Ground Rod **Tap Connectors**

Type YGHR-C irreversible compression grounding connector is engineered specifically for the Telecommunications Industry for (1, 2 or 3) #2 solid, tinned or bare conductor taps. UL467 Listed. Acceptable for direct burial in earth or concrete. BURNDY® has designed this connector to meet the stringent requirements of OSHA, the National Electric Code (NEC), UL, and the Telecommunications Industry. Performance and long life are this connector's basic design guidelines.










TAP



#### **Features and Benefits**


- Tap side 1, 2 or 3 conductors.
  - ♦ One connector style can be used for many applications.
- Material is high conductivity wrought copper extrusion, identical material to the conductor.
  - High-conductivity copper minimizes resistance and voltage drop. Eliminates the possibility of corrosion due to dissimilar metals.
- · System engineered tooling.
  - ♦ Each tooling recommendation has been designed to provide a reliable, dependable connection.

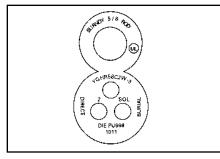

E-15

- The die index number is embossed on connector after completion of crimp.
  - ♦ Facilitates speedy inspection of installed connectors to ensure consistently reliable and dependable connections.
- Prefilled with PENETROX™ and individually sealed in clear polyethylene sheet.
  - ♦ Ensures the electrical integrity of the finished connection by inhibiting moisture and contaminates from entering the contact area. Maintains long-term high-conductivity.
- UL 467 Listed. Acceptable for direct burial.
- May be used in direct burial or concrete embedded grounding applications. Provides quality assurance to recognized industry NEC standards from an independent party.



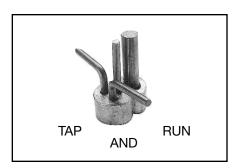

				Installation	Tooling			
			PAT750/Y	35/Y750**	Y46 <sup>*</sup>	•		
Catalog	<b>Ground Rod</b>		Die	No. of	Die	No. of	Die	
Number +	Diameter •	Tap Conductor $lacktriangle$	No.	Crimps	No.	Crimps	Index	
			PU998†	(1)	PU998†	(1)		
YGHR58C2W-3	5/8″	#2 Sol. Copper 1, 2, or 3 may be connected	F09901	(1)	U1011	(2)	998 or	
TURNOUZW-S	3/0		U1011	(2)	P998	(1)	1011	
			01011	(2)	P1011	(2)		

- Contact BURNDY® for other ground rod diameters. PU998 and U1011 die sets require PUADP-1 adapter for use in the Y46 HYPRESS™.
- Tap positions may be left void when fewer than (3) conductors are used.
- + To order electro-tin plated connector for use on galvanized steel ground rod add suffix -"TN" to the catalog number.

  NOTE: The ground rod hole diameter is larger for galvanized steel ground rod in the tin plated connector.
- † Ground rod must be precrimped with die U2CABT (Index No. 348) when PU998 die set is used in the Y35, Y750 or
- HYPRESS™ tools. For even greater mechanical resistance use UPRECRIMP 58 dies.
- \*\* The Y750 utilizes PU dies and the U1011 die. The Y35

only uses PU998 die set. NOTE: A 12" bend radius is recommended for the conductor.


#### TYPE YGHA

#### **HYLUG™**

## Heavy Duty Irreversible Compression Terminals

Heavy duty HYLUG™ irreversible compression terminals designed not only to carry short circuit load, but to also withstand high mechanical stress. Each conductor element has an inspection probe hole to ensure proper cable insertion. UL467 Listed. Acceptable for direct burial in earth or concrete. UL486A Listed. Prefilled with PENETROX™ compound and strip sealed.



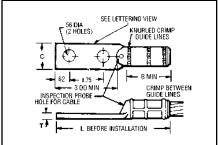





**IEEE-837** 



Catalog Number	Copper Conductor Size	Installation Tools, Die Set Catalog Number, and (Number of Crimps) HYPRESS™ Y35/Y39/Y45 ① /Y46 ② /Y750 /PAT750	В	С	L	т
YGHA2C-2N	2 str.	U1CRT (1)	.75	.97	4.21	.26
YGHA25-2N	1/0 str.	U27RT (1)	.83	.91	4.60	.19
YGHA26-2N	2/0 str.	U28RT (1)	.83	.97	4.38	.26
YGHA27-2N	3/0 str.	U29RT (1)	1.18	1.08	4.94	.29
YGHA28-2N	4/0 str.	U30RT (2)	1.18	1.22	4.94	.30
YGHA29-2N	250 kcmil	U31RT (2)	1.18	1.28	4.94	.34
YGHA31-2N	350 kcmil	U34RT (2)	1.18	1.62	5.00	.43
YGHA34-2N	500 kcmil	U36RT (3)	1.48	1.72	5.42	.40

① Where a "U" or "PU" die is recommended with the Y45 HYPRESS™, a PT6515 adapter must be used.


#### TYPE YGHS

#### **HYLINK**<sup>TM</sup>

## Heavy Duty Irreversible Compression Terminals

Heavy duty HYLINK™ ground splice designed not only to carry short circuit load, but to also withstand high mechanical stress. Each conductor element has an inspection probe hole and a center stop to ensure proper cable insertion. UL467 Listed. Acceptable for direct burial in earth or concrete. UL486A Listed. Prefilled with PENETROX™ compound and strip sealed.



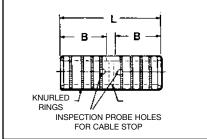







Catalog Number	Copper Conductor Size	Installation Tools, Die Set Catalog Number, and (Number of Crimps) HYPRESS™ Y35/Y39/Y45 ① /Y46 ② /Y750 /PAT750	В	L
YGHS2C	2 str.	U1CRT (1)	.75	1.73
YGHS25	1/0 str.	U27RT (1)	.83	1.89
YGHS26	2/0 str.	U28RT (1)	.83	1.89
YGHS27	3/0 str.	U29RT (1)	1.18	2.59
YGHS28	4/0 str.	U30RT (2)	1.18	2.59
YGHS29	250 kcmil	U31RT (2)	1.18	2.59
YGHS31	350 kcmil	U34RT (2)	1.18	2.59
YGHS34	500 kcmil	U36RT (3)	1.48	3.19

① Where a "U" or "PU" die is recommended with the Y45 HYPRESS $^{\text{TM}}$ , a PT6515 adapter must be used.

② Where a "U" or "PU" die is recommended with the Y46 HYPRESS™, a PUADP-1 adapter must be used.

② Where a "U" or "PU" die is recommended with the Y46 HYPRESS™, a PUADP-1 adapter must be used.

#### E-17

#### **TYPE YGA**

#### HYLUG™

## Grounding Irreversible Compression Terminals


Irreversible compression HYLUG™ Ground terminal specifically designed for grounding applications. Each connector has an inspection probe hole to ensure proper cable insertion. UL467 Listed. Acceptable for direct burial in earth or concrete. UL486A Listed. Prefilled with PENETROX™ compound and strip sealed.









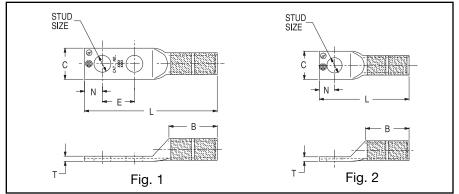

				Installation Tools, Die Set Cat. No., and								
					(number of	crimps)						
				Mechanical		Hydraulic						
						Y35/Y39/Y45/PAT750 ①						
		Copper	Y2MR	MD7-34R	OUR840	/Y46 ② /Y750						
Catalog	Fig.	Conductor	Die # (# of	Die # (# of	Die # (# of	Die # (# of	Stud					
Number	No.	Size	crimps)	crimps)	crimps)	crimps)	Size	В	C	L	T	E
YGA8C-TC10	2	8 sol./8 str.	Red (4)		VT (2) RT (2)	U8CRT (2)	#10	.81	.41	1.57	.08	_
YGA8C-TC14	2	8 sol./8 str.	Red (4)		VT (2) RT (2)	U8CRT (2)	1/4	.81	.44	1.69	.08	_
YGA8C-TC516	2	8 sol./8 str.	Red (4)	X8CF	VT (2) RT (2)	U8CRT (2)	5/16	.81	.51	1.75	.06	_
YGA8C-2N	1	8 sol./8 str.	Red (4)	X8CF	VT (2) RT (2)	U8CRT (2)	1/2	.81	.71	4.09	.05	1.75
YGA6C-TC10	2	6 sol./6 str.	Blue (4)		VT (2) RT (2)	U5CRT (2)	#10	1.12	.42	1.89	.09	_
YGA6C-TC14	2	6 sol./6 str.	Blue (4)	W5CVT (2)		U5CRT (2)	1/4	1.12	.45	2.02	.08	_
YGA6C-TC516	2	6 sol./6 str.	Blue (4)		VT (2) RT (2)	U5CRT (2)	5/16	1.12	.51	2.08	.07	_
YGA6C-2TC38E2G1	1	6 sol./6 str.	Blue (4)		VT (2) RT (2)	U5CRT (2)	3/8	1.12	.58	3.42	.06	.75
YGA6C-2N	1	6 sol./6 str.	Blue (4)		VT (2) RT (2)	U5CRT (2)	1/2	1.12	.83	4.40	.12	1.75
YGA2C-2TC38	1	2 sol./2 str.	Brown (4)		VT (2) RT (2)	U2CRT (2)	3/8	1.25	.60	3.48	.12	1.00
YGA2C-2N	1	2 str.	Brown (4)		VT (2) RT (2)	U2CRT (2)	1/2	1.22	.81	4.71	.12	1.75
YGA25-2N	1	1/0 str.	_		VT (4) RT (4)	U25RT (2)	1/2	1.35	.81	4.91	.12	1.75
YGA26-2N	1	2/0 str.	_	W26'	VT (4) RT (4)	U26RT (2)	1/2	1.45	.81	4.89	.12	1.75
YGA28-2N	1	4/0 str.	_		VT (4) RT (4)	U28RT (2)	1/2	1.57	1.00	5.06	.14	1.75
YGA29-2N	1	250 kcmil	_	— W29VT (4)		U29RT (2)	1/2	1.57	1.09	5.16	.16	1.75
YGA34-2N	1	500 kcmil	_	W34'	VT (4)	U34RT (4)	1/2	2.20	1.52	5.94	.23	1.75

① Where a "U" or "PU" die is recommended with the Y45 HYPRESS<sup>TM</sup>, a PT6515 adapter must be used.

② Where a "U" or "PU" die is recommended with the Y46 HYPRESSTM, a PUADP-1 adapter must be used.


#### **TYPE YGS**

#### **HYLINK**<sup>TM</sup>

#### Grounding Irreversible **Compression Splices**

Irreversible compression HYLINK™ ground splices specifically designed for grounding applications. Each conductor element has an inspection probe hole and a center stop to ensure proper cable insertion. UL467 Listed. Acceptable for direct burial in earth or concrete. UL486A Listed. Prefilled with  $\label{eq:penergy} \mathsf{PENETROX^{TM}} \ \mathsf{compound} \ \mathsf{and} \ \mathsf{strip} \ \mathsf{sealed}.$ 



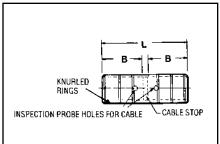







			Mechanical		Hydraulic				
	Copper	Y2MR	MD7-34R		Y35/Y39/Y45①				
Catalog	Conductor	Die # (# of			/Y46 <sup>2</sup> /Y750/PAT750				
Number	Size	Crimps)	Crimps)	Crimps)	Die # (# of Crimps)	В	L		
YGS8C	#8 sol./str.	_	X8CRT, W8CRT, W8CVT ③		X8CRT, W8CRT, W8CVT ③		U8CRT (2)	.78	1.75
YGS6C	#6 sol./str.	_	X5CRT, W5CRT, W5CVT ③		U5CRT (2)	1.09	2.38		
YGS2C	2 str.	Brown (4)		VT (2) RT (2)	U2CRT (2)	1.22	2.67		
YGS25	1/0 str.	_		VT (4) RT (4)	U25RT (2)	1.35	2.97		
YGS26	2/0 str.	_		VT (4) RT (4)	U26RT (2)	1.45	3.13		
YGS28	4/0 str.	_	W28VT (4) X28RT (4)		U28RT (2)	1.57	3.37		
YGS29	250 kcmil	_	W29	VT (4)	U29RT (2)	1.57	3.37		
YGS34	500 kcmil	_	W34VT (4)	_	U34RT (4)	2.20	4.63		

① Where a "U" or "PU" die is recommended with the Y45

Canada: 1-800-387-6487

Where a "0" or "PU" die is recommended with die 145 HYPRESS™, a PT6515 adapter must be used.

② Where a "0" or "PU" die is recommended with the Y46 HYPRESS™, a PUADP-1 adapter must be used.


③ Use "X" with OUR840, "W" with MD6/MD7.

#### **TYPE YGF**

#### **GROUNDING PLATE**

The irreversible compression ground plate is designed to withstand the rigors of concrete construction. The ground plates are made of high strength, high-conductivity cast copper alloy body with a pure wrought copper compression element. In addition to the tapped NEMA size holes and spacing on the face, the plate comes with a tapped hole on the underside for ease of positioning prior to pouring the concrete. UL467 Listed. Acceptable for direct burial in earth or concrete. Prefilled with PENETROX™ compound and strip sealed.



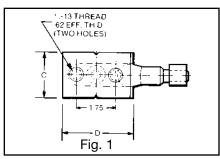


E-19





**IEEE-837** 



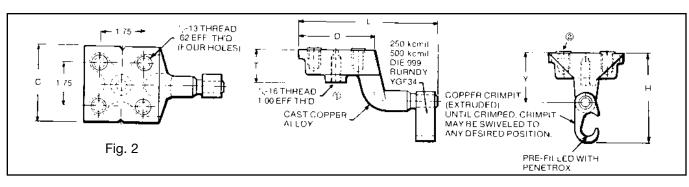

Catalog Number	Fig. No.	С	D	Н	L	Т	Y
YGF29-2N	1	2.00	3.25	3.62	5.78	1.31	2.00
YGF29-4N	2	3.25	3.25	3.62	5.78	1.31	2.00
YGF34-2N	1	2.00	3.25	4.62	5.40	1.31	2.19
YGF34-4N	2	3.75	3.75	4.62	5.90	1.31	2.19

#### NOTES

- ① This tapped hole may be used to position the grounding plate on a threaded rod prior to placement of the concrete.
- 3/8-16 thread with 1.00 EFF. Thread is standard. If other thread is required, add appropriate Code No. to Catalog No. for desired thread.
  - -50 (1/2 -13, .94 EFF. Thread), -62 (5/8 -11, .94 EFF. Thread) and -75 (3/4 -10, .81 EFF. Thread)
  - Example: YGF34-4N-50 is YGF34-4N with 1/2 -13 Thread
- ② Plastic plugs are provided to keep dirt out of the threaded holes until the attachment of grounding terminals.

			Installation Tools, Die Set Cat. No., and (number of crimps)					
Catalog	Copper	Ta	apped Holes	HYPRESS™				
Number	Conductor Range	Size	Hole Centers	PAT750/Y750/Y35/Y39	Y45 ①	Y46 ②		
YGF29-2N	2 - 250 kcmil	1/2 - 13	1-3/4	U997 (1)	U997 (1)	U997 (1)		
YGF29-4N	2 - 250 kcmil	1/2 - 13	1-3/4	U997 (1)	U997 (1)	U997 (1)		
YGF34-2N*	250 - 500 kcmil	1/2 - 13	1-3/4	U1011 (3)	S1011 (2)	P1011 (2)		
YGF34-4N*	250 - 500 kcmil	1/2 - 13	1-3/4	U1011 (3)	S1011 (2)	P1011 (2)		


#### ORDERING INFORMATION

- ① Where a "U" or "PU" die is recommended with the Y45 HYPRESS™, a PT6515 adapter must be used.
- ② Where a "U" or "PU" die is recommended with the Y46 HYPRESS™, a PUADP-1 adapter must be used.
- \* These connectors can only be installed using the Y750, Y45 or Y46 HYPRESS™ with recommended dies. These connectors CAN NOT be installed with the Y35 or Y39 HYPRESS™.

#### **TYPE YGIB**

#### GROUNDLINK™ CONNECTOR

An irreversible compression ground connection which allows attachment to a structural steel standard (angled) or wide flange (parallel) beam. Installed with a required 5-piece die set, Catalog PIBEAMKIT or UIBEAMKIT. Die index 1105. GROUNDLINK™ connectors are made of high-conductivity wrought copper and come pre-filled with PENETROX™ E compound and strip sealed. Order terminal mounting hardware separately.

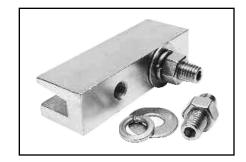








**IEEE-837** 





Connector shipped with thread protection studs only. Order TMHG kits separately.  $\label{eq:connector} % \begin{center} \beg$ 

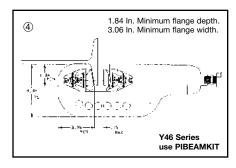

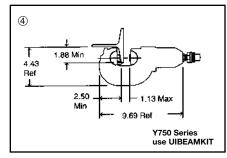

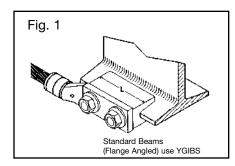

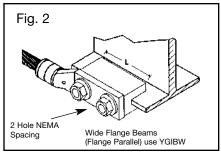

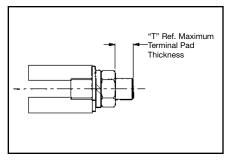

#### **TERMINAL MOUNTING HARDWARE**

Catalog Number	"T"
TMHG-42	.42
TMHG-92	.92

NOTE: Use TMHG-92 to double stack lugs.

#### NOTES:

- Terminal conector to be ordered separately. When Ibeam connector is used with type "YGHA" terminal, the connection meets IEEE 837-1989 requirements. YGA-2N, YA-2N and other BURNDY® 2-hole NEMA copper terminals are suitable.
- 2. Order "TMHG" Terminal Mounting Hardware Kit separately. Kit consists of 2 studs, 2 flat washers, 2 lockwashers and 2 hex nuts.
- Using the 1/4 hex key wrench, screw the stud into the connector until stud bottoms out in connector. Install a "YGHA" terminal, flat washer, lockwasher and hex nut onto stud. Tighten and torque to 480 pound-inches.
- Dimensions shown reflect the minimum dimensions required on a beam to properly install the I-beam connector.
- To correctly determine the appropriate YGIB connector to use based on flange thickness, order either YGIBGAUGE1 or YGIBKIT1 (KIT1 contains wiremike).

#### E-21

#### **TYPE YGIB**

(Continued)

#### GROUNDLINK™ CONNECTOR

Copper Conductor		Fig.			i-Beam Flange	Suggested Terr	ninals	
Range	Catalog Number	No.	"L"	"J"	Thickness	Copper Conductor	Terminal	"T" Ref.
			0.00			#2 Str. AWG	YGHA2C-2N	.26
0 4/0 414/0	YGIBS28-338-2N	1	3.00		550"	1/0 Str. AWG	YGHA25-2N	.19
2 - 4/0 AWG	VOIDWOO OOO ON	_	0.00		.250" - to -	2/0 Str. AWG	YGHA26-2N	.26
	YGIBW28-338-2N	2	3.00		.338″	4/0 Str. AWG	YGHA28-2N	.30
250 - 500 kcmil	YGIBS34-338-2N	1	6.00			250 kcmil	YGHA29-2N	.34
250 - 500 KCITIII	YGIBW34-338-2N	2	6.00			500 kcmil	YGHA34-2N	.40
	YGIBS28-400-2N	1	2.00			#2 Str. AWG	YGHA2C-2N	.26
2 - 4/0 AWG	1 UID320-400-2N	'	3.00		.338″	1/0 Str. AWG	YGHA25-2N	.19
2 - 4/0 AWG	YGIBW28-400-2N	2	3.00		.336 to	2/0 Str. AWG	YGHA26-2N	.26
	1 GIDWZ0-400-ZIV		3.00		.400"	4/0 Str. AWG	YGHA28-2N	.30
250 - 500 kcmil	YGIBS34-400-2N	1	6.00			250 kcmil	YGHA29-2N	.34
230 - 300 KCIIII	YGIBW34-400-2N	2	0.00			500 kcmil	YGHA34-2N	.40
	YGIBS28-462-2N	1	3.00		.400"	#2 Str. AWG	YGHA2C-2N	.26
	101D320-402-2N	'	3.00			1/0 Str. AWG	YGHA25-2N	.19
2 - 4/0 AWG	YGIBW28-462-2N	2	3.00	1/2 - 13	to -	2/0 Str. AWG	YGHA26-2N	.26
	1 GIDW20-402-2N		3.00		.462"	4/0 Str. AWG	YGHA28-2N	.30
250 - 500 kcmil	YGIBS34-462-2N	1	6.00		.402	250 kcmil	YGHA29-2N	.34
	YGIBW34-462-2N	2	0.00			500 kcmil	YGHA34-2N	.40
	YGIBS28-550-2N	1	3.00		4.62"	#2 Str. AWG	YGHA2C-2N	.26
2 - 4/0 AWG	Tuibozo 330 Ziv	'	5.00			1/0 Str. AWG	YGHA25-2N	.19
2 - 4/0 AWG	YGIBW28-550-2N	2	3.00		to -	2/0 Str. AWG	YGHA26-2N	.26
			0.00		.550"	4/0 Str. AWG	YGHA28-2N	.30
250 - 500 kcmil	YGIBS34-550-2N	1	6.00		.550	250 kcmil	YGHA29-2N	.34
230 300 Killiii	YGIBW34-550-2N	2	0.00			500 kcmil	YGHA34-2N	.40
	YGIBS28-613-2N	1 1	3.00			#2 Str. AWG	YGHA2C-2N	.26
2 - 4/0 AWG	Tuibozo 010 Zit	'	3.00		.550"	1/0 Str. AWG	YGHA25-2N	.19
2 4/0 AWG	YGIBW28-613-2N	2	3.00		to	2/0 Str. AWG	YGHA26-2N	.26
						4/0 Str. AWG	YGHA28-2N	.30
250 - 500 kcmil	YGIBW34-613-2N	2	6.00			500 kcmil	YGHA34-2N	.40
	YGIBS28-675-2N	1 1	3.00		[	#2 Str. AWG	YGHA2C-2N	.26
2 - 4/0 AWG	. GIDOLO OTO LII	'	0.00		.613"	1/0 Str. AWG	YGHA25-2N	.19
	YGIBW28-675-2N	2	3.00		to	2/0 Str. AWG	YGHA26-2N	.26
			0.00		.675"	4/0 Str. AWG	YGHA28-2N	.30
250 - 500 kcmil	YGIBS34-675-2N	1	6.00		.0,0	250 kcmil	YGHA29-2N	.34
200 000 1011111	YGIBW34-675-2N	2	0.00			500 kcmil	YGHA34-2N	.40


#### **TYPE GSTUD-HY**

#### **VERSITAIL™**

Structural Steel Grounding Connector

#### **INSTALLATION**

- Weld the VERSITAIL<sup>™</sup> to the steel member.
- 2. Select the proper connector for your specific application.
  - a. FOR COMPRESSION CONNECTORS Select the proper BURNDY® "YGHP," connector. Clean the conductor, join the VERSITAIL™ and the grounding conductor together with the recommended tool and die set, then crimp the connector over the knurled area of the VERSI-TAIL™.
  - b. FOR MECHANICAL CONNECTORS Select the properly sized BURNDY® connector. Clean the conductor, then apply PENETROX™ E oxide inhibiting compound on the contact area for increased effectiveness and service life. Put the connector over the knurled area of the VERSITAIL™ and apply the recommended torque value for correct installation.

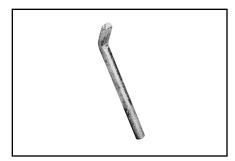

#### **FEATURES**

- The VERSITAIL<sup>™</sup> may be welded to steel surfaces quickly and easily with normal construction equipment.
- The VERSITAIL™ eliminates costly disk grinding and the need to expose virgin metal. The welding process burns through the oxidation and "scale" to establish excellent electrical grounding continuity.
- The VERSITAIL™ may be installed by the welder in the field or at the steel fabricator based on customer preference.
- The VERSITAIL<sup>™</sup> pure copper coating over low carbon, hot rolled steel is compatible with standard welding processes. No toxic gasses are generated.
- The VERSITAIL™ knurled surface is copper plated and specifically designed to ensure excellent mechanical gripping and electrical integrity for BURNDY® compression and mechanical connectors in all grounding applications.
- The VERSITAIL™ may be installed during adverse weather conditions thus eliminating costly construction delays.

#### **BENEFITS**


Low installation cost.

- No drilling . . . No cleaning . . .
- No special preparation



#### SPECIFICATIONS

- Low Carbon, hot rolled steel.
- Pure copper plated finish.

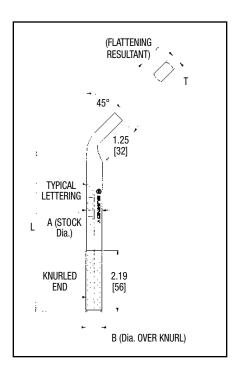

	Nom.		Dimen	sions		Electrical Equivalent Copper
Catalog	Rod	Α	В	L	T	Conductor Size
Number	Size	In. [mm]	In. [mm]	In. [mm]	In. [mm]	(AWG)*
GSTUD14HY	1/4"	.25 [6.3]	.26 [6.6]	4.81 [122.2]	.19 [4.8]	#6
GSTUD38HY	3/8"	.38 [9.7]	.39 [9.9]	5.81 [147.6]	.25 [6.4]	#3
GSTUD916HY	5/8"	.56 [14.2]	.57 [14.5]	5.68 [144.3]	.38 [9.7]	1/0
GSTUD34HY	3/4"	.75 [19.0]	.76 [19.3]	5.81 [147.6]	.51 [13.0]	4/0


<sup>\*</sup> This is the equivalent rating for continuous service. Larger conductors may be connected using both compression and bolted connectors in potential ground fault applications.

#### **TYPES YGT & YTTAG**

## STATIC GROUNDING RECEPTACLE

Type YGT static grounding receptacles are designed for static grounding of equipment. The receptacle is connected to the ground grid with HYGROUND® compression connectors and finished flush with surface to provide a permanent corrosion proof grounding point.



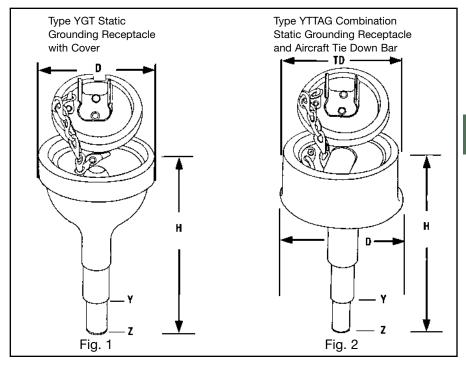

Catalog	Figure						
Number	Number	* HYGROUND® Connector	H	D	Y Dia.	Z Dia.	TD
YGT275	1	Select suitable YGHR or	5.5	2.75	.75	.56	_
YTTAG388	2	YGLR for 3/4" ground rod and sized to ground conductor.	6.5	4.75	.75	.56	4.3

<sup>\*</sup> When using U or PU dies with Y46 HYPRESS™, a PUADP-1 adapter is required.


#### NOTES:

- Ground rod must be pre-crimped with U2CABT die set when PU998 die is used or for even higher mechanical resistance use special UPRECRIMP dies on ground rods.
- Pre-crimping of ground is not necessary when P1011 die is used. Install YGHR or YGLR on hub Y. Hub Z is inserted into 1/2" rigid conduit. The conduit is driven into earth to provide support and provide correct level of receptacle prior to cement pour.

#### **TYPE YG-B**

#### **BUS BAR CONNECTOR**


BURNDY's YG14B2TC2C6C Compression Bus Bar Connector is ideally suited for cellular tower applications and is easier to use than exothermic connections. This high conductivity wrought copper connector allows attachment of the ground conductor to the ground bus with just one crimp using the BURNDY® Y750 HYPRESS™ Hydraulic Compression tool and the U1105 die set. This exclusive patent pending design allows the user to attach #2 AWG sol./str. and/or #6 sol./str. copper conductor to 1/4" thick copper bus bar. This connection is suitable using (1) or (2) conductors for power, grounding and bonding applictions. UL Listed to both UL486 and UL467 (suitable for direct burial) ensures that this connector will meet the rigors of either application. Prefilled with PENE-TROX™ E compound and strip sealed.

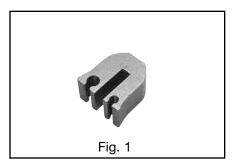










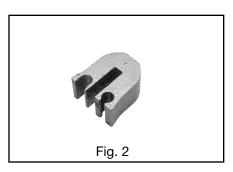

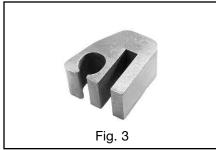

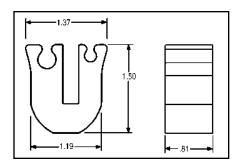

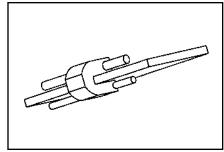

Catalog Number	Fig No.	Ground Bar Thickness	Bus Bar Tap Conductors	Tooling	Installation Die No.	No. of Crimps
YG14B2TC2C6C	1	1/4"	#2 Sol./and/or Str. Copper #6 Sol./and/or Str. Copper	PAT750, Y750	U1105	1
YG14B2TC2C2C*	2	1/4"	#2 #2	PAT750, Y750	U1105	1
YG14BTC28	3	1/4"	4/0 AWG Str. to 1/0 AWG Str. Copper	PAT750, Y750	U1105	1

**NOTE:** Suitable for use with either (1) or (2) conductors (excluding YG14BTC26 and YG14BTC28).

<sup>\*</sup> For continuous uncut conductor applications.

#### **MECHANICAL GROUNDING CONNECTORS**

More than 60 years of technological innovation has made BURNDY® mechanical grounding connectors one of the most widely used, highly respected lines in the industry. There is virtually no grounding application problem that this diversified line cannot help solve.

All BURNDY® mechanical grounding connectors have been designed for easy installation and for outstanding durability. Only the finest high copper alloys are used in their manufacture, ensuring top performance under the most extreme environmental conditions.

UL467 Listed for direct burial applications in earth or concrete.

E-25

#### **TYPES KC, K2C**

#### **SERVIT POST™**

#### For Copper Cable to Flat


SERVIT POST™ used to ground one or two cables to steel structures, fence posts, transformers. Also used to tap one or two cables from bus bar. One-wrench installation.









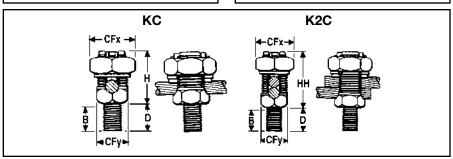

Catalog Nun	nber	Cond	uctor	Stud							
Type KC †	Type K2C ‡	Stranded	Solid	Diameter	В	CFx	CFy	D	Н	НН	
KC15	K2C15	10.0	10 0	1/4 00	3/8	1/0	0/0	1/2	F/0	7/0	
KC15B1	K2C15B1	12 - 9	12 - 8	- 8 1/4 - 20	7/8	1/2	3/8	1	5/8	7/8	
KC17	K2C17	10. 7	10 6	1/4 - 20	3/8	5/8	7/16	1/2	7/8	4	
KC17B1	K2C17B1	10 - 7	10 - 6		7/8		7/16	1	1/0	'	
KC20	K2C20	10 5	10 4	F/10 10	13/32	11/10	1/0	5/8	7/0	1 1/0	
KC20B1	K2C20B1	10 - 5	10 - 4	5/16 - 18	27/32	11/16	1/2	1	7/8	1-1/8	
KC22	K2C22	10.0	10 0	0/0 10	15/32	0/4	F /O	5/8	4	1-1/4	
KC22B1	K2C22B1	10 - 3	10 - 2	3/8 - 16	31/32	3/4	5/8	1-1/8	ı	1-1/4	
KC23	K2C23	0 0	8 - 2	10 - 1	3/8 - 16	15/32	13/16	5/8	5/8	1	1-3/8
KC23B1	K2C23B1	8-2	10-1	3/0 - 10	31/32	13/16	5/8	1-1/8	l	1-3/0	
KC25	K2C25	0 1/0	0 0/0	2 - 2/0 1/2 - 13	9/16	15/10	0/4	3/4	1-1/8	1-5/8	
KC25B1	K2C25B1	2 - 1/0	2 - 2/0		1-1/16	15/16	3/4	1-1/4			
KC26	K2C26	0 0/0	0 0/0	1/0 10	17/32		7/0	3/4	1.0/0	1 7/0	
KC26B1	K2C26B1	2 - 2/0	2 - 3/0	1/2 - 13	1-1/16	'	7/8	1-1/4	1-3/8	1-7/8	
KC28	K2C28	1 4/0	1 4/0	F/0 11	3/4	1 1/0	1.0/10	1	1.0/4	0.1/4	
KC28B1	K2C28B1	1 - 4/0	1 - 4/0	5/8 - 11	1-1/4	1-1/2	1-3/16	1-1/2	1-3/4	2-1/4	
KC31	K2C31	1 050		5/8 - 11	3/4	1 11/10	1.0/0	1	0.1/4	0.7/0	
KC31B1	K2C31B1	1 - 350	_		1-1/4	1-11/16	1-3/8	1-1/2	2-1/4	2-7/8	
KC34	K2C34	2/0 500		0/4 10	1		1.5/0	1-1/4	0.0/0	0.1/4	
KC34B1	K2C34B1	3/0 - 500	_	3/4 - 10	1-1/2	2	1-5/8	1-3/4	2-3/8	3-1/4	

† For 1 conductor. ‡ For 1 or 2 conductors. Add "NSP" suffix to have connector supplied w/split lock-washer and nut.

## TYPES KC22J12T13, EQC632C

## TRANSFORMER GROUND CONNECTORS

#### For Copper


E-26

Fits all standard EEI NEMA distribution transformers as a tank grounding terminal.



Catalog Number	Ranges
KC22J12T13	8 Sol 2 Sol.
KC26	2 Sol 2/0 Str.
KC34J12T13	3/0 - 500 Str.
EQC632C	8 Sol 2 Str.

Both, one-wrench installation.

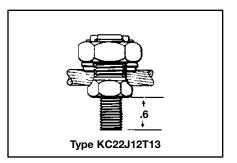

#### **TYPE KS**

#### **SERVIT®**

#### For Copper

UL467 Listed for direct burial applications in earth or concrete. Compact, high-strength, high copper alloy SERVIT® split-bolt has free-running threads and easy to grip wrench flats. Highly resistant to cracking and corrosion.








Catalog Number	Cross Flats	L	w	Copper Conductor Range (Sol Str.)	Rebar w/ (1) No. 8 Sol. Cu	Recommended Torque (In. Lb.)
KS15	.50	.85	.38	12 AWG - 8 AWG	N/A	80
KS17	.63	1.14	.45	8 AWG - 6 AWG	N/A	165
KS20	.69	1.20	.51	8 AWG - 4 AWG	N/A	165
KS22	.75	1.50	.60	6 AWG - 3 AWG	N/A	275
KS23	.82	1.54	.62	6 AWG - 2 AWG	N/A	275
KS25	.94	1.77	.73	4 AWG - 1/0	N/A	385
KS26	1.05	1.94	.82	2 AWG - 2/0 6 AWG - 8 AWG Str./Sol.	#3 (3/8")	385
KS27	1.36	1.86	1.17	1 AWG - 3/0	N/A	500
KS29	1.36	2.07	1.17	1 AWG - 250 kcmil 6 AWG - 8 AWG Str./Sol.	#4 (1/2")	650
KS31	1.70	2.51	1.41	1/0 AWG - 350 kcmil 6 AWG - 8 AWG Str./Sol.	#5 (5/8")	650
KS34	1.82	2.79	1.48	2/0 AWG - 500 kcmil 6 AWG - 8 AWG Str./Sol.	#6 (3/4")	825

#### **TYPE GKA**

#### For Copper

UL467 Listed for direct burial applications in earth or concrete. One-piece forged body construction insures mechanical integrity in an underground environment. Supplied with a stainless steel headless screw.

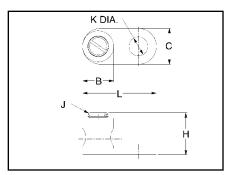





Catalog Number	Cable Range	В	C	Н	J	K	L
GKA8C <sup>1</sup>	#10 Sol #8 Str.	.31	.38	.58	#10 - 32	.21	.81
GKA4C <sup>2</sup>	#14 Sol #4 Str.	.46	.54	.71	5/16 - 24	.28	1.13

 To be assembled with TMH322 stainless steel hardware kit. Ordered separately. 2. To be assembled with TMH 323 stainless steel hardware kit. Ordered separately.


#### **TYPE KPB**

#### For Copper

UL467 Listed for direct burial in earth or concrete. UL486 listed. This exclusive BURNDY® design accommodates #10 - #4 copper where continuous conductor runs are preferable.






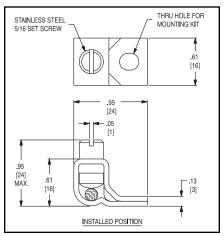

Catalog Number	Range	Stud Hole
KPB4CG1	#10 - #4 CU	#10 ¹

 To be assembled with TMH322SS stainless steel hardware kit. Ordered separately.

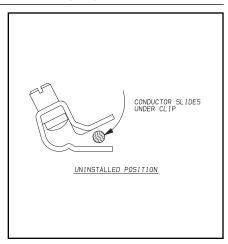

#### TYPE CL50-1

#### COPPER LAY-IN QIKLUG™


#### For Copper

The Lay-In QIKLUG™ is manufactured from high strength pure electrolytic copper to ensure maximum strength and conductivity. UL467 Listed for direct burial in earth or concrete. The open-faced design allows for fast lay-in of the conductor without the need for cutting or breaking.








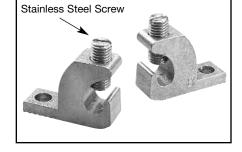

Catalog Number	Wire Range Copper	Stud Hole
CL50-1	#14 - #4 CU	#10
CL50-1TN*	#14 - #4 CU	#10

\*-TN Version is tin plated. Commonly used for solar panel grounding.

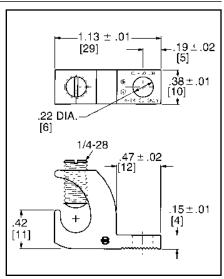

#### **TYPE GAR**

- Wire to Rebar
- Fence Post Grounding Connector
- Wire to Pipe


For Parallel or 90° Copper Cable Connection to Rod or Pipe with the Same Connector

High copper alloy ground connector for joining a range of cable, parallel or at right angles to rod or tube. Especially good for fence posts. High copper alloy cast body with DURIUM™ U-bolts, nuts and lockwashers, permit entire connection to be buried in ground or concrete without danger of corrosion.


- One-wrench installation.
- UL467 Listed.
- Acceptable for direct burial.





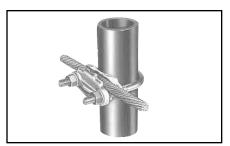



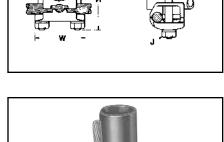



Wire Parallel to Pipe









Catalog		Conductor					
Number	Tube I.P.S.	Rod Size or O.D. Range	Rebar Size	Cable	Н	J	W
GAR114C				8 Sol 4 Str.			
GAR1126	1/4	1/2	_	4 Sol 2/0 Str.	2-1/2		1-7/8
GAR1129	1			2/0 Sol 250	1	0.40	
GAR644C				8 Sol 4 Str.		3/8	
GAR6426	3/8	5/8 - 3/4	#5 (5/8") -	4 Sol 2/0 Str.	2-7/8		2-1/8
GAR6429	3/8	5/8 - 3/4	#6 (3/4")	2/0 Sol 250	1		
GAR6434	1			300 - 500	3-1/2	1/2	2-1/2
GAR144C				8 Sol 4 Str.	2-3/4		
GAR1426	1/2 - 3/4	7/8 - 1	#7 (7/8") -	4 Sol 2/0 Str.	3	3/8	2-3/8
GAR1429	1/2 - 3/4	7/8 - 1	#8 (1")	2/0 Sol 250	3		
GAR1434	1			300 - 500	3-3/4	1/2	2-3/4
GAR154C				8 Sol 4 Str.	2-7/8		
GAR1526	1	1-1/8 - 1-1/4	#9 (1-1/8") -	4 Sol 2/0 Str.	2-1/0	3/8	2-5/8
GAR1529	] '	1-1/0 - 1-1/4	#10 (1-1/4")	2/0 Sol 250	3-3/8		
GAR1534	1			300 - 500	4-1/2	1/2	
GAR164C		1-3/8 - 1-1/2	#11 (1-3/8")	8 Sol 4 Str.	3-1/2	3/8	
GAR1626	1-1/4			4 Sol 2/0 Str.			3
GAR1629	1-1/4	1-3/6 - 1-1/2		2/0 Sol 250	]		
GAR1634				300 - 500	4-1/4	1/2	3-3/8
GAR174C				8 Sol 4 Str.			
GAR1726	1-1/2	1-5/8 - 1-7/8		4 Sol 2/0 Str.	4	3/8	3-1/4
GAR1729	1-1/2	1-5/6 - 1-7/6	_	2/0 Sol 250			
GAR1734	1			300 - 500	4-5/8	1/2	2-5/8
GAR184C				8 Sol 4 Str.	4-1/4		
GAR1826	2	2 - 2-3/8		4 Sol 2/0 Str.	4-1/4	3/8	3-3/4
GAR1829		2 - 2-3/0	_	2/0 Sol 250	4-1/2		
GAR1834				300 - 500	5-1/4	1/2	4-1/8
GAR194C				8 Sol 4 Str.			
GAR1926	2-1/2	2-1/2 - 2-7/8		4 Sol 2/0 Str.	5	3/8	4-1/4
GAR1929	2-1/2	2-1/2 - 2-1/0	_	2/0 Sol 250			
GAR1934	1			300 - 500	5-5/8	1/2	4-5/8

#### **TYPE GAR**

(Continued)

## FENCE POST GROUNDING CONNECTOR

Catalog		Conductor					
Number	Tube I.P.S.	Rod Size or O.D. Range	Cable	Н	J	W	
GAR204C			8 Sol 4 Str.				
GAR2026	3	3 - 3-1/2	4 Sol 2/0 Str.	5-5/8	3/8	4-3/4	
GAR2029		3 - 3-1/2	2/0 Sol 250	]			
GAR2034			300 - 500	6-3/8	1/2	5-1/4	
GAR214C			8 Sol 4 Str.				
GAR2126	3-1/2	3-1/2 - 4	4 Sol 2/0 Str.	6-1/4	3/8	5-3/8	
GAR2129	3-1/2	3-1/2 - 4	2/0 Sol 250				
GAR2134			300 - 500	6-3/4	1/2	5-3/4	
GAR224C			8 Sol 4 Str.	6-3/8	3/8		
GAR2226	4	4 - 4-1/2	4 Sol 2/0 Str.			5-7/8	
GAR2229	4	4 - 4-1/2	2/0 Sol 250				
GAR2234			300 - 500	6-7/8	1/2	6-1/4	
GAR244C			8 Sol 4 Str.		3/8	6-7/8	
GAR2426	5		4 Sol 2/0 Str.	7-3/4	3/0	0-7/0	
GAR2429		_ [	2/0 Sol 250		1/2	7-1/4	
GAR2434			300 - 500	8-5/8	1/2	1-1/4	
GAR8629	6	_	2/0 Sol 250	8-13/16	1/2	8-3/8	

Contact  ${\rm BURNDY}^\circledast$  for additional pipe and wire size combinations not shown.

E-29

## TYPES GAR-BU AND GAR3902 SERIES

#### **GROUND CONNECTORS**


Type GAR-BU is a high-conductivity copper ground connector for connecting a small to medium range copper ground conductor to water pipe as well as structural and reinforcing rod shapes. Universal acceptance of several sizes of cylindrical shapes makes this suitable for industrial construction and maintenance work as well as cathodic protection. Cable clamp swivels to permit parallel grounding of one pipe or 90° degree cable run for grounding several parallel pipes. Single wrench installation. UL467 Listed and CSA certified.









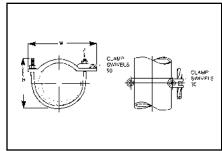

#### **Features and Benefits**

- Cable clamp swivels at 90°.
  - Permits parallel grounding of one pipe or a 90° cable run for grounding several parallel pipes.
- One-wrench installation.
  - ♦ Simplified installation.
- DURIUM™ silicon bronze hardware (-BU Series)\*.
  - Long lasting corrosion resistance and acceptable for direct burial in earth or concrete.
- UL467 Listed.
  - Provides quality assurance to recognized industry NEC standards from an independent party.

Catalog							Recommended
Number *	Cable Range	IPS Size	O.D. Range	Н	J	W	Tightening Torque
GAR3902-BU		1/2" - 1"	.840 - 1.32	3.50		3.25	
GAR3903-BU		1-1/4" - 2"	1.66 - 2.38	4.00		4.25	
GAR3904-BU		2-1/2" - 3-1/2"	2.88 - 4.00	6.50		6.00	
GAR3905-BU	#4 - 4/0 AWG	4" - 5"	4.50 - 5.56	7.50	3/8" - 16	7.50	240 in Ibs.
GAR3906-BU	#4 - 4/0 AWG	6"	6.62	8.50	3/0 - 10	8.62	240 111 105.
GAR3907-BU		8"	8.62	10.00		10.62	
GAR3908-BU		10"	10.75	12.00		12.75	
GAR3909-BU		12"	12.75	14.00		14.75	
GAR3902		1/2" - 1"	.840 - 1.32	3.50		3.25	
GAR3903		1-1/4" - 2"	1.66 - 2.38	4.00		4.25	
GAR3904		2-1/2" - 3-1/2"	2.88 - 4.00	6.50		6.00	
GAR3905	#4 - 4/0 AWG	4" - 5"	4.50 - 5.56	7.50	3/8" - 16	7.50	240 in Ibs.
GAR3906	#4 - 4/U AVVU	6"	6.62	8.50	3/0 - 10	8.62	240 111 105.
GAR3907		8"	8.62	10.00		10.62	
GAR3908		10"	10.75	12.00		12.75	
GAR3909		12"	12.75	14.00		14.75	

 <sup>\*</sup> Type GAR-BU is supplied with DURIUM™ silicon bronze hardware and is listed for direct burial.

#### **TYPE GAR-RB**

For Reinforcement Bar




Catalog					Copper Conductor	
Number	Rebar	IPS Size	O.D. Range	Rod	Min.	Max.
GAR644C-RB	#3 - 6 (.375750)	3/8	.62575	5/8 - 3/4	8 Sol.	4 Str.


UL467 listed for direct burial in earth or concrete.

#### **TYPE GAR-TC**

## WATER PIPE GROUND CONNECTOR

Type GAR-TC is a high-conductivity copper ground connector that features a pre-drilled pad, allowing a 2-hole compression terminal to be directly connected to water pipe as well as structural and reinforcing rod shapes. Universal acceptance of several sizes of cylindrical shapes makes this suitable for industrial construction and maintenance work as well as telecommunications grounding. Terminal may be mounted parallel, 45° or 90° degrees to the pipe. Acceptable for direct burial.

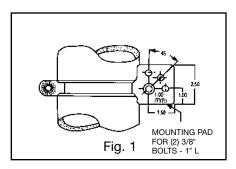

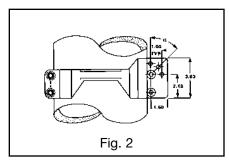








#### **Features and Benefits**

- Large, smooth connector contact area between pipe and ground clamp
- Provides large surface contact area to maximize contact area between connector and pipe.
- The GAR-TC mounting pad permits parallel, 45° or 90° angle connections to the pipe.
- Provides maximum flexibility for field installation.
- Pre-drilled pad for (2) 3/8" bolts on 1" centers.
- Allows direct mounting of (2) hole compression terminals up to 750 kcmil to pipe.

- DURIUM™ silicon bronze hardware.
  - Provide long lasting corrosion resistance acceptable for direct burial in earth or concrete.
- One-wrench installation.
  - ♦ Simplified installation.
- UL467 Listed.
  - Provides quality assurance to recognized industry NEC standards from an independent party. Type GAR-TC is acceptable for direct burial

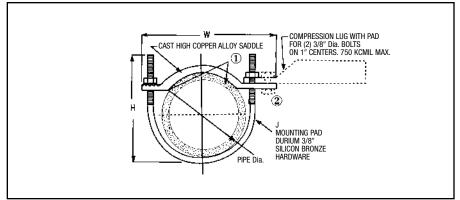

Catalog	Fig.	Accomn	nodates				Recomended	
Number	No.	I.P.S.	O.D. Size	Н	J	W	Tightening Torque	
GAR3902TC	1	1/2" - 1"	.840 - 1.32	3.50		3.75		
GAR3903TC	1	1-1/4" - 2"	1.66 - 2.38	4.00		4.75		
GAR3904TC	1	2-1/2" - 3-1/2"	2.88 - 4.00	6.50	3/8" - 16	6.50	240 inlbs.	
GAR3905TC	1	4" - 5"	4.50 - 5.56	7.50		8.00		
GAR3906TC	1	6"	6.62	8.50		9.12		
GAR3907TC	2	8"	8.62	10.00		11.25		
GAR3908TC	2	10"	10.75	12.00	3/8" - 16	13.25	240 inlbs.	
GAR3909TC	2	12"	12.75	14.00		15.25		

- ① Add suffix "-TNET" for electro-tin plated connector and electro-tin plated DURIUM™ silicon bronze hardware. Tin plated catalog number includes mounting hardware for second bolt hole.
- ② TMH-289 includes (1) 38 x 125 HEB, (1) 38 CHEN, (1) 38 SW and (2) 38 FW. Order separately.

NOTE: Clean pipe surface beneath saddle until virgin metal is exposed, install GAR-TC ground connector and for maximum conductivity, apply PENETROX® E oxide inhibiting compound around perimeter of the saddle.


#### TYPE GD

## CABLE TO ROD/TUBE GROUND CONNECTOR

For Two Copper Cables to Rod or Tube

High copper alloy ground connector for joining a range of two parallel cables to rod or pipe. Especially good for grounding fence posts. High copper alloy cast body with DURIUM™ U-bolts, nuts, and lockwashers make the GD suitable for burial in ground or concrete. One-wrench installation. UL467 Listed. Acceptable for direct burial in earth or concrete.



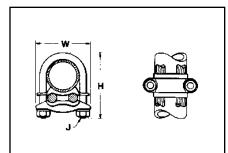





Catalog		Conductor				
Number	Tube I.P.S.	Rod Size or O.D. Range	Cable	Н	J	W
GD1526	1	1-1/8 - 1-1/4	4 Sol 2/0 Str.	3-3/8		2-5/8
GD1529	] '	1-1/0 - 1-1/4	2/0 Sol 250	3-3/6		2-3/6
GD1626	1-1/4	1-3/8 - 1-1/2	4 Sol 2/0 Str.	3-1/2		3
GD1629	1-1/4	1-3/6 - 1-1/2	2/0 Sol 250	3-1/2	3/8	
GD174C			8 Sol 4 Str.			3-1/4
GD1726	1-1/2	1-5/8 - 1-7/8	4 Sol 2/0 Str.	4		3-1/4
GD1729	1-1/2	1-3/6 - 1-7/6	2/0 Sol 250			
GD1734			300 - 500	4-5/8	1/2	3-5/8
GD184C			8 Sol 4 Str.			
GD1826	2	2 - 2-3/8	4 Sol 2/0 Str.	4-3/8	3/8	3-3/4
GD1829		2 - 2-3/6	2/0 Sol 250			
GD1834			300 - 500	5-3/8	1/2	4-1/8
GD194C	2-1/2		8 Sol 4 Str.			
GD1926		2-1/2 - 2-7/8	4 Sol 2/0 Str.	5	3/8	4-1/4
GD1929		-1/2 2-1/2 - 2-1/0	2/0 Sol 250	J		
GD1934			300 - 500		1/2	4-5/8
GD204C			8 Sol 4 Str.			
GD2026	3	3 - 3-1/2	4 Sol 2/0 Str.	5-5/8	3/8	4-7/8
GD2029		3 3 1/2	2/0 Sol 250			
GD2034			300 - 500	6-3/8	1/2	5-1/4
GD214C			8 Sol 4 Str.			
GD2126	3-1/2	3-1/2 - 4	4 Sol 2/0 Str.	6-1/4	3/8	5-3/8
GD2129	J 772	3 1/2 4	2/0 Sol 250			
GD2134			300 - 500	6-7/8	1/2	5-3/4
GD224C			8 Sol 4 Str.			
GD2226	4	4 - 4-1/2	4 Sol 2/0 Str.	6-3/8	3/8	5-7/8
GD2229		7 7 1/2	2/0 Sol 250			
GD2234			300 - 500	6-7/8	1/2	6-1/4

Complies with NFPA 78-86 HEAVY DUTY stacks. (Order: LD for lead plating for HEAVY DUTY stack applications.)

Canada: 1-800-387-6487

E-32

E-33

#### **TYPE GP**

#### **GROUND CONNECTOR**


For Two Copper Cables to Rod or Pipe

High copper alloy ground connector for joining a range of parallel cables perpendicular to rod, pipe or column. Also used with one groove for run, the other for tap to equipment. High copper alloy cast body and DURIUM™ U-bolts, nuts, and lockwashers make the GP suitable for direct burial in the ground or concrete. One-wrench installation. UL467 Listed. Acceptable for direct burial in earth or concrete.







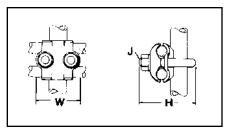

Catalog		Conductor				
Number	Tube I.P.S.	Rod Size or O.D. Range	Cable	Н	J	W
GP114C			8 Sol 4 Str.			
GP1126	1/4	1/2	4 Sol 2/0 Str.			1-7/8
GP1129			2/0 Sol 250	2-1/2	3/8	
GP644C			8 Sol 4 Str.		3/0	
GP6426	3/8	5/8 - 3/4	4 Sol 2/0 Str.			2-1/8
GP6429	3/0	3/6 - 3/4	2/0 Sol 250	2-7/8		
GP6434			300 - 500	3-1/2	1/2	2-1/2
GP144C		7/8 - 1	8 Sol 4 Str.	2-3/4	38	2-3/8
GP1426	1/2 - 3/4		4 Sol 2/0 Str.	3		
GP1429	1/2 - 3/4		3/0 Sol 250	3		
GP1434			300 - 500	3-3/4	1/2	2-3/4
GP164C	1-1/4	1-5/8	8 Sol 4 Str.	3-1/2		3
GP1629	1-1/4	1-5/6	2/0 Sol 250	3-1/2		ა
GP1726	1-1/2	1-7/8	4 Sol 2/0 Str.	4		3-1/4
GP184C	2	2-3/8	8 Sol 4 Str.	4-1/8	3/8	3-11/16
GP1826		2-3/6	4 Sol 2/0 Str.	4-3/8		3-11/10
GP2026	3	3-1/2	4 Sol 2/0 Str.	5-1/2		4-13/16
GP2226	4	4-1/2	4 Sol 2/0 Str.	6-3/8		5-13/16

#### **TYPE GK**

#### **GROUND CONNECTOR**


For Three Copper Cables to Rod or Pipe

High copper alloy ground connector for joining three equal cables to rod or tube. Cable grooves take a wide range of cable. High copper alloy cast body and DURIUM™ U-bolts, nuts, and lockwashers make the GK suitable for direct burial in soil or concrete. One-wrench installation. UL467 Listed. Acceptable for direct burial in earth or concrete.







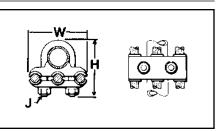

Catalog		Conductor				
Number	Tube I.P.S.	Rod Size or O.D. Range	Cable	Н	J	W
GK114C			8 Sol 4 Str.		3/8	2-1/2
GK1126	1/4	1/2	4 Sol 2/0 Str.	2-1/2	3/0	2-3/4
GK1129			2/0 Sol 250		1/2	3-3/8
GK644C			8 Sol 4 Str.		3/8	2-5/8
GK6426	3/8	5/8 - 3/4	4 Sol 2/0 Str.	2-7/8	3/0	3
GK6429	3/0	3/6 - 3/4	2/0 Sol 250		1/2	3-1/2
GK6434			300 - 500	3-1/2	1/2	4
GK1426			4 Sol 2/0 Str.	2-3/4	38	3-1/4
GK1429	1/2 - 3/4	7/8 - 1	2 Sol 250	3-3/4	1/2	3-7/8
GK1434			300 - 500	3-3/4	1/2	4-3/8
GK1526	1	1-1/8 - 1-1/4	4 Sol 2/0 Str.	3-3/8	3/8	3-1/2
GK1529	l I	1-1/6 - 1-1/4	2/0 Sol 250	3-3/4	1/2	4-1/8
GK1626	1-1/4	1-3/8 - 1-1/2	4 Sol 2/0 Str.	3-1/2	3/8	3-7/8
GK1629	1-1/4	1-3/6 - 1-1/2	2/0 Sol 250	4-1/4	1/2	4-1/2
GK1726	1-1/2	1-5/8 - 1-7/8	4 Sol 2/0 Str.	4	3/8	4-1/8
GK1729	1-1/2	1-3/6 - 1-7/6	2/0 Sol 250	4-5/8	1/2	4-3/4
GK1826	2	2 - 2-3/8	4 Sol 2/0 Str.	4-1/4	3/8	4-5/8
GK1829		2 - 2-3/0	2/0 Sol 250	4-3/8	1/2	5-1/8
GK1926	2-1/2	2-1/2 - 2-7/8	4 Sol 2/0 Str.	5	3/8	5-1/8
GK1929	2-1/2	2-1/2 - 2-1/0	2/0 Sol 250	5	1/2	5-5/8

Blue highlighted items are industry standard and most frequently ordered.

US: 1-800-346-4175 www.burndy.com Canada: 1-800-387-6487


#### TYPE BDT

## BONDIT™ INTERSYSTEM BONDING CONNECTOR

#### House Mounted or Meter Socket Mounted


Designed to meet the requirements of 2008 NEC Article 250.94 "Bonding for Other Systems." Corrosion-resistant stainless steel set screws. Accepts main ground wire (#2-#8) and up to 4 intersystem wires (#6-#14). Same design can be mounted directly to the meter socket or mounted to the house. Innovative design does not damage meter socket and will not void warranty.

Catalog Number: BDT1

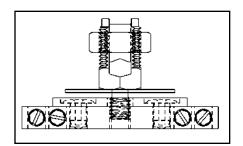


#### **Features & Benefits**

- Made in the USA!
- Meets Intersystem Bonding Requirements: NEC2008 250.94
- One connector does it all
- House mount or meter socket mount
- Incorporates proven BURNDY® SERVIT POST™ design
- Stainless steel set screws
- Accepts main ground wire (#2-#8), up to 4 intersystem wires (#6-#14)

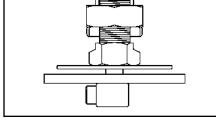



- Easily mounts to meter box during new installation or can be wall mounted
- Easy to follow instructions included
- Does not damage meter socket; no worries about damaging the paint or voiding warranties
- Easily installed with a wrench and screwdriver
- Open design prevents buildup of hornets, bees, spiders

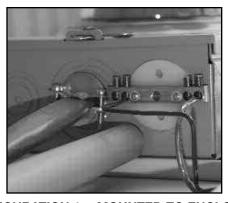

#### CONFIGURATION 1 - MOUNTED TO ENCLOSURE


- 1. Punch out a 1/2" or 3/4" knock out on the electrical enclosure.
- Begin assembly by installing the ground electrode conductor in the SERVIT POST™ inside the electrical enclosure. Torque on SERVIT® nut: 275 in-lb max.
- Install the rest of the connector as shown in figure 1 below, it is not necessary for the bus bar to be aligned parallel with the enclosure. (Note: the split washer is not used in this configuration.)
- 4. Tighten the intersystem ground wires with set screws in the bus bar to a maximum torque of 35 in-lb.
- Adhere the BONDIT™ location sticker to the front of the electrical enclosure.

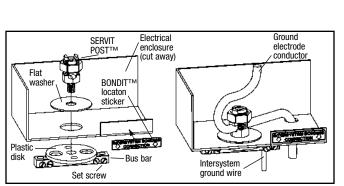

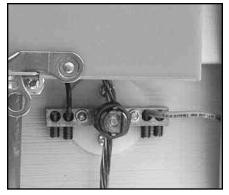

#### **CONFIGURATION 2 — MOUNTED TO EXTERIOR WALL**

- Begin by assembling the connector as shown in figure 2 below. Be sure SERVIT POST™ is as tight as it can be while its groove is aligned with the ground electrode conductor. (Note: the flat washer is not used in this configuration.)
- Use two mounting screws (not included) to secure the connector to the exterior wall so that the set screws in the bus bar face downward.
- Install the ground electrode conductor into the SERVIT POST™ while turning the nut/pressure bar assembly to a maximum torque of 275 in-lb. (use 2 wrenches if necessary).
- 4. Tighten the intersystem ground wires with the set screws in the bus bar to a maximum torque of 35 in-lb.
- If hidden from view, use the BONDIT™ location sticker to indicate the location.

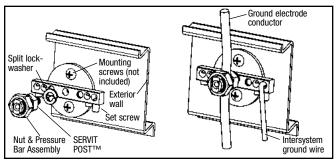

Blue highlighted items are industry standard and most frequently ordered.

Canada: 1-800-387-6487 www.burndy.com US: 1-800-346-4175

#### CAST BRONZE CLAMPS FOR CONDUIT

Pressure bar type conduit hub adjusts for 1/2", 3/4" EMT or 1/2" rigid conduit. Hub swings 360° for easy alignment. Zinc plated hardware.







	I -	Accommodates Conductor Range			Reference Dimensions			Recommended Screw Torque (Inch Pounds)	
Catalog	Water	Water Hub					Pipe	Wire	
Number	Pipe	Ground	Size	Н	L	W	Clamp	Clamp	
C-11JPT	1/2 - 1			2.07	3.19				
0-11311	[13 - 25]			[53]	[81]				
C-22JPT	1-1/4 - 2	10 - 6	1/2	2.70	3.83	2.70	50 inlb.	50 inlb.	
G-22JP1	[32 - 51]	Sol.	[13]	[69]	[97]	[69]	30 111. 15.	30 III. Ib.	
C-4JPT	2-1/2 - 4			4.39	5.15				
U-401' I	[64 - 102]			[112]	[131]				

#### CAST BRONZE GROUND CLAMPS

For connecting grounding conductor to water pipe or copper tube. "D" indicates UL467 Listed for direct burial in earth and concrete and are supplied with silicon bronze hardware. "B" indicates brass hardware.









	1	Accommodates Conductor Range					Recommended Screw Torque (Inch Pounds)		
Catalog Number	Water			Reference Dimensions H L W C				Pipe Clamp	Wire Clamp
C-11N	1/2 - 1	—	10 - 2	1.81	2.25	.63	.63	Olding	Olump
C-11D C-11B	[13 - 25]	#4 - #8	Str.	[46]	[56]	.03 [16]	.03 [16]		
C-22 *	1-1/4 - 2		10 - 2	2.38	3.63	.75	1.00		
C-22D	[32 - 51]		Str.	[60]	[92]	[19]	[25]	50 inlb.	50 inlb.
C-4 *	2-1/2 - 4	_	10 - 2	4.13	6.25	.96	1.88	1	
U-4	[64 - 114]		Str.	[105]	[159]	[24]	[48]		
C-8 *	4-1/2 - 6		10 - 2	4.29	8.34	1.25	1.88	1	
U-0 "	[114 - 165]		Str.	[109]	[212]	[32]	[48]		

<sup>\*</sup> Catalog numbers C-22, C-4, and C-8 are supplied with zinc plated steel hardware.

### BUDGET PRICE CAST BRONZE GROUND CLAMP

Similar to above but lighter duty.





								Recomi	nended
	Accommodates							Screw Torque	
	Conductor Range						(Inch Pounds)		
Catalog	Water			Ref	erence I	Pipe	Wire		
Number	Pipe	Rebar	Ground	Н	L	W	C	Clamp	Clamp
C-5	1/2 - 1		10 - 2	1.56	2.25	.56	.50	50 inlb.	50 inlb.
(JUNIOR)	[13 - 25]		Str.	[40]	[56]	[14]	[13]	JU 11110.	JU 1111D.

## CAST BRONZE GROUND CLAMPS

#### With Lay-in Feature

For connecting grounding conductor to water pipe, copper tube, ground rod or rebar. The open face design allows for fast lay-in of the tap conductor without the need for cutting. Simply reverse bottom clamp for smaller size rebar or rod. Connectors are provided with Silicon Bronze hardware.

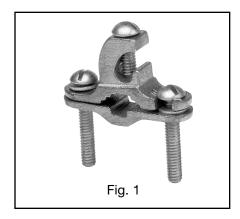








	Fig. #	Accommodates Conductor Range Main Tap				Reference			Recommended
Catalog Number		Water Pipe	Rebar	Ground Rod	Ground	Н	Dimensions L	W	Screw Torque (Inch Pounds)
C11K16D C11K17D	Fig. 1 Fig. 2	1/2" - 1" [13 - 25]	#4 - #6	3/8" - 1"	#10 - #2 Str.	1.64"	2.28"	0.66"	50 inlbs.

#### **DIE CAST CLAMPS**

Die cast zinc with zinc plated screws.







						Recom	mended		
	Accor	nmodates					Screw	Torque	
	Condu	ctor Range					(Inch Pounds)		
Catalog	Water		Re	Reference Dimensions				Wire	
Number	Pipe	Ground	Н	L	W	C	Clamp	Clamp	
CZ-11	1/2" - 1"	10 - 2	1.56"	2.25"	.56"	.50"	50 inlb.	50 inlb.	
02-11	[13 - 25]	Str.	[40]	[56]	[14]	[13]	JU IIIID.	JU 1111D.	

E-37

## CAST BRONZE CLAMPS

To connect armored cable to water pipe. Zinc plated screws. Pressure bar grips armor or outer cable insulation. 360° swing hub for easy alignment.







						Recommended			
	Accommodates			Reference			Screw Torque		
	C	onductor Range	ן ט	<u>imensio</u> i	18	(Inch	Pounds)		
Catalog	Water	Armored				Pipe	Wire		
Number	Pipe	Conductor	Н	L	W	Clamp	Clamp		
C-11JA	1/2 - 1		1.38	3.05					
U-11JA	[13 - 25]		[35]	[77]					
C-22JA	1-1/4 - 2	10 - 6	2.60	3.69	1.41	50 inlb.	50 inlb.		
G-ZZJA	[32 - 51]	Sol.	[66]	[94]	[36]	50 IIIID.	50 IIIID.		
0.410	2-1/2 - 4		4.29	5.01	1				
C-4JA	[64 - 102]		[109]	[128]					

# CAST BRONZE GROUND CLAMPS

For connecting grounding conductor, EMT or rigid conduit to water pipe, copper tube, ground rod or rebar. Hub swings 360° for easy alignment. Simply reverse bottom clamp for smaller size rebar or rod. Connectors are provided with Silicon Bronze hardware.







	Accommodates Conductor Range							
Catalog	Water	Main	Ground	Тар				Recommended Screw Torque
Number	Pipe	Rebar	Rod	Ground	Н	L	W	(Inch Pounds)
C11HD4/0DB	1/2" - 1" [13 - 25]	#4 - #6	3/8" - 1"	#8 - 4/0 AWG	2.25	2.65	1.56	50 inlbs.
C22HD4/0DB	1-1/4" - 2" [32 - 51]	_	_	#8 - 4/0 AWG	2.70	3.60	1.56	50 inlbs.

# CAST BRONZE CLAMPS

For connecting armored cable to water pipe. Zinc plated screws. "D" indicates UL467 for direct burial in earth and concrete, supplied with silicon bronze hardware.







	Accommodates Conductor Range							Screw	mended Torque Younds)
Catalog	Water		Ground	Ref	erence	Dimens	ions	Pipe	Wire
Number	Pipe	Ground	Clamp	Н	L	W	C	Clamp	Clamp
C-6	1/2 - 1	10 - 2	Bare Armored	1.60	2.34	1.06	.63		
C-6D	[13 - 25]	Str.	Unarmored Wire Cables	[41]	[59]	[27]	[16]	50 inlb.	50 inlb.
C-7	1-1/4 - 2 [32 - 51]	10 - 2 Str.	or Cords	2.38 [60]	3.62 [92]	.94 [24]	1.00 [25]		

E-39

## CAST BRONZE CLAMP FOR RIGID CONDUIT

For grounding rigid conduit systems. Zinc plated screws.







	Accommodates Conductor Range						Screw	mended Torque ounds)	
Catalog	Water		Hub	Ref	erence l	Dimensi	ons	Pipe	Wire
Number	Pipe	Ground	Size	Н	L	W	C	Clamp	Clamp
0.01	1/2 - 1			2.07	2.34	1.34	1.06		
C-61	[13 - 25]	#6 Sol.	1/2	[53]	[59]	[34]	[27]	50 inlb.	50 inlb.
C-66	1-1/4 - 2	Max.	[13]	2.69	3.62	1.34	1.40	JU IIIID.	JU IIIID.
U-00	[32 - 51]			[68]	[92]	[34]	[36]		

## CAST BRONZE CLAMPS FOR CONDUIT

For grounding rigid conduit systems. Continuity from rigid conduit systems to ground provided by cast bronze threaded conduit hub. Zinc plated screws.









		ccommodat						Screw	mended Torque ounds)
Catalog	Water		Hub	Ref	erence l	Dimensi	ons	Pipe	Wire
Number	Pipe	Ground	Size	Н	L	W	C	Clamp	Clamp
C 111 U 1	1/2 - 1			2.25	3.23		.97		
C-11LH-1	[13 - 25]			[57]	[83]		[25]		
C-22LH-1	1-1/4 - 2	10 Str	1/2	2.88	3.50	.69	1.34		
G-ZZLN-1	[32 - 51]	6 Sol.	[13]	[73]	[89]	[18]	[34]		
C-4LH-1	2-1/2 - 4			4.56	4.82		2.44		
G-4LN-1	[54 - 102]			[116]	[122]		[62]		
C-11LH-2	1/2 - 1			2.56	2.86		1.13		
G-TTLN-Z	[13 - 25]			[65]	[73]		[29]		
C-22LH-2	1-1/4 - 2	2/0 - 10	3/4	3.19	3.50	1.00	1.50	50 inlb.	50 inlb.
U-ZZLII-Z	[32 - 51]	Str.	[19]	[65]	[89]	[25]	[38]	JO III. ID.	50 III. ID.
C-4LH-2	2-1/2 - 4			4.88	4.82		2.38		
U-4LII-Z	[64 - 102]			[124]	[122]		[60]		
C-11LH-3	1/2 - 1			2.69	2.86		1.19		
0-11LH-3	[13 - 25]			[68]	[73]	]	[30]		
C-22LH-3	1-1/4 - 2	3/0 - 10	1	3.32	3.50	1.13	1.56		
0-22LII-3	[32 - 51]	Str.	[25]	[59]	[89]	[29]	[40]		
C-4LH-3	2-1/2 - 4			5.01	4.82		2.44		
U-4LII-3	[63 - 102]			[127]	[122]		[62]		

C-LH parts ending in "-1" have one screw and a washer, not shown. C-LH parts ending in "-2" or "-3" have two screws as shown.

# CAST BRONZE CLAMP WITH COPPER STRAP

For grounding rigid conduit systems. Strap helps protect conduit system from water system vibrations. Zinc plated screws. Strap ETP copper.

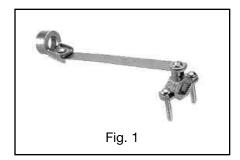

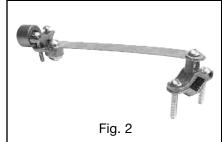





		1	ccommodate	-						Recomn Screw (Inch Po	Torque
Catalog		Water		Hub		Refere	ence Dimen	sions		Pipe	Wire
Number	Fig. #	Pipe	Ground	Size	Н	L	W	C	D	Clamp	Clamp
C-11CSH-1	Fig. 1		6 Sol.	1/2			1.06	1.06			
	Ŭ		Max.	[13]			[27]	[27]			
C-11CSH-2	Fig. 1			3/4			1.25	1.50			
- · · · · · · ·		1/2 - 1	4/0 Str.	[19]	1.75	8.50	[32]	[38]	6.12	50 inlb.	50 inlb.
C-11CSH-3	Fig. 1	[13 - 25]	Max.	1	[44]	[216]	1.50	1.75	[155]	30 III. Ib.	
0-110311-3	1 11g. 1			[25]			[38]	[44]			
C11CSLH12	Fig. 2	1	#10 - 2/0	1/2	1		1.18	1.06			45 inlb.
GIIGSLIIIZ	11g. 2		AWG	[13]				[27]			43 11110.

E-40

#### **TYPE GC-A**

## DUAL RATED GROUND CLAMP

## For Copper and Aluminum Cable


GC-A ground clamps are UL Listed for use with either copper or aluminum conductors to copper water pipe, galvanized pipe or steel conduit. All clamps are constructed from tin plated high-strength extruded aluminum alloy. PENETROX™ oxide inhibiting joint compounds are recommended for all aluminum applications.





#### **Features and Benefits**

- Clamps are dual rated for both copper and aluminum conductors.
  - ♦ Maximum flexibility of application.
- All connectors are tin plated.
  - Provide low contact resistance and prevents galvanic corrosion.
- All clamps are range taking.
  - Only 3 catalog numbers covers complete range of applications from 1/2 - 4 inches.

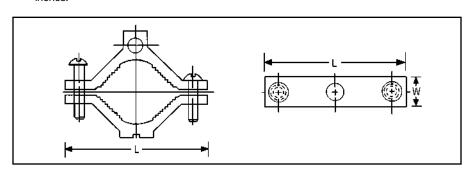


Catalog Number	Conduit, Pipe, or Water Tube Size	Wire Range	Screw Type	W	L	Hex Size
GC15A	1/2 - 3/4 - 1	1/0 - 14	Slotted	11/16	2-1/4	S
GC18A	1-1/4 - 1-1/2 - 2	250 kcmil - 6	Hex Socket	13/16	3-3/4	5/16
GC22A	2-1/2 - 3 - 3-1/2 - 4	250 kcmil - 6	Hex Socket	1	6-5/16	5/16


## **TYPE GG**

#### **GROUND CONNECTOR**

For Copper Bar, Strap, Braid or Cable to Rod or Tube

High copper alloy ground connector for joining bar, strap, braid or cable to rod or tube. High copper alloy cast body, DURIUM™ U-bolts, nuts and lockwashers make the GG particularly effective for use with braid for ground rods, switch handles, fence posts and gates. One-wrench installation.

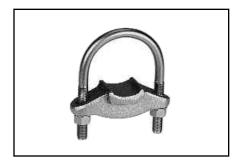

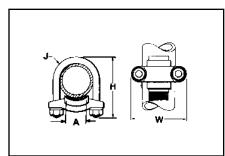





Catalog	Cond	luctor					
Number	Tube I.P.S.	Rod	Α	Н	J	W	
GG15-1	1	1-1/8 - 1-1/4		3-3/8		2-5/8	
GG16-1	1-1/4	1-3/8 - 1-1/2	1			3	
GG17-1	1-1/2	1 5/0 1 7/0		3-1/2	3/8	3-1/4	
GG17-15	1-1/2	1-5/8 - 1-7/8	1-1/2		3/0	3-1/4	
GG18-1			1	4-1/4		3-3/4	
GG18-15	2	2 - 2-3/8	1-1/2	4-1/4		3-3/4	
GG18-2			0	4-3/8		4-1/8	
GG19-2	2-1/2	2-1/2 - 2-7/8	2	5		4-5/8	
GG19-25	2-1/2	2-1/2 - 2-1/0	2-1/2	J 3		4-5/6	
GG20-2			2				
GG20-25	3	3 - 3-1/2	2-1/2	6-3/8		5-1/4	
GG20-3			3				
GG21-2			2				
GG21-25	3-1/2	3-1/2 - 4	2-1/2	5-7/8	1/2	5-3/4	
GG21-3	3-1/2	3-1/2 - 4	3	3-7/6		3-3/4	
GG21-35			3-1/2				
GG22-2			2				
GG22-25	4	4 4 1/0	2-1/2	6.1/0		6-1/4	
GG22-3	4	4 - 4-1/2	3	6-1/2		6-1/4	
GG22-4			4				
GG24-2	5	_	2	7-5/8		7-1/4	

✓ See note page E-1


## **TYPE GQ**

#### **GROUND CONNECTOR**

### For Copper Cable to Tube

High copper alloy ground connector for cross connecting a wide range of cable. High copper alloy, cast body, DURIUM™ U-bolts, nuts, and lockwashers make the GQ suitable for burial in soil or concrete. One-wrench installation. UL467 Listed. Acceptable for direct burial in earth or concrete.



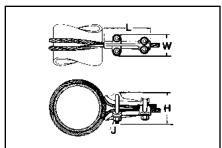

E-43





Catalog	og Conductor					
Number	Tube I.P.S.	Cable	Н	J	L	W
GQ2626	6" Max.	4 Str 2/0 Str.	4-1/2		Е	2-1/2
GQ26-1	Above 6"	4 50 2/0 50.	7-1/8	1/2	5	2-1/2
GQ2929	6" Max.	2/0 Str 250	4-1/8	1/2	c	2-3/4
GQ29-1	Above 6"	2/0 811 250	7-1/2	]	6	2-3/4

## **TYPE GX**

#### **GROUND CONNECTOR**


#### For Copper Cables

High copper alloy ground connector for cross connecting a wide range of cable. The high copper alloy cast body, DURIUM™ U-bolts, nuts, and lockwashers make the GX suitable for burial in soil or concrete. One-wrench installation. UL467 Listed. Acceptable for direct burial in earth or concrete.







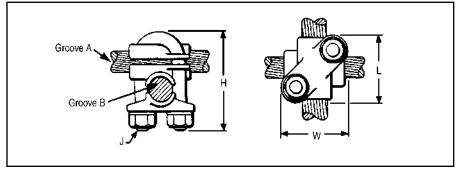

Catalog	Con	Conductor				
Number	Groove A	Groove B	Н	J	L	W
GX4C4C	8 Sol 4 Str.	8 Sol 4 Str.	1-7/8		1-5/8	1-5/8
GX264C	4 Sol 2/0 Str.	8 Sol 4 Str.	2-1/2		1-3/4	1-3/4
GX2626	4 301 2/0 311.	4 Sol 2/0 Str.	2-1/2		1-5/4	1-3/4
GX294C		8 Sol 4 Str.				
GX2926	2/0 Sol 250	4 Sol 2/0 Str.		3/8	1-7/8	
GX2929		2/0 Sol 250	2-3/4			1-7/8
GX344C		8 Sol 4 Str.	2-3/4			1-7/0
GX3426	300 - 500	4 Sol 2/0 Str.			2-1/8	
GX3429	300 - 300	2/0 Sol 250				
GX3434		300 - 500	4-1/4	1/2	2-5/8	2-5/8

E-44

E-45

#### **TYPE GRC**

#### HIGH STRENGTH GROUND ROD CLAMP


#### For Copper Cable to Rod

High copper alloy ground connector for joining a range of cable to copper clad, galvanized steel, and stainless steel ground rods. Slips over end of rod, one-wrench installation. UL467 Listed for direct burial in earth and concrete.







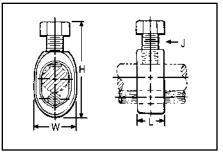

**REA LISTED** 

Catalog	Drive	Conducto	Conductor Range				
Number	Rod	Min.	Max.	Н	W	L	J
GRC12	1/2	10 Sol.	2 Str.	2.00	.89	.63	
GRC58	5/8	10 501.	1 Str.	2.19	.95	.63	3/8
GRC34	3/4	8 Sol.	1/0 Str.	2.47	1.09	.65	

## TYPE GCRT1/0 GROUND CONNECTORS

### GROUND CLAMP RANGE TAKING, UP TO 1/0

The GCRT1/0 is a range taking ground rod clamp offering another choice from the BURNDY® family of connectors. The GCRT1/0 works on 1/2", 5/8" and 3/4" ground rods with a wire range of #8 through 1/0! The clamp is UL467 Listed for direct burial in earth and concrete. Catalog number **GCRT1/0**.



#### **Features and Benefits**

- Range taking design helps reduce inventory.
- UL Listed and CSA Certified.
- UL467 Listed for direct burial in earth and concrete.







#### **TYPE GRL**

# LIGHT DUTY ECONOMICAL GROUND ROD CLAMP

UL467 Listed. Acceptable for direct burial.







		Conductor Range				
Catalog Number	Rod Size	Minimum	Maximum			
GRL3*	3/8	10 AWG	4 AWG			
GRL4	1/2	10 AWG	2 AWG			
GRL5	5/8	10 AWG	2 AWG			
GRL6	3/4	10 AWG	2 AWG			

<sup>\*</sup> GRL3 not UL Listed.

## TYPE B


#### **FLEXIBLE COPPER BRAID**


Flexible copper braid jumpers designed to take up linear expansion and contraction, compensate for misalignment and absorb vibratory movement of electrical equipment and devices.

Made of flat extra flexible, tinned, pure copper braid, with unplated, seamless, pure copper ferrules formed into a rectangular shape on each end.

Last two numbers in catalog number indicate total length of braid in inches (e.g., BD12N or BD12 is 12" long braid jumper).

Other lengths, plating and drilling are available. Refer to factory.

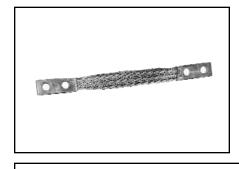

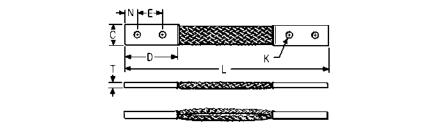





Catalog	Number of Braids in									oximate re Rating
Number	Ferrules	C	D	E	K	L	N	T	Indoor	Outdoor
BD12 †			2.50	1.25	.44	12				
BD12N** †			3.00	1.75	.56	12	1			
BD18 †	1	0.4	2.50	1.25	.44	18	.62	.13	100	205
BD18N** †	ı	.94	3.00	1.75	.56	18	.62	.13	190	225
BD24 †			2.50	1.25	.44	24				
BD24N** †			3.00	1.75	.56	24				
BE12 †				1.50	.44	12	.75			
BE12N** †				1.75	.56	12	.62			
BE18 †	1	1.50	3.00	1.50	.44	18	.75	.17	340	405
BE18N** †	I	1.50	3.00	1.75	.56	18	.62	.17	340	405
BE24 †				1.50	.44	24	.75			
BE24N** †				1.75	.56	24	.62			
BF12 †				1.50	.44	12	.75			400
BF12N** †				1.75	.56	12	.62			
BF18 †	1	1.19	3.00	1.50	.44	18	.75	.25	360	
BF18N** †	I	1.19	3.00	1.75	.56	18	.62	.25	300	430
BF24 †				1.50	.44	24	.75			
BF24N** †				1.75	.56	24	.62			
BG12				1.50	.44	12	.75			
BG12N**				1.75	.56	12	.62			
BG18	1	1.50	3.00	1.50	.44	18	.75	.25	415	495
BG18N**	I	1.50	3.00	1.75	.56	18	.62	.20	410	490
BG24				1.50	.44	24	.75			
BG24N**				1.75	.56	24	.62			
			i				1			

<sup>\*</sup> This rating may vary with ambient conditions, orientation of the braid and other service conditions

Note: All sizes are listed to UL467 and specific sizes (†) are certified to CSA C22.2, No. 41 Grounding and Bonding Equipment Standards. Equivalent sizes may be designated by suffix letters representing variations in length, mounting configurations, pad size and finish. Contact factory for details.

of the braid and other service conditions.
\*\*Tongue drilled per (2) hole NEMA standard.

## **TYPE B**

#### **FLEXIBLE COPPER BRAID**

(Continued)





Catalog	Number of Braids in									oximate re Rating
Number	Ferrules	C	D	E	K	L	N	T	Indoor	Outdoor
B2D12 †		0.4	2.50	1.25	.44	12	.62	0.5	200	455
B2D12N** †		.94	3.00	1.75	.56	12	.62	.25	380	455
B2E12		1.62	3.00	1.50	.44	12	.75	.25	530	635
B2E12N**	2	1.02	3.00	1.75	.56	12	.62	.25	330	033
B2F12		1.38	3.00	1.50	.44	12	.75	.38	600	720
B2F12N**		1.30	3.00	1.75	.56	12	.62	.30	000	120
B2G12N**		1.50	3.00	1.75	.56	12	.62	.50	700	840
B3D12 †		1.19	2.50	1.25	.44	12	.62	.25	470	560
B3D12N** †		1.19	3.00	1.75	.56	12	.62	.23	470	
B3E12		1.64	3.00	1.50	.44	12	.75	.31	700	840
B3E12N**	3	1.04	3.00	1.75	.56	12	.62	اد.	700	040
B3F12	J	1.44	3.00	1.50	.44	12	.75	.56	820	980
B3F12N**		1.44	3.00	1.75	.56	12	.62	.50	020	980
B3G12		1.69	3.00	1.50	.44	12	.75	.69	960	1150
B3G12N**		1.09	3.00	1.75	.56	12	.62	.09	900	1130
B4D12		1.19	2.50	1.25	.44	12	.62	.32	600	720
B4D12N**		1.19	3.00	1.75	.56	12	.62	.32	000	120
B4E12		1.64	3.00	1.50	.44	12	.75	.36	850	1020
B4E12N**	4	4 1.64	3.00	1.75	.56	12	.62	.50	030	1020
B4F12		1.50	3.00	1.50	.44	12	.75	.78	1000	1200
B4F12N**		1.30	3.00	1.75	.56	12	.62	.10	1000	1200
B4G12N**		1.69	3.00	1.75	.56	12	.62	.94	1200	1440

<sup>\*</sup> This rating may vary with ambient conditions, orientation of the braid and other service conditions.
\*\*Tongue drilled per (2) hole NEMA standard.

Note: All sizes are listed to UL467 and specific sizes (†) are certified to CSA C22.2, No. 41 Grounding and Bonding Equipment Standards. Equivalent sizes may be designated by suffix letters representing variations in length, mounting configurations, pad size and finish. Contact factory for


E-47


## **TYPES GB, GBM**

#### **GROUND CONNECTOR**

For Copper Cable to Bar

High copper alloy ground connector for joining a range of cable to 1/4" thick bar.\* Type GB separates cable from bar, GBM clamps cable directly on bar surface. One-wrench installation. UL467 Listed. The high copper alloy cast body and DURIUM™ bolts, nuts, and lockwashers make the GB and GBM suitable for direct burial in concrete or ground.

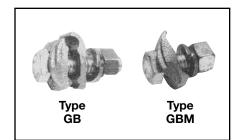

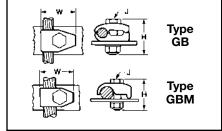





Catalog Number			H Type	H Type		W Type	W Type
Type GB	Type GBM	Conductor	GB/GBL	GBM	J	GB/GBL	GBM
GB4C	GBM4C	8 Sol 4 Str.	1-1/2	1-1/2	3/8	1-1/4	1-1/4
GB26	GBM26	4 Sol 2/0 Str.		1-1/2	3/0	1-1/2	1-1/2
+GBL30		4 Sol 300	2			7/8	0
GB29	GBM29	2/0 Sol 250		2	1/2	2	2
GB34	GBM34	300 - 500	3	2-1/4		2-3/8	2-3/8

<sup>+</sup> GBL30 is not UL listed.


Add "GS" suffix for galvanized steel hardware.


## **TYPES GC, GCM**

#### **GROUND CONNECTOR**

For Two Copper Cables to Bar

High copper alloy ground connector for joining a wide range of two parallel cables to 1/4" thick bar.\* Type GC separates cable from bar, GCM clamps cable to bar surface. One-wrench installation. UL467 Listed. The high copper alloy cast body and DURIUM™ bolts, nuts, and lockwashers make the GC and GCM suitable for direct burial in concrete or ground.

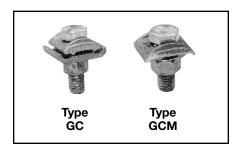

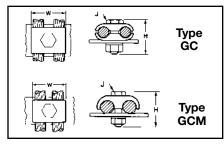





Catalog Number			H Type	H Type		W Type	W Type
Type GC	Type GCM	Conductor	GC/GCL	GCM	J	GC/GCL	GCM
GC4C4C	GCM4C	8 Sol 4 Str.	1-1/2	1-1/2	3/8	1-3/8	1
GC2626	GCM26	4 Sol 2/0 Str.	2	1-1/2	3/0	1-3/4	1-3/8
GCL30	GCM30	4 Str 300	2	_	_	1	
GC2929	GCM29	2/0 Sol 250	2-1/4	2	_	2-1/4	2
GC3434	GCM34	300 - 500	2-7/8	2-1/4	1/2	2-7/8	2-5/8

Smooth oval-shank bolts are available upon request for cabletray applications (example: GC30G3). Also refer to type GC-CT. Add "GS" suffix for galavanized steel hardware.

<sup>\*</sup> For other bar thicknesses see note at bottom of page E-48.

<sup>\*</sup> For other bar thicknesses see note at bottom of page E-48.

E-49

#### **TYPE GL**

#### **GROUND CONNECTOR**


For Two Copper Cables to Bar

High copper alloy ground connector for joining a wide range of two parallel cables to 1/4'' thick bar.\* Two-bolt design, separates cable from bar. One-wrench installation. UL467 Listed. The high copper alloy cast body and DURIUM<sup>TM</sup> bolts, nuts, and lockwashers make them suitable for direct burial in concrete or ground.







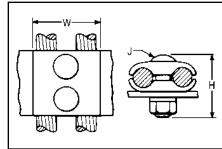

Catalog Number*	Conductor	Н	J	w
GL4C4C	8 Sol 4 Str.	1-1/2	3/8	1-3/8
GL2626	4 Sol 2/0 Str.	2	3/0	1-3/4
GL2929	2/0 Sol 250	2-1/4	1/2	2-1/4
GL3434	300 - 500	2-7/8	1/2	2-7/8

<sup>\*</sup> For other bar thicknesses see note at bottom of page.

### **TYPE GZ**

#### **GROUND CONNECTOR**

For Copper Cable to Bar

High copper alloy ground connector for joining a wide range of cable to 1/4" thick bar\*. Cable is gripped by curving it around the clamping bolt in connector groove. UL467 Listed. The high copper alloy cast body and DURIUM™ bolts, nuts, and lockwashers make them suitable for direct burial in concrete or ground.








Conductor

8 Str. - 4 Str.

3 Str. - 2/0 Str.

3/0 Str. - 250

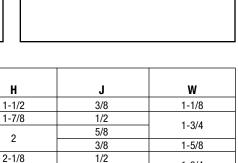

5/8

3/8

1/2

5/8

2-1/4

2-3/8

2-1/2

1-3/4

2-1/4

#### NOTE:

Catalog

Number\*

GZ4C-38

GZ4C-12

GZ4C-58

GZ26-38

GZ26-12

GZ26-58

GZ29-38

GZ29-12

GZ29-58

The GB, GBM, GC, GCM, GL and GZ are all used for joining a range of cable to bar. The catalog numbers in each table accommodate the indicated cable range and up to 1/4" thick bar. Optional bolt lengths are available to accommodate up to 1" thick bar. For bar thicknesses from 1/4" to 1/2", add the suffix "T4" to the catalog number in the table. For bar thicknesses from 1/2" to 1", add the suffix "T8" to the catalog number in the table.

#### **TYPE GC-CT**

## CABLETRAY GROUND CLAMP


This unique connector incorporates features which are unmatched. Made of tin-plated cast copper alloy, it accommodates either one or two conductors, copper or aluminum cable. In addition to a low profile head with a deep Phillips recess, the galvanized steel bolt has a ribbed neck which prevents rotation during installation when installed in a .44 diameter hole. When used on aluminum conductor, the cable must be scratch brushed and PENETROX<sup>TM</sup> A joint compound must be used on cable and connector.

UL467 Listed for copper conductor only. Suitable for direct burial in concrete or earth.







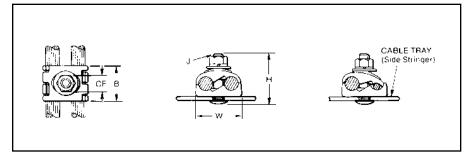

Catalog Number	Accommodates Copper or Alunimum Conductor in Either Groove	В	CF	Н	J	w
GC2525CT	#6 Sol. (.162 Dia.) - 1/0 Str. (.372 Dia.)	1.12	.56	1.95	3/8" - 16	1.45
GC2626CT	#2 Sol. (.258 Dia.) - 2/0 Str. (.419 Dia.)	1.12	.56	1.95	3/8" - 16	1.70
GC2929CT	2/0 Str. (.414 Dia.) - 250 kcmil (.575 Dia.)	1.12	.56	2.20	3/8" - 16	1.98

#### NOTE:

The bolt head is mounted on the inside wall of cabletray to avoid damage to the cable insulation.

May be used with aluminum or galvanized steel cable tray.

#### **TYPE GTC1AC34RA**

## PROTECTIVE GROUNDING CLAMP

#### For Pad Mounted Equipment

A newly designed Protective Grounding Clamp for making secure connections when installing Protective Grounding Sets on Pad Mounted Equipment.

Features a 90° right angle side entry for ferrule. Cable connection will now exit clamp parralel with grounding bar allowing cable set to remain within the cabinet. Closing the cabinet doors will now be easier and will not require infringing on the safety clearance zone.

Eliminates awkward hotstick mounting and tightening of clamp jaws from elevated angles. Improves safety thanks to easier respect of minimum approach distance.

The clamp is used as a base for new grounding sets or can be retrofit on most grounding sets for pad mounted equipment.

Designed and manufactured in the U.S.A.

Catalog Number: GTC1AC34RA




#### **Features**

- ASTM classification (F855-04):
- Grade 3 (27kA for 15 cycles)
- Class A/Type I/C-shape
- Brass alloy
- Weight: 1.85 Lbs.
- Jaw range: round section conductor 3/8" to 3/4" diameter.




E-51



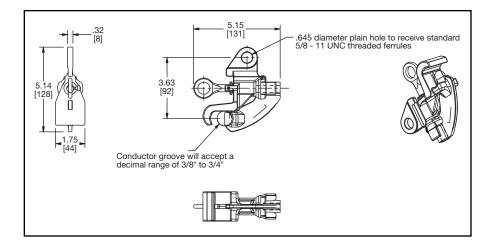

Possible base for a Grounding Set:



Single phase configuration (using standard hardware) Triple phase configuration (using a 4-way connector)


## **TYPE GIE-G**

#### **GROUND CONNECTOR**

For Vehicle Grounding Heavy Duty Construction

High-strength copper alloy ground clamps for grounding gasoline trucks, tank cars, aircraft and other vehicles where danger of explosion due to static electricity exists. Corrosion resistant and supplied with nonsparking, adjustable, replaceable contact grip screws. Automatic safety release disconnects should a vehicle unexpectedly move from the grounded area. Accommodates 4 Str. flexible copper cable.



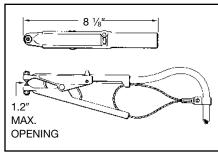


	Replaceable Contact Grip Screws							
Catalog Number	Catalog Number	Material	Point Configuration					
GIE4CG3	GIE4CG3P5	Beryllium Copper	Cone Point					
uic40u3	GIE4CG3P7	Derymum Copper	Cup Point					
GIE4CG4	GIE4CG4P5	Stainless Steel	Cone Point					
uic40u4	GIE4CG4P7	Statiliess steel	Cup Point					


### **TYPE GIE-G**

#### **GROUND CONNECTOR**

Accommodates flexible rubber sheath cable ranging from #6 to #2 conductor.

Catalog Number: GIE2CG3

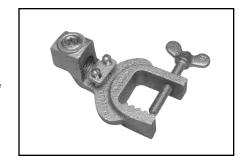

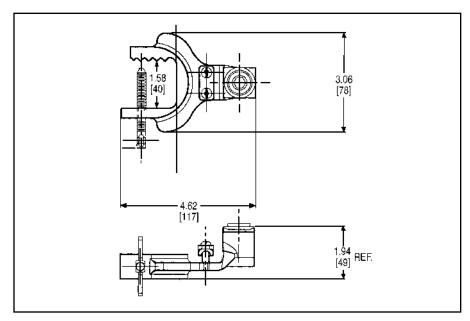



Blue highlighted items are industry standard and most frequently ordered.


Canada: 1-800-387-6487 www.burndy.com US: 1-800-346-4175


## **RAIL CONNECTOR**

Mechanical clamp connectors designed for use in power, contact or running rail applications. Connectors are cast of a high conductivity copper alloy, tin-plated, and assembled with high-strength DURIUM™ hardware. Connectors designed for extended service life.

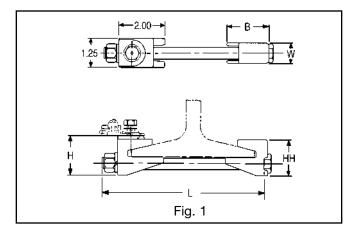

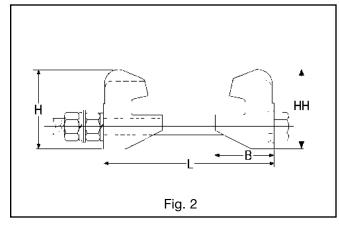

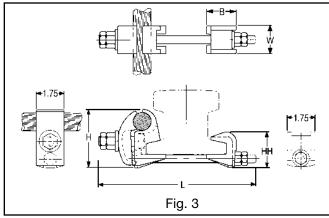

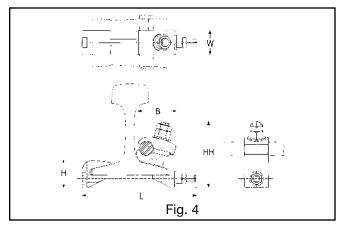

Catalog Number	Fig. No.	Accommodates	В	н	нн	L	w
J278	1	100 Lbs. A.R.E.A. Running Rail	1.81	1.88	1.72	7.50	.88
J279	1	75 or 90 Lbs. Running Rail	1.81	1.71	1.55	7.50	.88
J280	1	150 Lbs. Contact Rail	2.12	2.08	1.92	7.00	1.25
J295	2	150 Lbs. Third Rail	2.62	3.50	3.50	7.75	3.00
RGC44G1*	3	150 Lbs. NMC Contact Rail and (1) 800-1000 kcmil CU Cable	1.75	2.82	2.25	10.00	1.75
RGC39G1*	4	115 Lbs. Contact or Running Rail and (1) 500-750 kcmil CU Cable	2.75	2.00	4.78	8.32	1.25

<sup>\*</sup> Tin-plated.

E-53

## **TYPE QGFL**


#### $\mathbf{BARTAP^{TM}}$

For Copper Cable to Flat Bar or Pad

High copper alloy BARTAP $^{\text{TM}}$  for joining a range of cable to bar or pad. One-wrench installation. DURIUM $^{\text{TM}}$  nut and lockwasher.





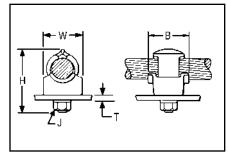

Catalog					T		
Number	Conductor	В	Н	J	(Max.)	W	
QGFL1CB1	10 Sol 1 Str.	1-1/8	1-7/8		1/4	- 1	
QGFL1CB1T6	10 501 1 511.	1-1/6	2-3/8	3/8	3/4	] '	
QGFL26B1			2-1/8	3/6	1/4		
QGFL26B1T6	8 Sol 2/0 Str.	1-1/4	2-5/8		3/4	1-1/8	
QGFL26B2*	0 301 2/0 311.		1-1/2		1/4	1-1/6	
QGFL26B2T6*		1-1/2	2-7/8		3/4		
QGFL29B1*	C C+* OEO	1-5/8	2-5/8		1/4	1-3/8	
QGFL29B1T6*	6 Str 250		3-1/8		3/4	1-3/0	
QGFL31B1*	2 Sol 350	1-3/4	2-7/8		1/4	1-5/8	
QGFL31B1T6*	2 301 330		3-1/4		3/4	1-3/0	
QGFL34B1	1/0 Sol 500	2	3-1/8		1/4	1-3/4	
QGFL34B1T6	1/0 301 300	2	3-5/8	1/2	3/4		
QGFL39B1	350 - 750		3-1/4	1/2	1/4	1-3/4	
QGFL39B1T6	330 - 730		3-5/8		3/4	1-3/4	
QGFL44B1	750 - 1000		3-3/8		1/4	2-1/8	
QGFL44B1T6	730 - 1000	2-1/4	4-1/8		3/4	2-1/0	
QGFL46B1	1000 - 1500	2-1/4	4	7	1/4	2-1/2	
QGFL46B1T6	1000 - 1500		4-1/2		3/4	2-1/2	
QGFL48B1	1500 - 2000		4-3/4		1/4	3	


 $<sup>^{\</sup>star}$  Can be installed side by side or in line on NEMA drilled bar.


#### **TYPE GA-H**

#### **GROUND CONNECTOR**

For Copper Cable to "H" Beam

High copper alloy ground connector for joining a wide range of cable parallel to "H" beams or square tube. Hardware is made from DURIUM $^{\text{TM}}$  for superior corrosion protection.

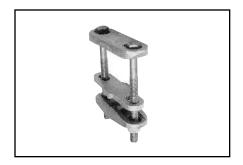

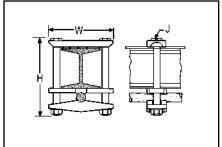


Catalog	Conducto				
Number	"H" Beam	Cable	Н	J	W
GA25H26	1-7/8" × 1-7/8" - 2-1/2" × 2-1/2"	4 Sol 2/0 Str.	4-3/4	3/8	4

#### **TYPE GRF**

# UNIGROUND™ RAISED FLOOR GROUNDING CONNECTOR

The BURNDY® UNIGROUND™ is a universal grounding clamp, specifically designed for all raised flooring systems. It can be installed on round or square pedestals and can accommodate one or two grounding wires to make an efficient grid. The underfloor signal reference grid provides the low impedance ground path that attenuates high frequency static and 60 Hz transient noise for cleaner data output. UL467 Listed.

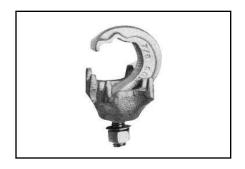








#### **Features and Benefits**

- One connector fits all applications.
- ♦ Ease of specification and installation.
- Single bolt design.
  - ♦ Ease of installation:
    - No need to disassemble.
    - Single wrench installation.
- Accepts 1 or 2 ground conductors.
- ♦ Requires less connectors to install signal reference grid.
- Tin plated cast bronze construction.
  - ♦ Resists corrosion and provides extended life ground connection.

- Grounds all pedestals (round or square).
   Will handle up to 7/8" square and 1" round.
  - Ease of installation. One connector does it all
- Serves 3 needs:
  - 1. Signal Reference Grid.
  - 2. Static Ground.
  - 3. Fault Current Ground.
  - ♦ UNIGROUND™ solves all possible grounding problems found in computer applications today.

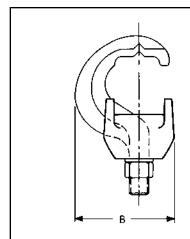

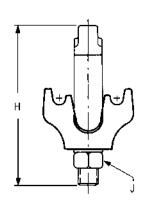



Catalog	Number of	Conductor	Pedestal Type					
Number	Conductors	Size Sol. & Str.	Round	Square	В	Н	J	W
GRF4C-3	1 or 2	#8 - #2	Up to 1"	Up to 7/8"	1.96	3.14	3/8"	1.76
GRF4C-4	1 or 2	#8 - #2	Up to 3/4"	Up to 5/8"	1.79	3.13	3/8"	1.40

## **TYPES GP-G1, GP-RT**

#### RAISED FLOOR GROUNDING CLAMPS

High copper alloy ground connector for raised floor computer grounding applications. These connectors can be installed on round and square pedestal applications and will accommodate one or two grounding wires to make an efficient grid. The underfloor signal reference grid provides the low impedance ground path that attenuates high frequency static and 60 Hz transient noise for cleaner data output. UL467 Listed.

In addition we offer the GP1726RT, which is especially designed for penetrating epoxy paint on pedestals. This patented connector offers a low impedance, time saving connection between conductors and the Pedestal.








#### **Features and Benefits**

- Accepts 1 or 2 Ground Conductors
  - Requires less connectors to install signal reference grid.
- Made of copper alloy.
- DURIUM™ U-Bolts, nuts and lockwashers.
  - Provides a low impedance ground path for maximum performance.
- Grounds all pedestals (round or square).
- $\bullet$  Will handle from  $3\!/\!4"$  to 1" round or square.
  - ♦ Ease of installation.
- Serves 3 needs.
  - 1. Signal Reference Grid.
  - 2. Static Ground.
  - 3. Fault Current Ground.
  - Connectors solves all possible grounding problems found in computer applications today.

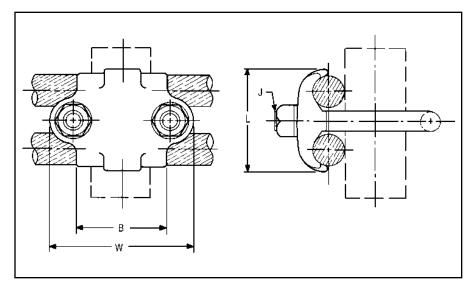

Catalog	Number of	Conductor	Pedestal Type				
Number	Conductors	Size Sol. & Str.	Round or Square	В	J	L	W
GP654CG1	1 or 2	#8 Sol 4 Str.	3/4" - 1" Round	1.5	3/8"	1.31	2.38
GP64526G1	1 or 2	#4 Sol 2/0 Str.	3/4" - 7/8" Square	1.5	3/8"	1.69	2.38
GP1526G1	1 or 2	#4 Sol 2/0 Str.	1-1/4" Round	1.75	3/8"	1.69	2.62
GP1726RT	1 or 2	#6 Sol 2/0 Str.	2" Round	2.12	3/8"	1.50	3.22
GP1726G1	1 or 2	#6 Sol 2/0 Str.	2" Round	2.12	3/8"	1.50	3.22


#### **TYPE BBB**


#### **BURNDY®** BusBar

#### Copper BusBar

Bare copper BusBar, UL Listed for grounding. Available in many sizes and hole patterns. Brackets and insulators included with most styles. Also available in undrilled, horizontal and vertical versions.

BusBar is used in a variety of applications. Can be used as a common ground point and "power" applications as well.

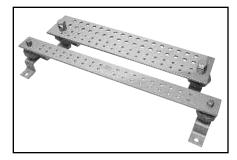

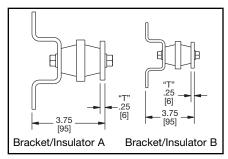






Catalog Number	Fig. No.	Insulator & Bracket	T - Bar Thickness	W - Bar Width	L - Bar Length	E1	E2	<b>E</b> 3	F1	F2	No. of Holes	K
BBB14210A	1	Α	1/4"	2"	10"	.63	_	_	1.00	_	16	.28
BBB14224B	2	Α	1/4"	2"	24"	.625	.75	_	1.00	1.00	36	.28
BBB14410C	3	А	1/4″	4"	10"	.75	1.00	_	1.25	_	6 16	6-32 .28
BBB14410D	4	А	1/4"	4"	10"	1.25	1.00	_	1.13	1.13	6 16	6-32 .28
BBB14412E	5	Α	1/4"	4"	12"	.75	_	_	2.00	1.25	18	.44
BBB14412F	6	А	1/4"	4"	12"	1.00	.75	_	2.00	1.25	12 12	.44 .28
BBB14416G	7	В	1/4"	4"	16"	.75	1.00	_	1.69	_	24	.44
BBB14416H	8	В	1/4″	4"	16"	1.00	1.00	.75	1.69	_	16 16	.44 .25
BBB14420J	9	В	1/4″	4"	20"	1.00	1.00	.75	1.00	_	34 34	.44 .25
BBB412UD	N/A	Α	1/4"	4"	12"	N/A	N/A	N/A	N/A	N/A	N/A	N/A
BBB424UD	N/A	В	1/4"	4"	24"	N/A	N/A	N/A	N/A	N/A	N/A	N/A
BBBHR19* BBBVR36*	N/A N/A	N/A N/A	3/16" 1/4"	3/4" 5/8"	19" 36"	.38 .32	Contact Factory for Dimensions					

<sup>\*</sup> Not UL Listed.

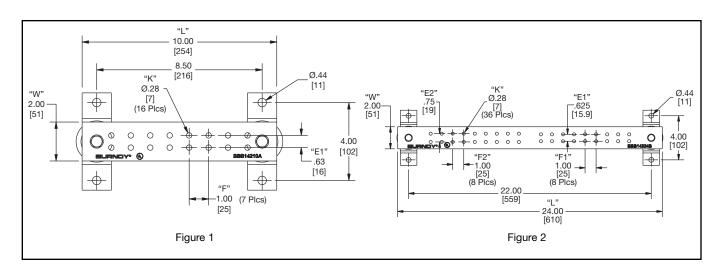



(Figures continued on next page)

#### **TYPE BBB**

#### **BURNDY® BusBar**

Copper BusBar (Continued)

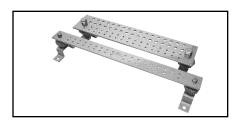

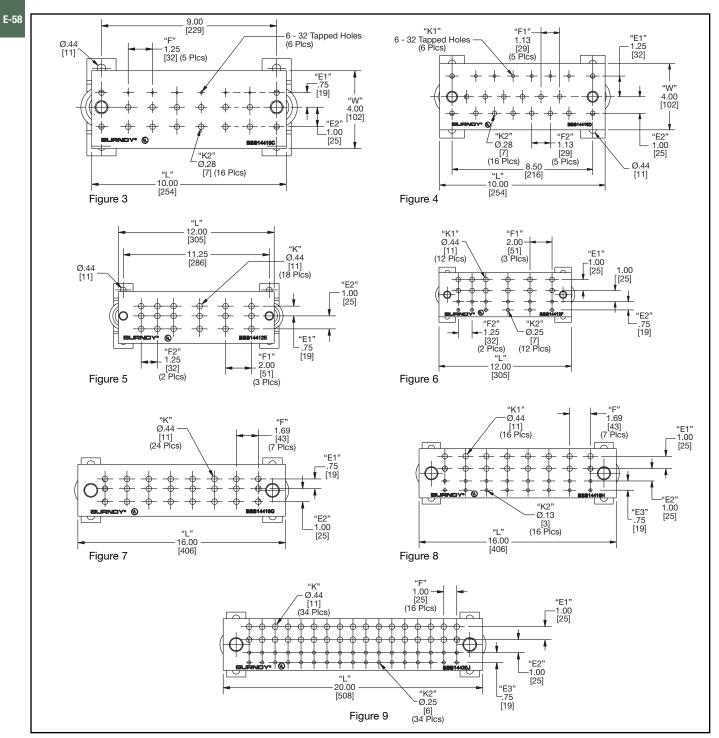

## **TABLE OF CONTENTS**

#### **BURNDYWeld®**

	BURNDYWeld® Introduction	Type <b>BCR-24 E-73</b>
	Making a BURNDYWeld®  Connection E-61	Single Shot Molds E-74
		Type <b>BCS-1 E-75</b>
700	WELD METAL E-62	Type <b>BCS-8 E-75</b>
	Type <b>BCC-1 E-63</b>	Type <b>BCS-2 E-76</b>
	Type <b>BCC-2 E-64</b>	Type <b>BCS-9 E-76</b>
	Type <b>BCC-4 E-65</b>	
	Type <b>BCC-11 E-66</b>	Type <b>BCS-3 E-77</b>
	Type <b>BCC-6 E-67</b>	Type <b>BCS-23 E-78</b>
		Type <b>BCS-4 E-79</b>
	Type <b>BCC-14 E-67</b>	Type <b>BCS-6 E-79</b>
	Type <b>BCC-7 E-68</b>	Type <b>BCS-7E-80</b>
	Type BCR-1 E-69 RUS Accepted	Type <b>BCS-18 E-80</b>
	Type <b>BCR-2 E-70</b>	
	Type <b>BCR-3 E-71</b>	BURNDY® GROUNDMAX™E-87 - E-88
	Type <b>BCR-17 E-72</b>	BURNDY® GRIDMAX <sup>TM</sup> E-89

For mold types or BURNDYWeld® items not shown, please contact factory.

#### **BURNDYWeld®**

The BURNDYWeld® connection process is a simple, efficient method of welding copper to copper or copper to steel. One advantage is that NO outside power is required when using the BURNDYWeld® exothermic process. The BURNDYWeld® process uses high temperature reaction of powdered copper oxide and aluminum. The reaction takes place in a semi-permanent graphite mold. These molds will last for fifty or more welds if proper care is given. The reaction takes place very rapidly, therefore the total amount of heat applied to the conductors or surfaces is considerably less than that of brazing or soldering. It is important to remember this when welding to insulated cable or thin wall pipe.

This system is very field friendly, since it is light and portable and requires no outside power source. It requires very little time or skill to obtain an efficient, maintenance free connection when using the BURNDYWeld® process.

For more information visit our website at www.burndy.com.


The BURNDYWeld® process has been used to weld materials other than copper for electrical purposes. Materials welded include:


Stainless Steel Columbium Brass Copperweld® Plain Steel **Bronze** Nichrome V **Everdur®** Niobium Galvanized Steel Kama Chromax Silcone Bronze Steel Rail Cast Iron Copper Clad Steel Cor-Ten® Monel

When welding to galvanized steel it is recommended to resurface exposed bare steel.

The BURNDYWeld® connection is a molecular weld. The weld metal has the same melting point as copper. These factors along with the increased cross section of the connection, BURNDYWeld® connections:

- Will not be affected by a high current surge. Tests have shown that the electrical conductor will melt before the BURNDYWeld® connection when subjected to high short circuit current. Consult IEEE Standard 837-1989.
- Will not loosen or corrode at the point of weld. There are no contact surfaces or mechanical pressures involved. A BURNDYWeld® connection becomes an integral part of the conductor.
- 3. Have a current-carrying capacity equal to or greater than that of the conductors.

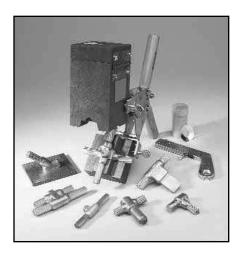

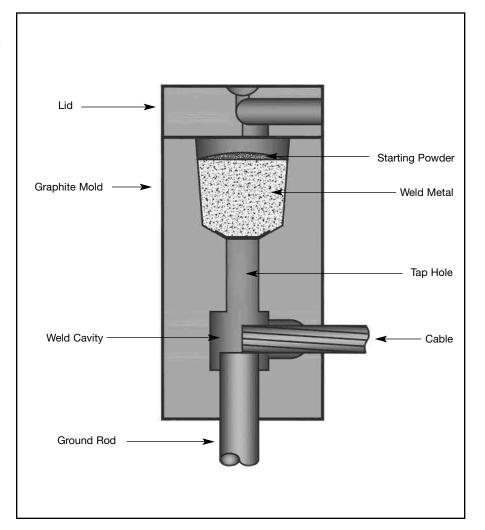

For mold types or BURNDYWeld® items not shown, please contact factory.

## Making a BURNDYWeld® Connection



Step 1

Position cleaned conductors in mold after making sure mold is dry, by pre-heating or making a test joint.




Step 2

Place metal disc in bottom of mold crucible.



Step 3

Dump powder into crucible, being careful not to loosen all the starting powder.

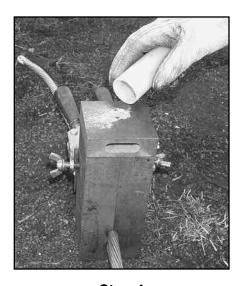


Step 4

Close lid and place a small amount of starting powder in the ignition pocket.



Step 5

Ignite the starting powder with the Flint Ignitor.

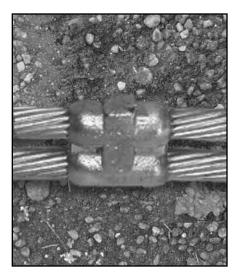

Step 6

Wait 15 seconds, then remove weld and clean mold before making next connection.

For mold types or BURNDYWeld® items not shown, please contact factory.

#### **WELD METAL**

BURNDYWeld® Weld Metal is packed in moisture-resistant plastic cartridges that have tight fitting caps. These cartridges, along with the necessary steel discs, are then packed in boxes that are hermetically-sealed. This ensures the powder arriving in good condition, always dry and ready for fast positive ignition.

BURNDYWeld® Weld Metal comes in several types; one for welding copper to copper, copper to steel, copper to rail, copper to cast iron and one for welding copper to steel for cathodic protection. The size and weight (in grams) of the cartridge are marked on each individual cartridge.



Standard Cartridge Size	Cast Iron Cartridge Size	Cathodic Protection Cartridge Size	Rail Cartridge Size	Cartridges Per Box
15	15CI	15CP	15R	20
25	25CI	25CP	25R	20
32	32CI	32CP	32R	10
45	45CI	45CP	45R	20
65	65CI	65CP	65R	20
90	90CI	_	90R	10
115	115Cl	_	115R	10
150	_	_	150R	10
200	_	_	200R	10
250	_	_	250R	10
500	_	_	500R	10

 ${\it BURNDYWeld}^{\scriptsize \textcircled{\tiny B}}$  Weld Metal is sold in box quantities only.

#### **Steel Discs Sold Separately**

Weld Metal Size	Catalog Number Steel Discs Only	Package Quantity
15 to 65	B370320-01	20
90 to 115	B370320-02	10
150 to 500	B370320-03	10

For mold types or BURNDYWeld® items not shown, please contact factory.


## **BCC-1 TYPE MOLDS**

#### **Horizontal End to End**

BCC-1 Type Molds are used for horizontal end to end cable connections.

Size range is #6 through 1000 kcmil solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

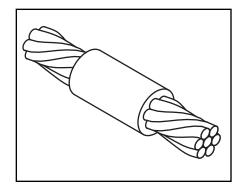



Cable	Mold Number	Price Key	Weld Metal	Handle Clamps
#8	Use Type BCC-14 on Page E-67	_	_	_
#6	Use Type BCC-14 on Page E-67	_	_	_
#4	B-5623	18 † *	25	N/A
#3	B-5624	18 † *	32	N/A
#2	B-5625	18 † *	32	N/A
#1	B-5626	18 † *	32	N/A
1/0	B-205	4	45	B-106
2/0	B-206	4	65	B-106
3/0	B-207	4	90	B-106
4/0	B-208	4	90	B-106
250 kcmil	B-209	4	115	B-106
300 kcmil	B-210	4	115	B-106
350 kcmil	B-211	4	150	B106
500 kcmil	B-213	4	200	B-107
750 kcmil	B-214	5	2-150	B-107
1000 kcmil	B-215	5	2-200	B-107

- For sizes not listed, contact BURNDY®.
   Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
   For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
   For expedited service, contact BURNDY®.

Required Tools:
Handle Clamps (see chart for correct handles)
† Sold complete with handles
\* B38-0309-00 Flint Ignitor (included)
Other recommended accessories:

B38-3922-00 Mold Cleaning Brush (pg E-92) B38-0135-00 Cable Cleaning Brush (pg E-92) B38-0330-00 Cable Clamp (pg E-92)

For mold types or BURNDYWeld® items not shown, please contact factory.


#### **TYPE BCC-2 MOLDS**

#### **Horizontal Cable Tap to Horizontal Cable Run**

Type BCC-2 Molds are used to join horizontal cable tap to a horizontal run cable.

Size range is #6 through 750 kcmil solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

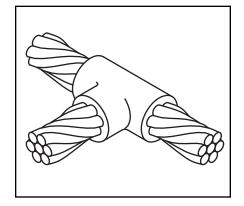



Cable			Price	Weld	Handle
Run	Тар	Mold Number	Key	Metal	Clamps
#6	#6	Use Type BCC-14 on Page E-67	_	_	
#4	#4	B-221	4	32	B-106
#2	#2	B-223	4	45	B-106
#2	#4	B-224	4	45	B-106
	#1	B-225	4	45	B-106
#1	#2	B-226	4	45	B-106
	#4	B-227	4	45	B-106
	1/0	B-228	4	90	B-106
1/0	#1	B-229	4	45	B-106
1/0	#2	B-230	4	45	B-106
	#4	B-231	4	45	B-106
	2/0	B-232	4	90	B-106
	1/0	B-233	4	90	B-106
2/0	#1	B-234	4	45	B-106
	#2	B-235	4	45	B-106
	#4	B-5475	4	45	B-106
	3/0	B-236	4	115	B-106
	2/0	B-237	4	90	B-106
3/0	1/0	B-238	4	90	B-106
3/0	#1	B-239	4	45	B-106
	#2	B-240	4	45	B-106
	#4	B-5574	4	45	B-106
	4/0	B-241	4	150	B-106
	3/0	B-242	4	115	B-106
	2/0	B-243	4	90	B-106
4/0	1/0	B-244	4	90	B-106
	#1	B-245	4	90	B-106
	#2	B-246	4	90	B-106
	#4	B-5021	4	90	B-106
	250 kcmil	B-247	4	150	B-106
	4/0	B-248	4	150	B-106
	3/0	B-249	4	150	B-106
250 kcmil	2/0	B-250	4	90	B-106
	1/0	B-251	4	90	B-106
	#1	B-252	4	90	B-106
	#2	B-253	4	90	B-106

	For	sizes	not	listed	contact	BURNDY®
•	I UI	31253	HUL	iioteu.	CUIILACI	DUMINUI

Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid

• For expedited service, contact BURNDY®.

Cabl	е		Price	Weld	Handle
Run	Тар	<b>Mold Number</b>	Key	Metal	Clamps
	300 kcmil	B-254	4	200	B-106
	250 kcmil	B-255	4	150	B-106
	4/0	B-256	4	150	B-106
000 1/2001	3/0	B-257	4	150	B-106
300 kcmil	2/0	B-258	4	90	B-106
	1/0	B-259	4	90	B-106
	#1	B-260	4	90	B-106
	#2	B-261	4	90	B-106
	350 kcmil	B-262	4	200	B-106
	300 kcmil	B-263	4	200	B-106
	250 kcmil	B-264	4	200	B-106
	4/0	B-265	4	150	B-106
350 kcmil	3/0	B-266	4	150	B-106
	2/0	B-267	4	90	B-106
	1/0	B-268	4	90	B106
	#1	B-269	4	90	B-106
	#2	B-270	4	90	B-106
	500 kcmil	B-280	4	2-150	B-106
	350 kcmil	B-282	4	200	B-106
	300 kcmil	B-283	4	200	B-106
	250 kcmil	B-284	4	200	B-106
500 kcmil	4/0	B-285	4	150	B-106
	2/0	B-286	4	90	B-106
	1/0	B-287	4	90	B-106
	#1	B-288	4	90	B-106
	#2	B-289	4	90	B-106
	750 kcmil	B-290	5	500	B-107
	500 kcmil	B-291	5	2-200	B-107
	350 kcmil	B-293	4	250	B-106
750 kcmil	300 kcmil	B-294	4	200	B-106
7 DU KUIIIII	250 kcmil	B-295	4	200	B-106
	4/0	B-296	4	150	B-106
	2/0	B-297	4	150	B-106
	1/0	B-298	4	150	B-106

Required Tools:

Handle Clamps (see chart for correct handles) **B38-0309-00** Flint Ignitor

Other recommended accessories:

B40-0319-01 Mold Cleaner for cartridge sizes #15-#65 (pg E-92) B40-0319-03 Mold Cleaner for cartridge sizes #90-#500 (pg E-92) B38-3922-00 Mold Cleaning Brush (pg E-92)

B38-0135-00 Cable Cleaning Brush (pg E-92) B38-0330-00 Cable Clamp (pg E-92)

For mold types or BURNDYWeld® items not shown, please contact factory.

For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDV®.


#### **TYPE BCC-4 MOLDS**

#### **Horizontal to Horizontal Cable Cross**

Type BCC-4 Molds are used to join two horizontal cables at right angles. One cable is cut and the other is a through run.

Size range is #6 through 500 kcmil solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

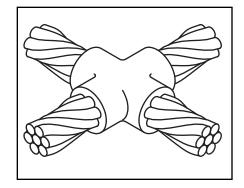



Cable			Price	Weld	Handle
Run	Тар	<b>Mold Number</b>	Key	Metal	Clamps
#6	#6	Use Type BCC-11 on Page E-66	_		-
#4	#4	B-423	4	45	B-106
#3	#3	B-424	4	45	B-106
"0	#2	B-425	4	65	B-106
#2	#4	B-426	4	65	B-106
	#1	B-427	4	65	B-106
#1	#2	B-428	4	65	B-106
	#4	B-429	4	65	B-106
	1/0	B-430	4	90	B-106
1 /0	#1	B-431	4	90	B-106
1/0	#2	B-432	4	90	B-106
	#4	B-433	4	90	B-106
	2/0	B-434	4	115	B-106
0./0	1/0	B-435	4	115	B-106
2/0	#1	B-436	4	115	B-106
	#2	B-437	4	115	B-106
	3/0	B-438	4	150	B-106
	2/0	B-439	4	150	B-106
3/0	1/0	B-440	4	115	B-106
	#1	B-441	4	115	B-106
	#2	B-442	4	115	B-106
	4/0	B-443	4	200	B-106
	3/0	B-444	4	200	B-106
4/0	2/0	B-445	4	150	B-106
4/0	1/0	B-442	4	150	B-106
	#1	B-447	4	115	B-106
	#2	B-448	4	115	B-106
	250 kcmil	B-449	4	200	B-106
	4/0	B-450	4	200	B-106
	3/0	B-451	4	200	B-106
250 kcmil	2/0	B-452	4	150	B-106
	1/0	B-453	4	150	B-106
	#1	B-454	4	115	B-106
	#2	B-455	4	115	B-106

•	For sizes	not	listed,	contact	BUF	RNDY	®.

- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- · For expedited service, contact BURNDY®.

Cable			Price	Weld	Handle
Run	Тар	Mold Number	Key	Metal	Clamps
	300 kcmil	B-456	4	250	B-106
	250 kcmil	B-457	4	250	B-106
	4/0	B-458	4	200	B-106
000 kamil	3/0	B-459	4	200	B-106
300 kcmil	2/0	B-460	4	150	B-106
	1/0	B-461	4	150	B-106
	#1	B-462	4	115	B-106
	#2	B-463	4	115	B-106
	350 kcmil	B-464	4	250	B-106
	300 kcmil	B-465	4	250	B-106
	250 kcmil	B-466	4	250	B-106
	4/0	B-467	4	200	B-106
350 kcmil	3/0	B-468	4	200	B-106
	2/0	B-469	4	200	B-106
	1/0	B-470	4	200	B-106
	#1	B-471	4	150	B-106
	#2	B-472	4	150	B-106
	500 kcmil	B-483	5	500	B-107
	350 kcmil	B-485	5	2-200	B-107
	300 kcmil	B-486	5	2-200	B-107
	250 kcmil	B-487	5	2-150	B-107
500 kcmil	4/0	B-488	5	2-150	B-107
SOO KCIIIII	3/0	B-489	5	2-150	B-107
	2/0	B-490	4	250	B-106
	1/0	B-491	4	250	B-106
	#1	B-492	4	200	B-106
	#2	B-493	4	200	B-106

Required Tools: Handle Clamps (see chart for correct handles) B38-0309-00 Flint Ignitor

B38-0309-00 Finit Ignitor
Other recommended accessories:
B40-0319-01 Mold Cleaner for cartridge sizes #15-#65 (pg E-92)
B40-0319-03 Mold Cleaner for cartridge sizes #90-#500 (pg E-92)
B38-3922-00 Mold Cleaning Brush (pg E-92)
B38-0330-00 Cable Cleaning Brush (pg E-92)
B38-0330-00 Cable Clamp (pg E-92)

For mold types or BURNDYWeld® items not shown, please contact factory.

## E-66


#### **TYPE BCC-11 MOLDS**

#### **Horizontal to Horizontal Cable Cross**

Type BCC-11 Molds are used to join uncut horizontal cables at right angles to each other.

Size range is #6 through 500 kcmil solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

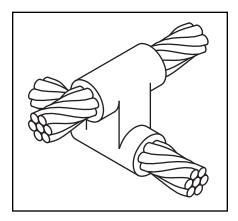



Cab	le		Price	Weld	Handle
Run	Tap	Mold Number	Key	Metal	Clamps
#6	#6	B-5432	191*	45	N/A
#4	#4	B-2687	4	65	B-106
#2	#2	B-2689	4	90	B-106
#2	#4	B-2690	4	65	B-106
	#1	B-2691	4	115	B-106
#1	#2	B-2692	4	90	B-106
	#4	B-2693	4	90	B-106
	1/0	B-2694	22	150	B-106
1/0	#1	B-2695	22	150	B-106
1/0	#2	B-2696	22	115	B-106
	#4	B-2697	22	115	B-106
	2/0	B-2698	22	200	B-106
2/0	1/0	B-2699	22	200	B-106
2/0	#1	B-2700	22	150	B-106
	#2	B-2701	22	150	B-106
	3/0	B-2702	22	250	B-106
	2/0	B-2703	22	200	B-106
3/0	1/0	B-2704	22	200	B-106
	#1	B-2705	22	150	B-106
	#2	B-2706	22	150	B-106

- For sizes not listed, contact BURNDY®.
   Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.

Cabl	е		Price	Weld	Handle
Run	Тар	<b>Mold Number</b>	Key	Metal	Clamps
	4/0	B-2707	22	250	B-106
	3/0	B-2708	22	250	B-106
4/0	2/0	B-2709	22	200	B-106
4/0	1/0	B-2710	22	200	B-106
	#1	B-2711	22	150	B-106
	#2	B-2712	22	150	B-106
	250 kcmil	B-2713	22	2-150	B-106
	4/0	B-2714	22	2-150	B-106
	3/0	B-2715	22	2-150	B-106
250 kcmil	2/0	B-2716	22	250	B-106
	1/0	B-2717	22	150	B-106
	#1	B-2718	22	200	B-106
	#2	B-2719	22	150	B-106
	500 kcmil	B-2747	23	3-250	B-107
	250 kcmil	B-2751	23	500	B-107
	4/0	B-2752	23	500	B-107
500 kcmil	3/0	B-2753	23	500	B-107
	2/0	B-2754	23	2-200	B-107
	1/0	B-2755	22	2-150	B-106
	#1	B-2756	22	250	B-106
	#2	B-2757	22	250	B-106

Required Tools: Handle Clamps (see chart for correct handles)

Sold complete with handles **B38-0309-00** Flint Ignitor

\* B38-0309-00 Flint Ignitor
Other recommended accessories:
B40-0319-01 Mold Cleaner for cartridge sizes #15-#65 (pg E-92)
B40-0319-03 Mold Cleaner for cartridge sizes #90-#500 (pg E-92)
B38-0322-00 Mold Cleaning Brush (pg E-92)
B38-0135-00 Cable Cleaning Brush (pg E-92)
B38-0330-00 Cable Clamp (pg E-92)

For mold types or BURNDYWeld® items not shown, please contact factory.

Price

Key

4

4

4

4

4

4

4

4

4

4

4

4

4

4

4

4

4

4

4

4

4

4

4

4

Weld

Metal

90

65

65

45

45

45

115

115

90

90

65

65

65

65

150

115

115

115

115

90

90

90

Handle

**Clamps** 

B-106


#### **BCC-6 TYPE MOLDS**

#### **Horizontal Parallel Tap**

BCC-6 Type Molds are used to join horizontal parallel tap to run connections. The tap cable is over the run cable.

Size range is #6 through 4/0 solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

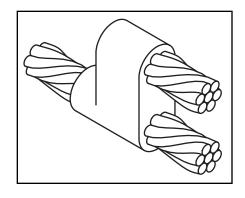

Cable

Tap

1/0

#1

#2

#4

#6

#6 Sol

#8 Sol

2/0

1/0

#1

#2

#4

#6

#6 Sol

#8 Sol

4/0

2/0

1/0

#1

#2

#4

#6

#6 Sol

#8 Sol

Run

1/0

2/0

4/0



**Mold Number** 

B-1287

B-1288

B-1289

B-1290

B-1291

B-1292

B-1293

B-1294

B-1295

B-1296

B-1297

B-1298

B-1299

B-1300

B-1301

B-1302

B-1303

B-1304

B-1305

B-1306

B-1307

B-1308

B-1309

B-1310

Cabl	е		Price	Weld	Handle
Run	Тар	Mold Number	Key	Metal	Clamps
#6 Sol	#6 Sol	B-1270	4	25	B-106
#6	#6	B-1271	4	25	B-106
	#4	B-1272	4	32	B-106
#4	#6	B-1273	4	32	B-106
#4	#6 Sol	B-1274	4	32	B-106
	#8 Sol	B-1275	4	32	B-106
	#2	B-1276	4	65	B-106
	#4	B-1277	4	45	B-106
#2	#6	B-1278	4	32	B-106
	#6 Sol	B-1279	4	32	B-106
	#8 Sol	B-1280	4	32	B-106
	#1	B-1281	4	65	B-106
	#2	B-1282	4	65	B-106
#1	#4	B-1283	4	45	B-106
	#6	B-1284	4	45	B-106
	#6 Sol	B-1285	4	45	B-106
	#8 Sol	B-1286	4	45	B-106

•	For sizes	not listed,	contact	BURNDY®.
---	-----------	-------------	---------	----------

- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid
- conductors.
  For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.
   Required Tools:

Handle Clamps (see chart for correct handles)

Sold complete with handles

B38-0309-00 Flint Ignitor

Other recommended accessories:

B38-3922-00 Mold Cleaning Brush (pg E-92)
B38-0135-00 Cable Cleaning Brush (pg E-92)

B38-0330-00 Cable Clamp (pg E-92)


### **BCC-14 TYPE MOLDS**

#### **Horizontal Parallel through Cables**

BCC-14 Type Molds are used to join horizontal parallel through run cables. Cables run side by side in the mold.

Size range is #8 through #6 solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed.

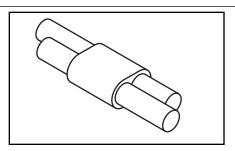

Cab	le		Price	Weld	Handle
Run	Тар	Mold Number	Key	Metal	Clamps
#8	#8	B-5709	18+	15	N/A
#6	#6	B-5618	18+	25	N/A

#### For mold types or BURNDYWeld® items not shown, please contact factory.

US: 1-800-346-4175	www.burndy.com	Canada: 1-800-387-6487

#### E-68


#### **BCC-7 TYPE MOLDS**

#### **Horizontal Parallel through Cables**

BCC-7 Type Molds are used to join horizontal parallel through run cables. One cable runs above the other cable in the mold.

Size range is #6 through 4/0 solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

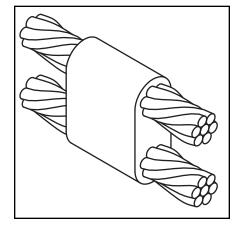



Cabl	е		Price	Weld	Handle
Run	Тар	Mold Number	Key	Metal	Clamps
#6	#6	Use Type BCC-14 on Page E-67	_	_	_
	#4	B-1311	4	32	B-106
	#6	B-5627	4	32	B-106
#4	#6 Sol	B-8882	4	32	B-106
	#8	B-5629	4	32	B-106
	#8 Sol	B-5630	4	32	B-106
	#2	B-1313	4	65	B-106
	#4	B-1314	4	65	B-106
#2	#6	B-5631	4	45	B-106
#2	#6 Sol	B-5632	4	45	B-106
	#8	B-5634	4	45	B-106
	#8 Sol	B-5635	4	45	B-106
	#1	B-1315	4	65	B-106
	#2	B-1316	4	65	B-106
	#4	B-1317	4	65	B-106
#1	#6	B-5636	4	65	B-106
	#6 Sol	B-5637	4	65	B-106
	#8	B-5638	4	45	B-106
	#8 Sol	B-5639	4	45	B-106
	1/0	B-1318	4	90	B-106
	#1	B-1319	4	65	B-106
	#2	B-1320	4	65	B-106
1/0	#4	B-1321	4	65	B-106
1/0	#6	B-5642	4	65	B-106
	#6 Sol	B-1208	4	65	B-106
	#8	B-5644	4	65	B-106
	#8 Sol	B-5645	4	65	B-106

•	For sizes not listed, co	ntact BURNDY®.
	Martida Patada a conforma	and a second description of the

Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid

For expedited service, contact BURNDY®.

Cab	le		Price	Weld	Handle
Run	Тар	<b>Mold Number</b>	Key	Metal	Clamps
	2/0	B-1322	4	115	B-106
	1/0	B-1323	4	115	B-106
	#1	B-1324	4	90	B-106
0/0	#2	B-1325	4	90	B-106
2/0	#4	B-5659	4	90	B-106
	#6	B-5342	4	90	B-106
	#6 Sol	B-5652	4	90	B-106
	#8	B-5668	4	65	B-106
	#8 Sol	B-5943	4	65	B-106
	3/0	B-1326	4	150	B-106
	2/0	B-1327	4	150	B-106
	1/0	B-1328	4	115	B-106
	#1	B-1329	4	115	B-106
3/0	#2	B-1330	4	115	B-106
	#4	B-6046	4	115	B-106
	#6	B-5676	4	90	B-106
	#6 Sol	B-5679	4	90	B-106
	#8	B-5680	4	90	B-106
	#8 Sol	B-5682	4	90	B-106
	4/0	B-1331	4	200	B-106
	3/0	B-1332	4	200	B-106
	2/0	B-1333	4	150	B-106
	1/0	B-1334	4	150	B-106
	#1	B-1335	4	150	B-106
4/0	#2	B-1336	4	150	B-106
	#4	B-5340	4	150	B-106
	#6	B-5684	4	90	B-106
	#6 Sol	B-6552	4	90	B-106
	#8	B-5686	4	90	B-106
	#8 Sol	B-5688	4	90	B-106

Required Tools:

Handle Clamps (see chart for correct handles)
B38-0309-00 Flint Ignitor
Other recommended accessories:

B38-3922-00 Mold Cleaning Brush (pg E-92) B38-0135-00 Cable Cleaning Brush (pg E-92) B38-0330-00 Cable Clamp (pg E-92)

For mold types or BURNDYWeld® items not shown, please contact factory.

considered. For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact  ${\rm BURNDY}^{\otimes}.$ 


#### **TYPE BCR-1 MOLDS**

#### **Horizontal Cable Terminal to Ground Rod**

Type BCR-1 Molds are used to terminate horizontal copper cable at the top of a vertical ground rod.

Size range is #6 through 1000 kcmil solid or concentric stranded copper conductors; 1/2" through 1" for the ground rod.

Contact BURNDY® for information on molds for conductors not listed below.

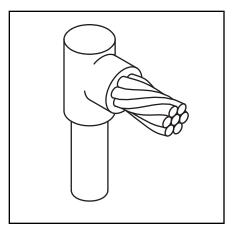



Cab	le		Price	Weld	Handle
Grd Rod	Тар	<b>Mold Number</b>	Key	Metal	Clamps
	#6	B-8402	18†*	25	N/A
	#4	B-8403	18†*	25	N/A
	#2	B-495	4	65	B-106
	#1	B-496	4	65	B-106
1/2"	1/0	B-497	4	90	B-106
1/2	2/0	B-498	4	90	B-106
	3/0	B-499	4	90	B-106
	4/0	B-500	4	90	B-106
	250 kcmil	B-501	4	90	B-106
	300 kcmil	B-502	4	90	B-106
	#6	B-8414	18†	32	N/A
	#4	B-8415	18†	32	N/A
	#2	B-503	4	65	B-106
	#1	B-504	4	65	B-106
	1/0	B-505	4	90	B-106
5/8"	2/0	B-506	4	90	B-106
	3/0	B-507	4	90	B-106
	4/0	B-508	4	90	B-106
	250 kcmil	B-509	4	90	B-106
	300 kcmil	B-510	4	115	B-106
	350 kcmil	B-511	4	115	B-106
	500 kcmil	B-513	4	150	B-106

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
- Molds listed are for copperclad ground rods. For welding to steel, stainless steel or galvanized steel ground rods add suffix "-N" to mold number.

  For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.

Cab	le		Price	Weld	Handle
Grd Rod	Тар	<b>Mold Number</b>	Key	Metal	Clamps
	#6	B-8422	181*	32	N/A
	#4	B-8426	191*	45	N/A
	#2	B-5781	4	90	B-106
	#1	B-514	4	90	B-106
	1/0	B-515	4	90	B-106
	2/0	B-516	4	90	B-106
3/4"	3/0	B-517	4	90	B-106
	4/0	B-518	4	90	B-106
	250 kcmil	B-519	4	90	B-106
	300 kcmil	B-520	4	115	B-106
	350 kcmil	B-521	4	115	B-106
	500 kcmil	B-523	4	150	B-106
	750 kcmil	B-524	4	250	B-106
	1/0	B-525	4	150	B-106
	2/0	B-526	4	150	B-106
	3/0	B-527	4	150	B-106
	4/0	B-528	4	150	B-106
1″	250 kcmil	B-529	4	150	B-106
ı	300 kcmil	B-530	4	200	B-106
	350 kcmil	B-531	4	200	B-106
	500 kcmil	B-533	4	200	B-106
	750 kcmil	B-534	4	250	B-106
	1000 kcmil	B-535	5	2-150	B-106

Required Tools: Handle Clamps (see chart for correct handles)

Handle Clamps (see chart for correct handles)
† Sold complete with handles
\* B38-0309-00 Flint Ignitor (included)
Other recommended accessories:
B38-3922-00 Mold Cleaning Brush (pg E-92)
B38-0135-00 Cable Cleaning Brush (pg E-92)
B38-0304-00 File (pg E-93)
B38-0330-00 Cable Clamp (pg E-92)

For mold types or BURNDYWeld® items not shown, please contact factory.


#### **TYPE BCR-2 MOLDS**

#### **Horizontal Cable to Ground Rod**

Type BCR-2 Molds are used to join horizontal through copper cable to the top of a vertical ground rod.

Size range is #6 through 1000 kcmil solid or concentric stranded copper conductors; 1/2" through 1" for the ground rod.

Contact BURNDY® for information on molds for conductors not listed below.

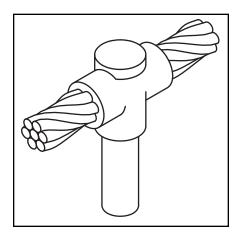



Cabl	е		Price	Weld	Handle
Grd Rod	Tap	<b>Mold Number</b>	Key	Metal	Clamps
	#6	B-8434	181†*	32	N/A
	#4	B-8435	18†*	32	N/A
	#2	B-537	4	90	B-106
	#1	B-538	4	90	B-106
1/2"	1/0	B-539	4	90	B-106
1/2	2/0	B-540	4	90	B-106
	3/0	B-541	4	115	B-106
	4/0	B-542	4	115	B-106
	250 kcmil	B-543	4	150	B-106
	300 kcmil	B-544	4	200	B-106
	#6	B-8441	18†*	32	N/A
	#4	B-8442	18†*	32	N/A
	#2	B-545	4	90	B-106
	#1	B-546	4	90	B-106
	1/0	B-547	4	90	B-106
5/8"	2/0	B-548	4	115	B-106
3/6	3/0	B-549	4	115	B-106
	4/0	B-550	4	115	B-106
	250 kcmil	B-551	4	150	B-106
	300 kcmil	B-532	4	200	B-106
	350 kcmil	B-553	4	200	B-106
	500 kcmil	B-555	4	250	B-106

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
- Molds listed are for copperclad ground rods. For welding to steel, stainless steel or galvanized steel ground rods add suffix "-N" to mold number.

  For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.

Cab	le		Price	Weld	Handle
Grd Rod	Тар	<b>Mold Number</b>	Key	Metal	Clamps
	#6	B-8452	19†*	45	N/A
	#4	B-8454	19†*	65	N/A
	#2	B-556	4	90	B-106
	#1	B-557	4	90	B-106
	1/0	B-558	4	115	B-106
0 / 4//	2/0	B-559	4	115	B-106
3/4"	3/0	B-560	4	115	B-106
	4/0	B-561	4	115	B-106
	250 kcmil	B-562	4	150	B-106
	300 kcmil	B-563	4	200	B-106
	350 kcmil	B-564	4	200	B-106
	500 kcmil	B-566	4	250	B-106
	750 kcmil	B-567	5	2-200	B-107
	1/0	B-569	4	150	B-106
	2/0	B-570	4	150	B-106
	3/0	B-571	4	150	B-106
	4/0	B-572	4	150	B-106
4"	250 kcmil	B-573	4	200	B-106
1″	300 kcmil	B-574	4	200	B-106
	350 kcmil	B-575	4	200	B-106
	500 kcmil	B-577	4	250	B-106
	750 kcmil	B-578	5	2-200	B-107
	1000 kcmil	B-579	5	500	B-107

Required Tools: Handle Clamps (see chart for correct handles)

Handle Clamps (see chart for correct handles)
† Sold complete with handles
\*B38-0309-00 Flint Ignitor (included)
Other recommended accessories:
B38-3922-00 Mold Cleaning Brush (pg E-92)
B38-0135-00 Cable Cleaning Brush (pg E-92)
B38-0304-00 File (pg E-93)
B38-0330-00 Cable Clamp (pg E-92)

For mold types or BURNDYWeld® items not shown, please contact factory.


#### **TYPE BCR-3 MOLDS**

#### **Horizontal Through Cable to Ground Rod**

Type BCR-3 Molds are used to join horizontal through run cable to the side of a vertical ground rod.

Size range is #6 through 1000 kcmil solid or concentric stranded copper conductors; 1/2" through 1" for the ground rod.

Contact BURNDY® for information on molds for conductors not listed below.

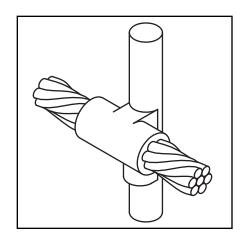



Cable			Price	Weld	Handle
Grd Rod	Tap	Mold Number	Key	Metal	Clamps
	#6	B-5321	24	65	B-106
	#4	B-2154	24	90	B-106
	#2	B-2155	24	90	B-106
1/2"	#1	B-2156	24	115	B-106
	1/0	B-1581	24	115	B-106
	2/0	B-1582	24	115	B-106
	4/0	B-1583	24	150	B-106
	250 kcmil	B-1584	24	150	B-106
	#6	B-5660	24	65	B-106
	#4	B-2157	24	90	B-106
	#2	B-2158	24	90	B-106
	#1	B-2159	24	115	B-106
5/8"	1/0	B-1586	24	115	B-106
	2/0	B-1587	24	115	B-106
	4/0	B-1588	24	150	B-106
	250 kcmil	B-1589	24	150	B-106
	500 kcmil	B-1593	13	2-200	B-107

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid
- Molds listed are for copperclad ground rods. For welding to steel, stainless steel or galvanized steel ground rods add suffix "-N" to mold number. For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.

Cable			Price	Weld	Handle
Grd Rod	Тар	Mold Number	Key	Metal	Clamps
	#6	B-6630	24	65	B-106
	#4	B-2160	24	90	B-106
	#2	B-2161	24	90	B-106
	#1	B-2162	24	115	B-106
	1/0	B-1594	24	115	B-106
3/4"	2/0	B-1595	24	115	B-106
	4/0	B-1596	24	150	B-106
	250 kcmil	B-1597	24	200	B-106
	500 kcmil	B-1601	13	500	B-107
	750 kcmil	B-1602	13	3-250	B-107
	#6	B-6906	24	90	B-106
	#4	B-2163	24	90	B-106
	#2	B-2164	24	90	B-106
1"	#1	B-2165	24	115	B-106
	1/0	B-1603	24	15	B-106
	2/0	B-1604	24	115	B-106
	4/0	B-1605	24	150	B-106
	250 kcmil	B-1606	24	200	B-106
	500 kcmil	B-1610	13	500	B-107
	750 kcmil	B-1611	13	3-250	B-107

Required Tools:

Hedurred Tools:
Handle Clamps (see chart for correct handles)
B38-0309-00 Flint Ignitor
Other recommended accessories:
B38-3922-00 Mold Cleaning Brush (pg E-92)
B38-0135-00 Cable Cleaning Brush (pg E-92)
B38-0304-00 File (pg E-93)

For mold types or BURNDYWeld® items not shown, please contact factory.


#### **TYPE BCR-17 MOLDS**

#### **Horizontal Run and Tap Cables to Ground Rod**

Type BCR-17 Molds are used to join horizontal run and tap cables to the top of a vertical ground rod.

Size range is #4 through 750 kcmil solid or concentric stranded copper conductors; 1/2" through 1" for the ground rod.

Contact BURNDY® for information on molds for conductors not listed below.

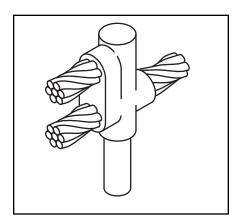

Cable			Price	Weld	Handle
Grd Rod	Tap	Mold Number	Key	Metal	Clamps
	#4	B-5416	4	90	B-106
	#2	B-6165	4	90	B-106
	#1	B-5830	4	90	B-106
1/2″	1/0	B-5940	4	115	B-106
	2/0	B-5850	4	150	B-106
	3/0	B-5833	4	200	B-106
	4/0	B-5380	4	200	B-106
	#4	B-5972	4	90	B-106
5/8"	#2	B-5935	4	115	B-106
	#1	B-5699	4	115	B-106
	1/0	B-5746	4	150	B-106
	2/0	B-5963	4	200	B-106
	3/0	B-5734	4	250	B-106
	4/0	B-5732	4	250	B-106
	250 kcmil	B-5722	5	2-150	B-107

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid
- Molds listed are for copperciad ground rods. For welding to steel, stainless steel or galvanized steel ground rods add suffix "-N" to mold number. For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.

Cable			Price	Weld	Handle
Grd Rod	Тар	<b>Mold Number</b>	Key	Metal	Clamps
	#4	B-5698	4	90	B-106
	#2	B-5294	4	115	B-106
	#1	B-5390	4	115	B-106
	1/0	B-6025	4	150	B-106
0/4"	2/0	B-5738	4	200	B-106
3/4"	3/0	B-6003	4	250	B-106
	4/0	B-2566	4	250	B-106
	250 kcmil	B-5904	5	2-150	B-107
	300 kcmil	B-5857	5	2-200	B-107
	350 kcmil	B-5777	5	2-200	B-107
	500 kcmil	B-5961	5	3-200	B-106
	#4	B-5556	4	115	B-106
	#2	B-5555	4	150	B-106
	#1	B-6048	4	150	B-106
	1/0	B-5992	4	200	B-106
	2/0	B-5877	4	250	B-106
1″	3/0	B-5821	5	2-150	B-107
ľ	4/0	B-5820	5	2-150	B-107
	250 kcmil	B-5804	5	2-200	B-107
	300 kcmil	B-5803	5	500	B-107
	350 kcmil	B-5561	5	500	B-107
	500 kcmil	B-5515	6	3-250	B-107
	750 kcmil	B-5513	6	2-500	B-107

Required Tools: Handle Clamps (see chart for correct handles)

B38-0309-00 Flint Ignitor

Other recommended accessories:

B38-3922-00 Mold Cleaning Brush (pg E-92)

B38-0135-00 Cable Cleaning Brush (pg E-92)

B38-0300-00 Cable Clamp (pg E-92)

B38-0304-00 File (pg E-93)

For mold types or BURNDYWeld® items not shown, please contact factory.


#### **TYPE BCR-24 MOLDS**

#### **Horizontal Parallel Run Cables to Ground Rod**

Type BCR-24 Molds are used to join horizontal parallel cables to the top of a vertical ground rod.

Size range is #4 through 750 kcmil solid or concentric stranded copper conductors; 1/2" through 1" for the ground rod.

Contact BURNDY® for information on molds for conductors not listed below.

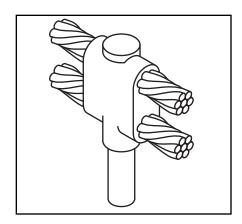

Cable			Price	Weld	Handle
Grd Rod	Tap	<b>Mold Number</b>	Key	Metal	Clamps
	#4	B-5640	4	115	B-106
	#2	B-5667	4	115	B-106
	#1	B-6002	4	115	B-106
1/2"	1/0	B-5767	4	150	B-106
	2/0	B-5604	4	200	B-106
	3/0	B-5560	4	250	B-106
	4/0	B-6766	4	250	B-106
	#4	B-6208	4	115	B-106
	#2	B-5702	4	150	B-106
	#1	B-5517	4	150	B-106
	1/0	B-5573	4	200	B-106
	2/0	B-8451	4	250	B-106
5/8"	3/0	B-2510	5	2-150	B-107
	4/0	B-5428	5	2-150	B-107
	250 kcmil	B-1212	5	2-200	B-107
	300 kcmil	B-2084	5	500	B-107
	350 kcmil	B-2558	5	500	B-107
	500 kcmil	B-2450	5	3-250	B-107

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
- Molds listed are for copperclad ground rods. For welding to steel, stainless steel or galvanized steel ground rods add suffix "-N" to mold number.

  For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.

Cable			Price	Weld	Handle
Grd Rod	Тар	<b>Mold Number</b>	Key	Metal	Clamps
	#4	B-8011	4	115	B-106
	#2	B-2320	4	150	B-106
	#1	B-2235	4	150	B-106
	1/0	B-6051	4	200	B-106
	2/0	B-8802	4	250	B-106
3/4"	3/0	B-8726	5	2-150	B-107
3/4	4/0	B-5677	5	2-150	B-107
	250 kcmil	B-8461	5	2-200	B-107
	300 kcmil	B-8428	5	500	B-107
	350 kcmil	B-6294	5	500	B-107
	500 kcmil	B-8214	5	3-250	B-107
	750 kcmil	B-8027	6	2-500	B-107
	#4	B-5330	4	150	B-106
	#2	B-5332	4	200	B-106
	#1	B-5333	4	200	B-106
	1/0	B-5334	4	250	B-106
	2/0	B-5335	5	2-150	B-107
1"	3/0	B-5336	5	2-200	B-107
ı	4/0	B-5337	5	2-200	B-107
	250 kcmil	B-5338	5	500	B-107
	300 kcmil	B-5341	5	3-200	B-107
	350 kcmil	B-5351	5	3-200	B-107
	500 kcmil	B-5352	6	2-500	B-107
	750 kcmil	B-5353	64	5-250	B-107

Required Tools: Handle Clamps (see chart for correct handles) **B38-0309-00** Flint Ignitor B38-0309-00 Flint Ignitor


‡ Crucible B-181 required
Other recommended accessories:
B38-3922-00 Mold Cleaning Brush (pg E-92)
B38-0135-00 Cable Cleaning Brush (pg E-92)
B38-0304-00 File (pg E-93)


#### **SINGLE SHOT MOLDS**


#### **RUS Accepted**


BURNDYWeld® Single Shot Molds are an economical way to make cable connections onto the top of a ground rod. The Single Shot is a disposable single use ceramic mold that comes complete with everything required except the Flint Ignitor.


Ground	Cabl	e Size		Mold	Cadweld®	
<b>Rod Size</b>	Solid	Stranded	Туре	Number	Part #	
	#6, #8	#8	BCR-1 ●	BS-2009	GR1-141G	
	#3, #4	#4, #6	BCR-1 ●	BS-2010	GR1-141L	
	#1, #2	#2, #3	BCR-1 ●	BS-2011	GR1-141V	
1/2"	#6, #8	#8	BCR-2 ●	BS-2024	GT1-141G	
	#3, #4	#4, #6	BCR-2 ●	BS-2025	GT1-141L	
	#1, #2	#2, #3	BCR-2 ●	BS-2026	GT1-141V	
	#6, #8	#8	BCR-1 ●	BS-2012	GT1-161G	
	#3, #4	#4, #6	BCR-1 ●	BS-2013	GT1-141L	
	#1, #2	#2, #3	BCR-1 ●	BS-2014	GR1-161V	
	2/0, 1/0	1/0, #1	BCR-1 ●	BS-2015	GR1-162C	
		2/0	BCR-1 ●	BS-2016	GR1-162G	
	#6, #8	#8	BCR-2 ●	BS-2027	FRT1-161G	
	#3, #4	#4. #6	BCR-2 ●	BS-2028	GT1-161L	
5/8"	#1, #2	#2. #3	BCR-2 ●	BS-2029	GT1-161V	
	2/0, 1/0	1/0, #1	BCR-2 ●	BS-2030	GT1-162C	
	#6, #8	#8	BCR-24	BS-2105	NX1-161G	
	#3. #4	#4. #6	BCR-14	BS-2106	NX1-161L	
	#1. #2	#2. #3	BCR-24	BS-2107	NX1-161V	
	#6, #8	#8	BCR-25	BS-2006	NT1-161G	
	#3, #4	#4, #6	BCR-25	BS-2007	NT1-161L	
	#1, #2	#2, #3	BCR-25	BS-2008	NT1-161V	
	#6. #8	#8	BCR-1	BS-2017	GR1-181G	
	#3, #4	#4, #6	BCR-1 ●	BS-2018	GR1-181L	
	#1, #2	#2, #3	BCR-1 ●	BS-2019	GR1-181V	
	2/0, 1/0	1/0, #1	BCR-1 ●	BS-2020	GR1-182C	
		2/0	BCR-1 ●	BS-2021	GR1-182G	
	#6, #8	#8	BCR-2 ●	BS-2031	GT1-181G	
	#3, #4	#4, #6	BCR-2 ●	BS-2032	GT1-181L	
3/4"	#1, #2	#2, #3	BCR-2 ●	BS-2033	GT1-181V	
	2/0, 1/0	1/0, #1	BCR-2 ●	BS-2034	T1-182C	
	#6, #8	#8	BCR-24	BS-2108	NX1-181G	
	#3. #4	#4. #6	BCR-24	BS-2109	NX1-181L	
	#1, #2	#2, #3	BCR-24	BS-2110	NX1-181V	
	#6, #8	#8	BCR-25 ●	BS-2068	NT1-181G	
	#3, #4	#4, #6	BCR-25 ●	BS-2069	NT1-181L	
	#1, #2	#2, #3	BCR-25 ●	BS-2070	NT1-181V	



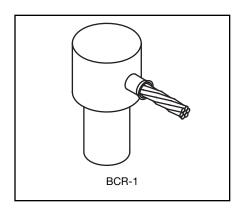

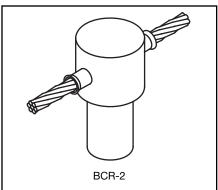

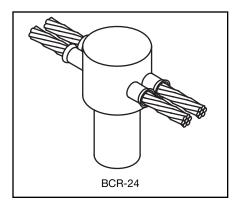

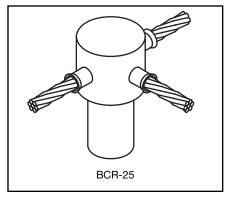

For mold types or BURNDYWeld® items not shown, please contact factory.


#### **TYPE BCS-1 MOLDS**


#### **Horizontal Cable to Horizontal Steel Surface**

Type BCS-1 Molds are used to terminate a horizontal copper cable to any horizontal steel surface. Note that the cable is OFF the surface.

Size range is 1/0 through 1000 kcmil solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

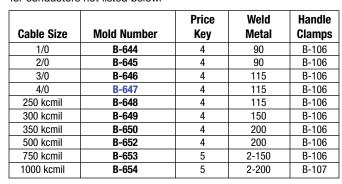

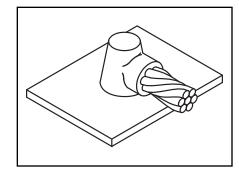



- For sizes not listed, contact  ${\tt BURNDY^0}.$  Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.

Required Tools: Handle Clamps (see chart for correct handles)

B38-0309-00 Flint Ignitor

Other recommended accessories: **B38-3922-00** Mold Cleaning Brush (pg E-92) **B38-0135-00** Cable Cleaning Brush (pg E-92) **B38-030-00** Cable Clamp (pg E-92) **B38-0101-00** Rasp (pg E-93)

#### **TYPE BCS-8 MOLDS**


#### **Horizontal Cable to Horizontal Steel Surface**

Type BCS-8 Molds are used to terminate a horizontal copper cable to any horizontal steel surface. Note that the cable is  $\mathbf{ON}$  the surface.

Size range is #6 through 1000 kcmil solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

		Price	Weld	Handle
Cable Size	Mold Number	Key	Metal	Clamps
#6	B-628	3†**	45	N/A
#4	B-629	3†*	45	N/A
#2	B-630	3†*	45	N/A
#1	B-631	3†*	65	N/A
1/0	B-7146	4	90	B-106
2/0	B-7075	4	90	B-106
3/0	B-2199	4	115	B-106
4/0	B-6114	4	115	B-106
250 kcmil	B-2200	4	115	B-106
300 kcmil	B-2506	4	150	B-106
350 kcmil	B-2507	4	200	B-106
500 kcmil	B-2509	4	200	B-106
750 kcmil	B-2542	5	2-150	B-107
1000 kcmil	B-2511	5	2-200	B-107

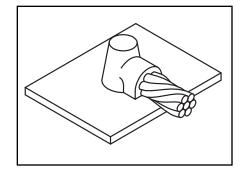



- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
- Conductors.

  For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.
   Required Tools:

Handle Clamps (see chart for correct handles)

Sold complete with frame B38-0309-00 Flint Ignitor (included)

Other recommended accessories:

B38-3922-00 Mold Cleaning Brush (pg E-92)
B38-0135-00 Cable Cleaning Brush (pg E-92)

**B38-0330-00** Cable Clamp (pg E-92) **B38-0101-00** Rasp (pg E-93)

For mold types or BURNDYWeld® items not shown, please contact factory.


#### **TYPE BCS-2 MOLDS**


#### **Horizontal Through Cable to Horizontal Steel Surface**

Type BCS-2 Molds are used to join horizontal through copper cable to any horizontal steel surface. Note the cable is OFF the surface.

Size range is 1/0 through 1000 kcmil solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

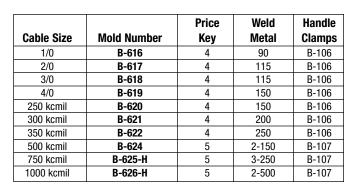

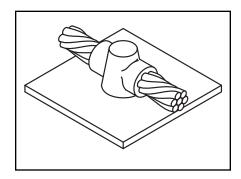

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact  ${\tt BURNDY}^{\otimes}.$
- For expedited service, contact BURNDY®.

Required Tools:

Handle Clamps (see above for correct handles)

B38-0309-00 Flint Ignitor

Other recommended accessories

**B38-3922-00** Mold Cleaning Brush (pg E-92) **B38-0135-00** Cable Cleaning Brush (pg E-92)

**B38-0101-00** Rasp (pg E-93)


#### **TYPE BCS-9 MOLDS**

#### **Horizontal Through Cable to Horizontal Steel Surface**

Type BCS-9 Molds are used to join horizontal through copper cable to any horizontal steel surface. Note the cable is ON the surface.

Size range is #6 through 500 kcmil solid or concentric stranded copper conductors.

Contact BURNDY® Products for information on molds for conductors not listed below.

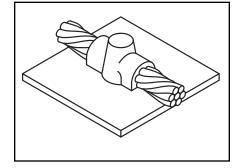

Cable Size	Mold Number	Price Key	Weld Metal	Handle Clamps
#6	B-602	3†*	45	N/A
#4	B-603	3†*	45	N/A
#2	B-604	3†*	45	N/A
#1	B-605	3†*	65	N/A
1/0	B-8379	4	90	B-106
2/0	B-5331	4	115	B-106
3/0	B-8381	4	115	B-106
4/0	B-7192	4	150	B-106
250 kcmil	B-8413	4	150	B-106
300 kcmil	B-8423	4	200	B-106
350 kcmil	B-8410	4	250	B-106
500 kcmil	B-5065	5	2-150	B-107

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.

Required Tools: Handle Clamps (see chart for correct handles)

† Sold complete with handle frame \* **B38-0309-00** Flint Ignitor (included)

Other recommended accessories:

**B40-0319-01** Mold Cleaner for cartridge sizes #15-#65 (pg E-92)

B40-0319-03 Mold Cleaner for cartridge sizes #90-#500 (pg E-92) B38-3922-00 Mold Cleaning Brush (pg E-92) B38-0135-00 Cable Cleaning Brush (pg E-92)

B38-0101-00 Rasp (pg E-93)


#### **TYPE BCS-3 MOLDS**


#### **Angular Cable Drop to Vertical Steel Surface**

Type BCS-3 Molds are used to join the end of a copper cable at a 45° angle to a vertical steel surface.

Size range is #6 through 1000 kcmil solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

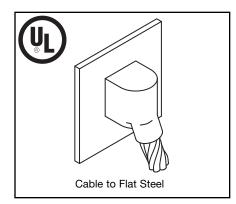

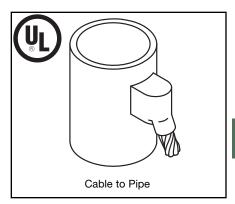

#### Cable to Flat Steel

Cable Size	Mold Number	Price Key	Weld Metal	Handle Clamps
#6	B-585	4	45	B-106
#4	B-586	4	45	B-106
#3	B-587	4	45	B-106
#2	B-588	4	45	B-106
#1	B-589	4	65	B-106
1/0	B-590	4	90	B-106
2/0	B-591	4	90	B-106
3/0	B-592	4	115	B-106
4/0	B-593	4	115	B-106
250 kcmil	B-594	4	115	B-106
300 kcmil	B-595	4	150	B-106
350 kcmil	B-596	4	200	B-106
500 kcmil	B-598	4	200	B-106
750 kcmil	B-599	5	2-150	B-107
1000 kcmil	B-600	5	2-200	B-107

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.

Required Tools:
Handle Clamps (see chart for correct handles)
B38-0309-00 Flint Ignitor

Other recommended accessories:
Magnetic Clamps to hold molds against vertical steel (pg E-89)
B38-3922-00 Mold Cleaning Brush (pg E-92)

**B38-0135-00** Cable Cleaning Brush (pg E-92) **B38-0101-00** Rasp (pg E-93)

#### **Cable to Pipe**

Cable	Pipe	Mold	Price	Weld	Handle
Size	Size	Number	Key	Metal	Clamps
	1-1/4" to 4"	B-2476	4	45	B-106
#4	4" to 6"	B-2477	4	45	B-106
	6" to 10"	B-2478	4	45	B-106
	12" & up	B-586 ‡	4	45	B-106
	1-1/4" to 4"	B-9233-S	4	45	B-106
#2 Sol	4" to 6"	B-2480-S	4	45	B-106
#2 501	6" to 10"	B-2583-S	4	45	B-106
	12" & up	B-588-S ‡	4	45	B-106
	1-1/4" to 4"	B-9233	4	45	B-106
#2	4" to 6"	B-2480	4	45	B-106
#2	6" to 10"	B-2583	4	45	B-106
	12" & up	B-588 ‡	4	45	B-106
	1-1/4" to 4"	B-2482	4	65	B-106
#1	4" to 6"	B-2483	4	65	B-106
#1	6" to 10"	B-2484	4	65	B-106
	12" & up	B-589 ‡	4	65	B-106
	1-1/4" to 4"	B-2486	4	90	B-106
1/0	4" to 6"	B-2487	4	90	B-106
1/0	6" to 10"	B-2488	4	90	B-106
	12" & up	B-590 ‡	4	90	B-106
	1-1/4" to 4"	B-8833	4	90	B-106
2/0	4" to 6"	B-2490	4	90	B-106
2/0	6" to 10"	B-2491	4	90	B-106
	12" & up"	B-591 ‡	4	90	B-106
	1-1/4" to 4"	B-2493	4	115	B-106
0./0	4" to 6"	B-2494	4	115	B-106
3/0	6" to 10"	B-2495	4	115	B-106
	12" & up	B-592 ‡	4	115	B-106
4/0	1-1/4" to 4"	B-9021	4	115	B-106
	4" to 6"	B-2497	4	115	B-106
4/0	6" to 10"	B-2498	4	115	B-106
	12" & up	B-593 ‡	4	115	B-106

- For sizes not listed, contact BURNDY®.
   Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.

Required Tools: Handle Clamps (see chart for correct handles) **B38-0309-00** Flint Ignitor

Other recommended accessories:

B106-32 Vertical Chain Clamp w/ B-106 Handles for 4" Pipe & smaller

B40-0106-27 20" Chain Extension for 4" to 10" Pipe
Use (2) 20" Chain Extensions for pipe sizes between 10" and 16"
B38-3922-00 Mold Cleaning Brush (pg E-92)

**B38-0135-00** Cable Cleaning Brush (pg E-92) **B38-0101-00** Rasp (pg E-93)

‡ Flat Surface Mold

For mold types or BURNDYWeld® items not shown, please contact factory.


#### **TYPE BCS-23 MOLDS**

#### **Vertical Cable Drop to Vertical Steel Surface**

Type BCS-23 Molds are used to join vertical cable down to a vertical steel surface. Note that the cable is OFF the surface.

Size range is #6 through 500 kcmil solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

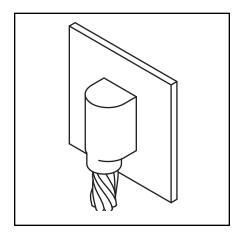

		Price	Weld	Handle
Cable Size	Mold Number	Key	Metal	Clamps
#6	B-5389	4	45	B-106
#4	B-5359	4	65	B-106
#2	B-2781	4	65	B-106
#1	B-5361	4	90	B-106
1/0	B-2189	4	115	B-106
2/0	B-2540	4	115	B-106
3/0	B-5362	4	150	B-106
4/0	B-8718	4	150	B-106
250 kcmil	B-8165	4	200	B-106
300 kcmil	B-5363	4	200	B-106
350 kcmil	B-9029	4	250	B-106
500 kcmil	B-8512	17	2-150	B-106

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.

BURNDY®.

For expedited service, contact BURNDY®.

Required Tools:
Handle Clamps (see chart for correct handles)
B38-0309-00 Filmt Ignitor

Other recommended accessories:

Magnetic Clamps to hold molds against vertical steel B38-3922-00 Mold Cleaning Brush (pg E-92) B38-0135-00 Cable Cleaning Brush (pg E-92) B38-0101-00 Rasp (pg E-93)


#### TYPE BCS-4 MOLDS


#### **Vertical Through Cable to Vertical Steel Surface**

Type BCS-4 Molds are used to join a vertical through copper cable to a vertical steel surface. Note that the cable is OFF the surface. For molds with the cable on the surface, contact BURNDY® Products.

Size range is #6 through 500 kcmil solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

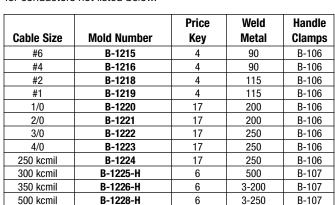

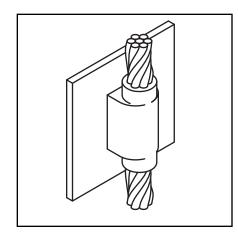

- For sizes not listed contact BURNDY®
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.

Required Tools:

Handle Clamps (see chart for correct handles) **B38-0309-00** Flint Ignitor

Other recommended accessories:

Magnetic Clamps to hold molds against vertical steel B38-3922-00 Mold Cleaning Brush (pg E-92) B38-0135-00 Cable Cleaning Brush (pg E-92)

B38-0101-00 Rasp (pg E-93)


#### **TYPE BCS-6 MOLDS**


#### **Horizontal Through Cable to Vertical Steel Surface**

Type BCS-6 Molds are used to join horizontal through copper cable to a vertical steel surface. Note that the cable is **OFF** the surface.

Size range is #6 through 250 kcmil solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

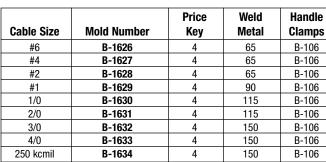

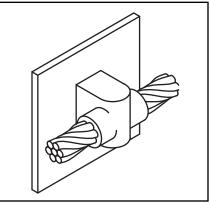

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.
   Required Tools:

Handle Clamps (see chart for correct handles)

**B38-0309-00** Flint Ignitor Other recommended accessories:

B40-0319-01 Mold Cleaner for cartridge sizes #15-#65 (pg E-92)

**B40-0319-03** Mold Cleaner for cartridge sizes #90-#500 (pg E-92) **B38-3922-00** Mold Cleaning Brush (pg E-92)

**B38-0135-00** Cable Cleaning Brush (pg E-92) B38-0101-00 Rasp (pg E-93)

For mold types or BURNDYWeld® items not shown, please contact factory.

#### **TYPE BCS-7 MOLDS**


#### **Overhead Vertical Tap Cable** to Vertical Steel Surface

Type BCS-7 Molds are used to join an overhead vertical copper conductor drop tap to a vertical steel surface.

Size range is #6 through 1000 kcmil solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

		Price	Weld	Handle
Cable Size	Mold Number	Key	Metal	Clamps
#6	B-1635	4	65	B-106
#4	B-1636	4	65	B-106
#3	B-1637	4	65	B-106
#2	B-1638	4	65	B-106
#1	B-1639	4	90	B-106
1/0	B-1640	4	150	B-106
2/0	B-1641	4	150	B-106
3/0	B-1642	17	200	B-106
4/0	B-1643	17	200	B-106
250 kcmil	B-1644	17	200	B-106
300 kcmil	B-1645	17	250	B-106
350 kcmil	B-1646	6	2-150	B-107
500 kcmil	B-1648	6	2-200	B-107
750 kcmil	B-1649	6	500	B-107
1000 kcmil	B-1650	6	3-200	B-107

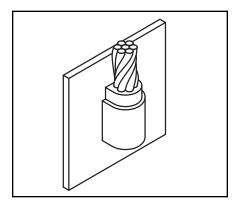

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®. Required Tools:

Handle Clamps (see chart for correct handles) **B38-0309-00** Flint Ignitor

Other recommended accessories:

Magnetic Clamps to hold molds against vertical steel B38-3922-00 Mold Cleaning Brush (pg E-92)

**B38-0135-00** Cable Cleaning Brush (pg E-92)

**B38-0101-00** Rasp (pg E-93)

#### **TYPE BCS-18 MOLDS**


#### **Horizontal Tap Cable to Vertical Steel Surface**

Type BCS-18 Molds are used to connect a horizontal conductor to a vertical steel surface. Note that the cable is ON the surface.

Size range is #6 through 500 kcmil solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.



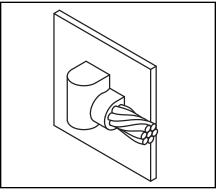

NOTE: Add (-R) to mold number for right hand mold or (-L) for left hand mold. Right hand (-R) mold will be furnished if not specified.

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact  ${\rm BURNDY}^{\oplus}.$
- For expedited service, contact BURNDY®.

Required Tools:

Handle Clamps (see chart for correct handles) **B38-0309-00** Flint Ignitor

Other recommended accessories:

Vertical Chain Clamps
B38-3922-00 Mold Cleaning Brush (pg E-92)

B38-0135-00 Cable Cleaning Brush (pg E-92)

B38-0101-00 Rasp (pg E-93)

For mold types or BURNDYWeld® items not shown, please contact factory.


#### **TYPE BCS-5 MOLDS**

#### **Horizontal Cable Tap to Horizontal Cast Iron Surface**

Type BCS-5 Molds are used to join horizontal cable taps to horizontal cast iron surfaces. Note that the cable is **ON** the surface.

Size range is #6 through #1 solid or concentric stranded copper conductors.

Contact BURNDY® for information on molds for conductors not listed below.

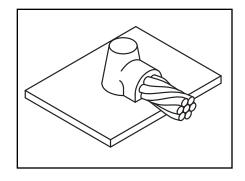

Cable Size	Mold Number	Price Key	Weld Metal	Handle Clamps
#6 Sol	B-1613	3+	2SCI	N/A
#6	B-1614	3+	25CI	N/A
#4 Sol	B-1615	3+	45CI	N/A
#4	B-1616	3+	45CI	N/A
#2 Sol	B-1617	3+	45CI	N/A
#2	B-1618	3+	45CI	N/A
#1 Sol	B-1619	3+	65CI	N/A
#1	B-1620	3+	65CI	N/A

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®. Required Tools:

† Sold complete with frame **B38-0309-00** Flint Ignitor (included)

Other recommended accessories:


**B38-3922-00** Mold Cleaning Brush (pg E-92) **B38-0135-00** Cable Cleaning Brush (pg E-92) **B38-0101-00** Rasp (pg E-93)

DO NOT use Type BCS-5 molds on Soil Pipe (ASTM A74-82). A test weld should be made on a section of the pipe being used to determine the possibility of detrimental metallurgical effects.

#### **TYPE BCRE-1 MOLDS**

#### **Horizontal Parallel Tap** to Rebar

Type BCRE-1 Molds are recommended for parallel, horizontal connections for solid or concentric stranded conductors #6 through 4/0 joined to reinforcing bars #3 through #6 and larger. The high copper content joint has a higher current carrying capacity than the conductors being joined and is impervious to vibration and moisture.

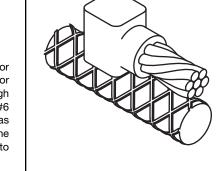

Contact BURNDY® for information on molds for conductors not listed below.

Rebar Size	Cable Size	Mold Number	Packing Material ‡	Price Key	Weld Metal	Handle Clamps
0.20	#6	B-7500	B38032900	4	25	B-106
	#4	B-7501	B38032900	4	32	B-106
	#2	B-7502	B38032900	4	45	B-106
	#1	B-7503	B38032900	4	65	B-106
#3	1/0	B-7504	B38032900	4	90	B-106
	2/0	B-7505	B38032900	4	90	B-106
	3/0	B-7506	B38032900	4	115	B-106
	4/0	B-7507	B38032900	4	115	B-106
	#6	B-7508	B38406100	3+	25	N/A
#4	#4	B-7509	B38406100	3+	32	N/A
. &	#2	B-7510	B38406100	3+	45	N/A
Larger	#1	B-7511	B38406100	3+	65	N/A
	1/0	B-7512	B38032900	4	90	B-106
	2/0	B-7513	B38032900	4	90	B-106
#4	3/0	B-7514	B38032900	4	115	B-106
	4/0	B-7515	B38032900	4	115	B-106
	1/0	B-7520	B38032900	4	90	B-106
	2/0	B-7521	B38032900	4	90	B-106
#5	3/0	B-7522	B38032900	4	115	B-106
	4/0	B-7523	B38032900	4	115	B-106
40	1/0	B-7528	B38406200	14+	90	N/A
#6 &	2/0	B-7529	B38406200	14+	90	N/A
	3/0	B-7530	B38406200	14+	115	N/A
Larger	4/0	B-7531	B38406200	14+	115	N/A

#### **‡ PACKING MATERIAL NOTE**

A packing pad is necessary when making BURNDYWeld® connections to rebar. Packing material B38032900 is copper shim stock. Packing material numbers B38406100, B38406200 and B38406300 are a ceramic fiber material and can be used for one connection only. Be sure to specify packing material catalog number when ordering mold and weld metal.

- · For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
   For expedited service, contact BURNDY®.
  Required Tools:

Handle Clamps (see chart for correct handles)
† Sold complete with frame

**B38-0309-00** Flint Ignitor

Other recommended accessories:

B38-3922-00 Mold Cleaning Brush (pg E-92)


B38-0135-00 Cable Cleaning Brush (pg E-92)

B38-0304-00 File (pg E-93)

#### **TYPE BCRE-2 MOLDS**

#### **Horizontal Cable Tap to Horizontal Rebar Run**

Type BCRE-2 Molds are recommended for right angle, horizontal connections for solid or concentric stranded conductors #6 through 4/0 joined to reinforcing bars #3 through #6. The high copper content joint has a higher current carrying capacity than the conductors being joined and is impervious to vibration and moisture.

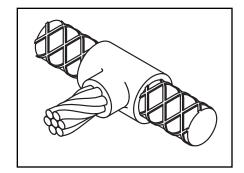

Contact BURNDY® for information on molds for conductors not listed below.

#4	Rebar	Cable	Mold	Packing	Price	Weld	Handle
#4 B-7589 B38032900 4 45 B-106  #2 B-7590 B38032900 4 65 B-106  #1 B-7591 B38032900 4 65 B-106  1/0 B-7592 B38032900 4 90 B-106  2/0 B-7593 B38032900 4 115 B-106  4/0 B-7595 B38032900 4 115 B-106  #4 B-7596 B38032900 4 45 B-106  #4 B-7597 B38032900 4 45 B-106  #4 B-7597 B38032900 4 45 B-106  #4 B-7598 B38032900 4 45 B-106  #4 B-7599 B38032900 4 65 B-106  #1 B-7599 B38032900 4 65 B-106  2/0 B-7601 B38032900 4 90 B-106  2/0 B-7601 B38032900 4 115 B-106  #4 B-7602 B38032900 4 150 B-106  #4 B-7603 B38032900 4 90 B-106  #4 B-7604 B38032900 4 90 B-106  #4 B-7605 B38032900 4 90 B-106  #4 B-7606 B38032900 4 90 B-106  #4 B-7607 B38032900 4 90 B-106  #4 B-7608 B38032900 4 90 B-106  #4 B-7609 B38032900 4 90 B-106  #4 B-7611 B38032900 4 90 B-106  #4 B-7613 B38032900 4 90 B-106  #4 B-7614 B38032900 4 90 B-106  #4 B-7615 B38032900 4 90 B-106  #4 B-7616 B38032900 4 90 B-106  #4 B-7617 B38032900 4 90 B-106  #4 B-7618 B38032900 4 115 B-106  #5 B-7616 B38032900 4 115 B-106  #6 B-7617 B38032900 4 115 B-106  #6 B-7618 B38032900 4 115 B-106	Size	Size	Number	Material ‡	Key	Metal	Clamps
#3 #2		#6	B-7588	B38032900	4	45	B-106
#3 #1 B-7591 B38032900 4 65 B-106 2/0 B-7592 B38032900 4 90 B-106 3/0 B-7594 B38032900 4 115 B-106 4/0 B-7595 B38032900 4 115 B-106 #6 B-7596 B38032900 4 45 B-106 #4 B-7597 B38032900 4 45 B-106 #2 B-7598 B38032900 4 45 B-106 #1 B-7599 B38032900 4 65 B-106 1/0 B-7600 B38032900 4 90 B-106 3/0 B-7602 B38032900 4 115 B-106 4/0 B-7603 B38032900 4 115 B-106 #4 B-7604 B38032900 4 90 B-106 #4 B-7605 B38032900 4 90 B-106 #4 B-7606 B38032900 4 90 B-106 #4 B-7606 B38032900 4 90 B-106 #4 B-7607 B38032900 4 90 B-106 #4 B-7608 B38032900 4 90 B-106 #5 B-106 #6 B-7604 B38032900 4 90 B-106 #6 B-7605 B38032900 4 90 B-106 #6 B-7606 B38032900 4 90 B-106 #6 B-7606 B38032900 4 90 B-106 #6 B-7607 B38032900 4 90 B-106 #6 B-7608 B38032900 4 90 B-106 #6 B-7610 B38032900 4 90 B-106 #6 B-7611 B38032900 4 90 B-106 #6 B-7612 B38032900 4 90 B-106 #6 B-7614 B38032900 4 90 B-106 #6 B-7615 B38032900 4 90 B-106 #1 B-7616 B38032900 4 90 B-106 #1 B-7617 B38032900 4 90 B-106 #1 B-7618 B38032900 4 115 B-106 #1 B-7616 B38032900 4 90 B-106 #1 B-7617 B38032900 4 90 B-106 #1 B-7616 B38032900 4 90 B-106 #1 B-7616 B38032900 4 115 B-106 #1 B-7617 B38032900 4 115 B-106 #1 B-7618 B38032900 4 115 B-106		#4	B-7589	B38032900	4	45	B-106
#4  #5  #6  #6  #7692  #6  #6  #7693  #7594  #7595  #7594  #7595  #7595  #7595  #7596  #7596  #7596  #7596  #7597  #7597  #7597  #7598  #7598  #7598  #7598  #7598  #7598  #7598  #7598  #7598  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #759  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599  #7599		#2	B-7590	B38032900	4	65	B-106
#4 B-7605 B38032900 4 90 B-106  #4 B-7606 B38032900 4 90 B-106  #5 B-7606 B38032900 4 115  #6 B-7606 B38032900 4 115  #6 B-7606 B38032900 4 115  #6 B-7601 B38032900 4 115  #6 B-7602 B38032900 4 115  #7 B-7603 B38032900 4 115  #7 B-7604 B38032900 4 115  #8 B-7606 B38032900 4 115  #8 B-7606 B38032900 4 115  #8 B-7606 B38032900 4 115  #8 B-7607 B38032900 4 90  #8 B-7608 B38032900 4 90  #8 B-7608 B38032900 4 90  #8 B-7609 B38032900 4 115  #8 B-7610 B38032900 4 115  #8 B-7611 B38032900 4 150  #8 B-7612 B38032900 4 150  #8 B-7611 B38032900 4 150  #8 B-7611 B38032900 4 150  #8 B-7612 B38032900 4 90  #8 B-106  #8 B-7611 B38032900 4 90  #8 B-106  #8 B	"0	#1	B-7591	B38032900	4	65	B-106
#4 #4 #4 #4 #4 #5 #595 #595 #596 #596 #596 #597 #597 #598 #596 #6 #597 #598 #598 #599 #598 #599 #598 #599 #598 #599 #598 #599 #599	#3	1/0	B-7592	B38032900	4	90	B-106
#4 B-7605 B38032900 4 115 B-106  #5 B-7606 B38032900 4 455 B-106  #4 B-7597 B38032900 4 455 B-106  #4 B-7598 B38032900 4 65 B-106  #1 B-7599 B38032900 4 65 B-106  1/0 B-7600 B38032900 4 90 B-106  2/0 B-7601 B38032900 4 90 B-106  3/0 B-7602 B38032900 4 115 B-106  4/0 B-7603 B38032900 4 115 B-106  #4 B-7605 B38032900 4 90 B-106  #4 B-7605 B38032900 4 90 B-106  #2 B-7606 B38032900 4 90 B-106  #2 B-7606 B38032900 4 90 B-106  #4 B-7607 B38032900 4 115 B-106  2/0 B-7608 B38032900 4 115 B-106  4/0 B-7611 B38032900 4 150 B-106  #4 B-7615 B38032900 4 90 B-106  #4 B-7611 B38032900 4 90 B-106  #4 B-7612 B38032900 4 90 B-106  #4 B-7613 B38032900 4 90 B-106  #4 B-7614 B38032900 4 90 B-106  #4 B-7615 B38032900 4 90 B-106  #4 B-7616 B38032900 4 90 B-106  #1 B-7616 B38032900 4 90 B-106  #1 B-7616 B38032900 4 90 B-106  #1 B-7617 B38032900 4 90 B-106  2/0 B-7617 B38032900 4 115 B-106  3/0 B-7618 B38032900 4 115 B-106		2/0	B-7593	B38032900	4	90	B-106
#4		3/0	B-7594	B38032900	4	115	B-106
#4		4/0	B-7595	B38032900	4	115	B-106
#4		#6	B-7596	B38032900	4	45	B-106
#4 #1 B-7599 B38032900 4 65 B-106 1/0 B-7600 B38032900 4 90 B-106 2/0 B-7601 B38032900 4 90 B-106 3/0 B-7602 B38032900 4 115 B-106 4/0 B-7603 B38032900 4 115 B-106 #6 B-7604 B38032900 4 90 B-106 #4 B-7605 B38032900 4 90 B-106 #2 B-7606 B38032900 4 90 B-106 #1 B-7607 B38032900 4 90 B-106 2/0 B-7608 B38032900 4 115 B-106 2/0 B-7609 B38032900 4 115 B-106 3/0 B-7610 B38032900 4 150 B-106 4/0 B-7611 B38032900 4 150 B-106 #4 B-7612 B38032900 4 90 B-106 #4 B-7613 B38032900 4 90 B-106 #4 B-7613 B38032900 4 90 B-106 #4 B-7613 B38032900 4 90 B-106 #4 B-7614 B38032900 4 90 B-106 #4 B-7615 B38032900 4 90 B-106 #1 B-7615 B38032900 4 90 B-106 #1 B-7616 B38032900 4 115 B-106 2/0 B-7617 B38032900 4 115 B-106 3/0 B-7618 B38032900 4 150 B-106		#4	B-7597	B38032900	4	45	B-106
#4    1/0		#2	B-7598	B38032900	4	65	B-106
#5  #5  #6  #6  #6  #6  #6  #6  #6  #6	ш.4	#1	B-7599	B38032900	4	65	B-106
#5 #5 #6 #6 #6 #6 #6 #6 #6 #6 #6 #6 #6 #6 #6	#4	1/0	B-7600	B38032900	4	90	B-106
#6 B-7603 B38032900 4 115 B-106  #6 B-7604 B38032900 4 90 B-106  #4 B-7605 B38032900 4 90 B-106  #2 B-7606 B38032900 4 90 B-106  #1 B-7607 B38032900 4 90 B-106  1/0 B-7608 B38032900 4 115 B-106  2/0 B-7609 B38032900 4 115 B-106  3/0 B-7610 B38032900 4 150 B-106  4/0 B-7611 B38032900 4 150 B-106  #6 B-7612 B38032900 4 90 B-106  #4 B-7613 B38032900 4 90 B-106  #4 B-7613 B38032900 4 90 B-106  #4 B-7614 B38032900 4 90 B-106  #1 B-7615 B38032900 4 90 B-106  #1 B-7615 B38032900 4 90 B-106  #1 B-7616 B38032900 4 115 B-106  2/0 B-7617 B38032900 4 115 B-106  3/0 B-7618 B38032900 4 150 B-106		2/0	B-7601	B38032900	4	90	B-106
#6 B-7604 B38032900 4 90 B-106  #4 B-7605 B38032900 4 90 B-106  #2 B-7606 B38032900 4 90 B-106  #1 B-7607 B38032900 4 90 B-106  1/0 B-7608 B38032900 4 115 B-106  2/0 B-7609 B38032900 4 115 B-106  3/0 B-7610 B38032900 4 150 B-106  4/0 B-7611 B38032900 4 150 B-106  #6 B-7612 B38032900 4 90 B-106  #4 B-7613 B38032900 4 90 B-106  #4 B-7613 B38032900 4 90 B-106  #4 B-7614 B38032900 4 90 B-106  #1 B-7615 B38032900 4 90 B-106  #1 B-7615 B38032900 4 15 B-106  2/0 B-7617 B38032900 4 115 B-106  3/0 B-7618 B38032900 4 150 B-106		3/0	B-7602	B38032900	4	115	B-106
#4 B-7605 B38032900 4 90 B-106 #2 B-7606 B38032900 4 90 B-106 #1 B-7607 B38032900 4 90 B-106 1/0 B-7608 B38032900 4 115 B-106 2/0 B-7609 B38032900 4 115 B-106 3/0 B-7610 B38032900 4 150 B-106 4/0 B-7611 B38032900 4 150 B-106 #6 B-7612 B38032900 4 90 B-106 #4 B-7613 B38032900 4 90 B-106 #4 B-7613 B38032900 4 90 B-106 #4 B-7614 B38032900 4 90 B-106 #1 B-7615 B38032900 4 90 B-106 2/0 B-7616 B38032900 4 115 B-106 2/0 B-7617 B38032900 4 115 B-106 3/0 B-7618 B38032900 4 150 B-106		4/0	B-7603	B38032900	4	115	B-106
#5 #2 B-7606 B38032900 4 90 B-106  #1 B-7607 B38032900 4 90 B-106  1/0 B-7608 B38032900 4 115 B-106  2/0 B-7609 B38032900 4 115 B-106  3/0 B-7610 B38032900 4 150 B-106  4/0 B-7611 B38032900 4 150 B-106  #6 B-7612 B38032900 4 90 B-106  #4 B-7613 B38032900 4 90 B-106  #4 B-7613 B38032900 4 90 B-106  #1 B-7615 B38032900 4 90 B-106  #1 B-7615 B38032900 4 90 B-106  2/0 B-7616 B38032900 4 115 B-106  2/0 B-7617 B38032900 4 115 B-106  3/0 B-7618 B38032900 4 150 B-106		#6	B-7604	B38032900	4	90	B-106
#1 B-7607 B38032900 4 90 B-106  1/0 B-7608 B38032900 4 115 B-106  2/0 B-7609 B38032900 4 115 B-106  3/0 B-7610 B38032900 4 150 B-106  4/0 B-7611 B38032900 4 150 B-106  #6 B-7612 B38032900 4 90 B-106  #4 B-7613 B38032900 4 90 B-106  #2 B-7614 B38032900 4 90 B-106  #1 B-7615 B38032900 4 90 B-106  1/0 B-7616 B38032900 4 115 B-106  2/0 B-7617 B38032900 4 115 B-106  3/0 B-7618 B38032900 4 150 B-106		#4	B-7605	B38032900	4	90	B-106
#6 #6 #6 #6 #6 #6 #6 #6 #6 #6 #6 #6 #6 #		#2	B-7606	B38032900	4	90	B-106
#6 #6 #6 #6 #6 #6 #6 #6 #6 #6 #6 #6 #6 #	μг	#1	B-7607	B38032900	4	90	B-106
#6 B-7610 B38032900 4 150 B-106  #6 B-7611 B38032900 4 150 B-106  #6 B-7612 B38032900 4 90 B-106  #4 B-7613 B38032900 4 90 B-106  #2 B-7614 B38032900 4 90 B-106  #1 B-7615 B38032900 4 90 B-106  1/0 B-7616 B38032900 4 115 B-106  2/0 B-7617 B38032900 4 115 B-106  3/0 B-7618 B38032900 4 150 B-106	#3	1/0	B-7608	B38032900	4	115	B-106
#6 B-7611 B38032900 4 150 B-106 #6 B-7612 B38032900 4 90 B-106 #4 B-7613 B38032900 4 90 B-106 #2 B-7614 B38032900 4 90 B-106 #1 B-7615 B38032900 4 90 B-106 1/0 B-7616 B38032900 4 115 B-106 2/0 B-7617 B38032900 4 115 B-106 3/0 B-7618 B38032900 4 150 B-106		2/0	B-7609	B38032900	4	115	B-106
#6 B-7612 B38032900 4 90 B-106 #4 B-7613 B38032900 4 90 B-106 #2 B-7614 B38032900 4 90 B-106 #1 B-7615 B38032900 4 90 B-106 1/0 B-7616 B38032900 4 115 B-106 2/0 B-7617 B38032900 4 115 B-106 3/0 B-7618 B38032900 4 150 B-106		3/0	B-7610	B38032900	4	150	B-106
#4 B-7613 B38032900 4 90 B-106 #2 B-7614 B38032900 4 90 B-106 #1 B-7615 B38032900 4 90 B-106 1/0 B-7616 B38032900 4 115 B-106 2/0 B-7617 B38032900 4 115 B-106 3/0 B-7618 B38032900 4 150 B-106		4/0	B-7611	B38032900	4	150	B-106
#6 #2 <b>B-7614</b> B38032900 4 90 B-106 #1 <b>B-7615</b> B38032900 4 90 B-106 1/0 <b>B-7616</b> B38032900 4 115 B-106 2/0 <b>B-7617</b> B38032900 4 115 B-106 3/0 <b>B-7618</b> B38032900 4 150 B-106		#6	B-7612	B38032900	4	90	B-106
#6 #1 <b>B-7615</b> B38032900 4 90 B-106 1/0 <b>B-7616</b> B38032900 4 115 B-106 2/0 <b>B-7617</b> B38032900 4 115 B-106 3/0 <b>B-7618</b> B38032900 4 150 B-106		#4	B-7613	B38032900	4	90	B-106
#6		#2	B-7614	B38032900	4	90	B-106
1/0 B-7616 B38032900 4 115 B-106 2/0 B-7617 B38032900 4 115 B-106 3/0 B-7618 B38032900 4 150 B-106	#С	#1	B-7615	B38032900	4	90	B-106
3/0 <b>B-7618</b> B38032900 4 150 B-106	#6	1/0	B-7616	B38032900	4	115	B-106
		2/0	B-7617	B38032900	4	115	B-106
4/0 <b>B-7619</b> B38032900 4 150 B-106		3/0	B-7618	B38032900	4	150	B-106
		4/0	B-7619	B38032900	4	150	B-106

#### For sizes not listed, contact BURNDY®

- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.
- For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®.

Handle Clamps (see chart for correct handles) **B38-0309-00** Flint Ignitor

Other recommended accessories

**B40-0319-01** Mold Cleaner for cartridge sizes #15-#65

**B40-0319-03** Mold Cleaner for cartridge sizes #90-#500

(pg E-92) **B38-3922-00** Mold Cleaning Brush (pg E-92) **B38-0135-00** Cable Cleaning Brush (pg E-92) **B38-0304-00** File (pg E-93)

#### **‡ PACKING MATERIAL NOTE**


A packing pad is necessary when making BURNDYWeld® connections to rebar. Packing material B38032900 is copper shim stock. Packing material numbers B38406100, B38406200 and B38406300 are a ceramic fiber material and can be used for one connection only. Be sure to specify packing material catalog number when ordering mold and weld metal.

For mold types or BURNDYWeld® items not shown, please contact factory.

#### **TYPE BCRE-3 MOLDS**

#### **Horizontal through Cable to Vertical Rebar**

Type BCRE-3 Molds are recommended for horizontal conductors to vertical rebar connections for solid or concentric stranded conductors #6 through 4/0 joined to reinforcing bars #3 through #7 & larger. The high copper content joint has a higher current carrying capacity than the conductors being joined and is impervious to vibration and moisture.

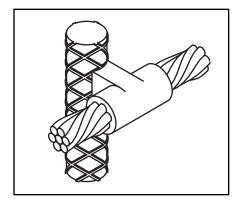

Contact BURNDY® for information on molds for conductors not listed below.

Rebar	Cable	Mold	Packing	Price	Weld	Handle
Size	Size	Number	Material ‡	Key	Metal	Clamps
	#6	B-7620	B38032900	24	90	B-106
İ	#4	B-7621	B38032900	24	90	B-106
Ī	#2	B-7622	B38032900	24	90	B-106
	#1	B-7623	B38032900	24	115	B-106
#3	1/0	B-7624	B38032900	24	115	B-106
Ī	2/0	B-7625	B38032900	24	115	B-106
	3/0	B-7626	B38032900	24	150	B-106
	4/0	B-7627	B38032900	24	150	B-106
	#6	B-7628	B38032900	24	90	B-106
İ	#4	B-7629	B38032900	24	90	B-106
İ	#2	B-7630	B38032900	24	90	B-106
	#1	B-7631	B38032900	24	115	B-106
#4	1/0	B-7632	B38032900	24	115	B-106
	2/0	B-7633	B38032900	24	115	B-106
l	3/0	B-7634	B38032900	24	150	B-106
	4/0	B-7635	B38032900	24	150	B-106
	#6	B-7636	B38032900	24	90	B-106
İ	#4	B-7637	B38032900	24	90	B-106
	#2	B-7638	B38032900	24	90	B-106
1	#1	B-7639	B38032900	24	115	B-106
#5	1/0	B-7640	B38032900	24	115	B-106
	2/0	B-7641	B38032900	24	115	B-106v
	3/0	B-7642	B38032900	24	150	B-106
İ	4/0	B-7643	B38032900	24	150	B-106
	#6	B-7644	B38032900	24	90	B-106
	#4	B-7645	B38032900	24	90	B-106
	#2	B-7646	B38032900	24	90	B-106
	#1	B-7647	B38032900	24	115	B-106
#6	1/0	B-7648	B38032900	24	115	B-106
ŀ	2/0	B-7649	B38032900	24	115	B-106
	3/0	B-7650	B38032900	24	150	B-106
ŀ	4/0	B-7651	B38032900	24	150	B-106
	#6	B-7652	B38406300	4+	90	B-106-4
	#4	B-7653	B38406300	4+	90	B-106-4
	#2	B-7654	B38406300	4+	90	B-106-4
#7	#1	B-7655	B38406300	4+	115	B-106-41
&	1/0	B-7656	B38406300	4+	115	B-106-41
Larger	2/0	B-7657	B38406300	4+	115	B-106-41
ŀ	3/0	B-7658	B38406300	4+	150	B-106-41
	4/0	B-7659	B38406300	4+	150	B-106-41

#### **‡ PACKING MATERIAL NOTE**

A packing pad is necessary when making BURNDYWeld® connections to rebar. Packing material B38032900 is copper shim stock. Packing material numbers B38406100, B38406200 and B38406300 are a ceramic fiber material and can be used for one connection only. Be sure to specify packing material catalog number when ordering mold and weld metal.

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix
- "-S" to mold number for solid conductors.
   For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY® Required Tools:

Handle Clamps (see chart for correct handles) **B38-0309-00** Flint Ignitor

Other recommended accessories:

Vertical Chain Clamps
† **B40-0319-03** Mold Cleaner for cartridge sizes #90-


B38-3922-00 Mold Cleaning Brush (pg E-92) B38-0135-00 Cable Cleaning Brush (pg E-92) B38-0304-00 File (pg E-93)

For mold types or BURNDYWeld® items not shown, please contact factory.

#### **TYPE BCRE-4 MOLDS**

#### **Horizontal through Cable to Horizontal Rebar**

Type BCRE-4 Molds are recommended for horizontal through conductors to horizontal rebar at right angle connections for solid or concentric stranded conductors #6 through 4/0 joined to reinforcing bars #3 through #6 & larger. The high copper content joint has a higher current carrying capacity than the conductors being joined and is impervious to vibration and moisture.

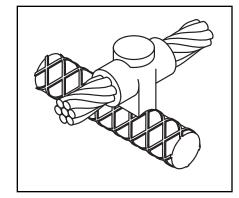

Contact BURNDY® for information on molds for conductors not listed below.

Rebar	Cable	Mold	Packing	Price	Weld	Handle
Size	Size	Number	Material ‡	Key	Metal	Clamps
	#6	B-7708	B38032900	4	90	B-106
	#4	B-7709	B38032900	4	90	B-106
	#2	B-7710	B38032900	4	90	B-106
"0	#1	B-7711	B38032900	4	115	B-106
#3	1/0	B-7712	B38032900	22	115	B-106
	2/0	B-7713	B38032900	22	115	B-106
	3/0	B-7714	B38032900	22	150	B-106
	4/0	B-7715	B38032900	22	150	B-106
	#6	B-7716	B38032900	4	90	B-106
	#4	B-7717	B38032900	4	90	B-106
	#2	B-7718	B38032900	4	90	B-106
	#1	B-7719	B38032900	22	115	B-106
#4	1/0	B-7720	B38032900	22	115	B-106
	2/0	B-7721	B38032900	22	115	B-106
	3/0	B-7722	B38032900	22	150	B-106
	4/0	B-7723	B38032900	22	150	B-106
	#6	B-7724	B38032900	4	90	B-106
	#4	B-7725	B38032900	4	90	B-106
	#2	B-7726	B38032900	4	90	B-106
"-	#1	B-7727	B38032900	22	115	B-106
#5	1/0	B-7728	B38032900	22	115	B-106
	2/0	B-7729	B38032900	22	115	B-106
	3/0	B-7730	B38032900	22	150	B-106
	4/0	B-7731	B38032900	22	150	B-106
	#6	B-7732	B38406100	14+	90	N/A
	#4	B-7733	B38406100	14+	90	N/A
щС	#2	B-7734	B38406100	14+	90	N/A
#6 &	#1	B-7735	B38406100	14+	115	N/A
	1/0	B-7736	B38406200	14+	115	N/A
Larger	2/0	B-7737	B38406200	14+	115	N/A
	3/0	B-7738	B38406200	14+	150	N/A
	4/0	B-7739	B38406200	14+	150	N/A

#### For sizes not listed, contact BURNDY®.

- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.

  For heavy duty molds, molds with wear plates or molds for Copperweld® cable, contact BURNDY®.

  For expedited service, contact BURNDY®.

  Required Tools:

Handle Clamps (see chart for correct handles) t Sold complete with frame

**B38-0309-00** Flint Ignitor

Other recommended accessories: **B40-0319-03** Mold Cleaner for cartridge sizes #90-#500

B38-3922-00 Mold Cleaning Brush (pg E-92) B38-0135-00 Cable Cleaning Brush (pg E-92) B38-0304-00 File (pg E-93)

#### **‡ PACKING MATERIAL NOTE**


A packing pad is necessary when making BURNDYWeld® connections to rebar. Packing material B38032900 is copper shim stock. Packing material numbers B38406100, B38406200 and B38406300 are a ceramic fiber material and can be used for one connection only. Be sure to specify packing material catalog number when ordering mold and weld metal.

For mold types or BURNDYWeld® items not shown, please contact factory.

#### **TYPE BCRE-6 MOLDS**

#### **Horizontal Cable Tap to Vertical Rebar**

Type BCRE-6 Molds are recommended for horizontal conductors terminating at right angles to vertical rebar connections for solid or concentric stranded conductors #6 through 4/0 joined to reinforcing bars #3 through #7 and larger. The high copper content joint has a higher current carrying capacity than the conductors being joined and is impervious to vibration and moisture.

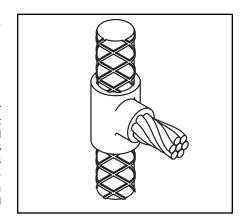

Contact BURNDY® for information on molds for conductors not listed below

Rebar	Cable	Mold	Packing	Price	Weld	Handle
Size	Size	Number	Material ‡	Key	Metal	Clamps
	#6	B-7884	B38032900	4	90	B-106
	#4	B-7885	B38032900	4	90	B-106
	#2	B-7886	B38032900	4	90	B-106
	#1	B-7887	B38032900	4	115	B-106
#3	1/0	B-7888	B38032900	4	115	B-106
	2/0	B-7889	B38032900	4	115	B-106
	3/0	B-7890	B38032900	4	150	B-106
	4/0	B-7891	B38032900	4	150	B-106
	#6	B-7892	B38032900	4	90	B-106
	#4	B-7893	B38032900	4	90	B-106
	#2	B-7894	B38032900	4	90	B-106
	#1	B-7895	B38032900	4	115	B-106
#4	1/0	B-7896	B38032900	4	115	B-106
	2/0	B-7897	B38032900	4	115	B-106
	3/0	B-7898	B38032900	4	150	B-106
	4/0	B-7899	B38032900	4	150	B-106
	#6	B-7900	B38032900	4	90	B-106
	#4	B-7901	B38032900	4	90	B-106
	#2	B-7902	B38032900	4	90	B-106
шг	#1	B-7903	B38032900	4	115	B-106
#5	1/0	B-7904	B38032900	4	115	B-106
	2/0	B-7905	B38032900	4	115	B-106
	3/0	B-7906	B38032900	4	150	B-106
	4/0	B-7907	B38032900	4	150	B-106
	#6	B-7908	B38032900	4	90	B-106
	#4	B-7909	B38032900	4	90	B-106
	#2	B-7910	B38032900	4	90	B-106
#6	#1	B-7911	B38032900	4	115	B-106
#0	1/0	B-7912	B38032900	4	115	B-106
	2/0	B-7913	B38032900	4	115	B-106
	3/0	B-7914	B38032900	4	150	B-106
	4/0	B-7915	B38032900	4	150	B-106
	#6	B-7916	B38406300	4	90	B-106-32
	#4	B-7917	B38406300	4	90	B-106-32
#7	#2	B-7918	B38406300	4	90	B-106-32
# <i>1</i> &	#1	B-7919	B38406300	4	115	B-106-32
-	1/0	B-7920	B38406300	4	115	B-106-32
Larger	2/0	B-7921	B38406300	4	115	B-106-32
	3/0	B-7922	B38406300	4	150	B-106-32
	4/0	B-7923	B38406300	4	150	B-106-32

#### **‡ PACKING MATERIAL NOTE**

A packing pad is necessary when making BURNDYWeld® connections to rebar. Packing material B38032900 is copper shim stock. Packing material numbers B38406100, B38406200 and B38406300 are a ceramic fiber material and can be used for one connection only. Be sure to specify packing material catalog number when ordering mold and weld metal.

- For sizes not listed, contact BURNDY®.
- Molds listed are for concentric stranded cable. Add suffix "-S" to mold number for solid conductors.

  • For heavy duty molds, molds with wear plates or molds
- for Copperweld® cable, contact BURNDY®.
- For expedited service, contact BURNDY®
  Required Tools:

Handle Clamps (see chart for correct handles) **B38-0309-00** Flint Ignitor

**B38-3922-00** Mold Cleaning Brush (pg E-92) **B38-0135-00** Cable Cleaning Brush (pg E-92) **B38-0304-00** File (pg E-93)

\*The B106-32 comes complete with a B-106 handle clamp and B40-0106-76 vertical chain clamp. Although good for use on all sizes of rebar, vertical chain clamps are strongly recommended on large size rebar as they hold the mold to the rebar securely. If you already have a B-106 handle clamp, you can purchase the vertical chain clamps separately. See page E-91 for a variety of options.

For mold types or BURNDYWeld® items not shown, please contact factory.

#### BURNDY® GROUNDMAX™

BURNDY® GROUNDMAX™ is an economical solution for areas with very difficult grounding issues. BURNDY® GROUNDMAX™ is highly conductive in a wet or dry application and does not require moisture to lower the resistance of your grounding system. BURNDY® GROUNDMAX™ contains a corrosion inhibitor which forms a film on copper, creating a barrier against corrosion.

BURNDY<sup>®</sup> GROUNDMAX<sup>™</sup> can be poured in dry or pumped in slurry form. No tamping required. It is very contractor friendly. No special tools required.

#### BURNDY® GROUNDMAX™ Advantages:

- Easy to install.
- Electrically conductive.
- Environmentally friendly.
- Will not leach into the ground.
- Positive low resistance, electrical connection to earth.
- Does not contain any hazardous chemicals.
- Compatible with all copper grounding systems.
- Contains a corrosion inhibitor to protect copper.
- Will not expand or shrink.
- Not affected by freezing.
- Excellent shelf life.
- Typical resistivity <10 Ohm-cm

Material Required Per Linear Foot of Trench Width of Trench (Inches)												
		4	6	8	10	12	14	16	18	20	22	24
	2	4.1	6.2	8.1	10.1	12.1	14.1	16.2	18.2	20.2	22.2	24.2
	3	6.2	9.3	12.1	15.2	18.2	21.2	24.2	27.3	30.3	33.3	36.4
Thickness of	4	8.2	12.3	16.2	20.2	24.2	28.3	32.3	36.4	40.4	44.5	48.5
BURNDY® GROUNDMAXTM	5	10.3	15.4	20.2	25.3	30.3	35.4	40.4	45.5	50.5	55.6	60.6
(Inches)	6	12.3	18.5	24.2	30.3	36.4	42.4	48.5	54.6	60.6	66.7	72.7
(monocy)	7	14.4	21.6	28.3	35.4	42.4	49.5	56.6	63.7	70.7	77.8	84.9
	8	16.4	24.7	32.3	40.4	48.5	56.0	64.7	72.7	80.8	88.9	97.0
	9	18.5	27.8	36.4	45.5	54.6	63.7	72.7	81.8	90.9	100.0	109.1
	10	20.6	30.8	40.4	50.5	60.6	70.7	80.8	90.9	101.0	111.1	121.2

#### To calculate the lbs. of material required to fill a trench:

- Determine desired thickness.
- Move to the right until you are under the known width of the trench. This number will be the weight of the material in lbs./linear ft.
- Take this number and multiply by the length of the trench in feet. Your answer will be the amount of BURNDY® GROUNDMAX™ material required to fill the trench to the desired level in lbs.

#### Example:

Thickness: = 6 inches Width = 18 inches

54.6 lbs. per linear ft. (from the table above)

Answer = 54.6 lbs. per linear ft. x 25 ft. trench = 1,365 lbs. of BURNDY®

GROUNDMAX™

= 28 (50 lb.) bags of BURNDY® GROUNDMAX™

#### BURNDY® GROUNDMAX™

#### **Application Information**

#### **Vertical Installation**

Drill or bore a hole the desired diameter and depth. Suspend ground electrode in center of hole to be filled. Pour BURNDY® GROUNDMAX<sup>TM</sup> until desired level is obtained. No tamping is required.

BUI	Dry Volume of RNDY® GROUNDMAX™ vs. Hole Size	Ground Resistance Comparison of Bare Rod vs.		
Hole Size	Lbs. of Burndy® Groundmax™ Per Ft.	Hole Size with 5/8" x 10' Rod in Center of 15' Hole	Percent Resistance Compared to Rod Only (100%)	
4"	6.5	4"	52%	
6"	14.5	6"	47%	
8"	25.8	8"	44%	
10"	40.4	10"	42%	
12"	58.1	12″	40%	

## Horizontal or Grid Construction†


Pour into horizontal trench until level of ground wire is reached. Place ground wire. Pour in additional BURNDY® GROUND-MAX<sup>TM</sup> until wire is covered to desired height. Cover with fill. No tamping required.


For grid construction, pour BURNDY® GROUNDMAX™ and spread over ground grid until desired thickness is achieved. Cover with fill.

	.475" Diameter	Percentage of Resistance with .475' Wire Plus BURNDY® GROUNDMAX™ Various Diameters Compared to Wire Only (100%)				
Length	Wire Only	2"	3″	4"	6″	
25′	100%	83%	78%	74%	69%	
50′	100%	85%	81%	77%	73%	
75′	100%	86%	82%	79%	75%	
100′	100%	87%	83%	80%	77%	
150′	100%	88%	84%	82%	78%	
200′	100%	88%	85%	83%	79%	
250′	100%	89%	85%	83%	80%	
300′	100%	89%	86%	84%	80%	

- † Entire grounding system should be surrounded by BURNDY® GROUNDMAX<sup>TM</sup>. Conductors should be insulated as they exit BURNDY® GROUNDMAX<sup>TM</sup> column.
- ‡ The use of BURNDY® GROUNDMAX™ around the grounding system will also reduce surge impedance by increasing the effective contact area of the electrode to soil.

#### **Horizontal Construction**



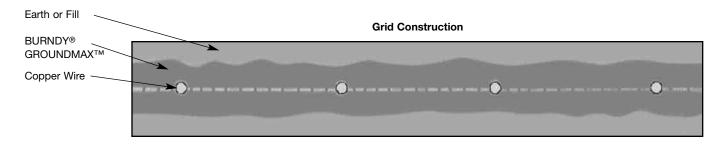



For mold types or BURNDYWeld® items not shown, please contact factory.

#### BURNDY® GRIDMAX™

#### PREFABRICATED WIRE MESH

Grounding, Personnel Safety Mats, Equipotential Bonding, Pool and Spa Grounding

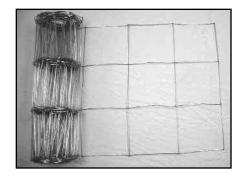

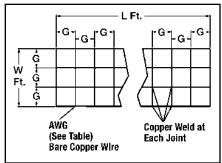



E-89

#### **Features and Benefits**

- Manufactured from bare solid copper.
- Spaced on 4", 6" or 12" centers.
- Copper to copper weld with 6% silver.
- Furnished in sections with lengths from 4' to 100'.
- Easily and economically installed using BURNDYWeld® HYGROUND® or our Mechanical connectors.
- ullet Sizes made specifically for the Pool and Spa market  $3' \times 100'$  and  $3' \times 50'$ . But can be used where any large area grounds are required.

		Dimensions			
Catalog		G	L	W	
Number	Conductor	(spacing)	(length)	(width)	
BGM3100	8 AWG	12"	100′	3′	
BGM3050	8 AWG	12"	50′	3′	
BGM640044	6 AWG	4"	4′	4′	
BGM640068	6 AWG	8"	6′	4′	
BGM64006	6 AWG	12"	6′	4′	
BGM640066	6 AWG	6"	6′	4′	

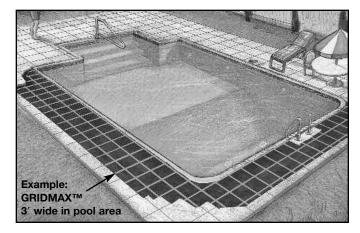


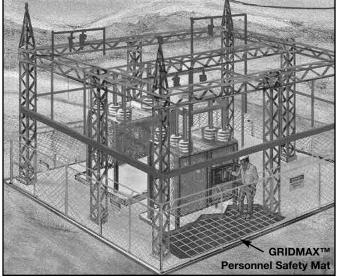

#### B-106 & B-107 HANDLE CLAMPS

BURNDYWeld® Handle Clamps make possible the use of many different sizes and types of molds with only two different clamps. The two handle clamps are catalog numbers **B-106** and **B-107**. These will fit 95% of all standard BURNDYWeld® molds.


- 1. Use B-106 clamps for all molds having a price key 4, 7, 17, 22 or 24. These molds are a nominal 3  $1/8'' \times 3 1/8''$  square.
- 2 Use B-107 clamps for all molds having a price key 5, 6, 8 or 23. These molds are a nominal  $4^{\prime\prime} \times 4^{\prime\prime}$  square.
- All molds having a price key 2, 3, 9, 10, 11, 12, 14, 15 or 16 have an attached frame; separate handles are not required.

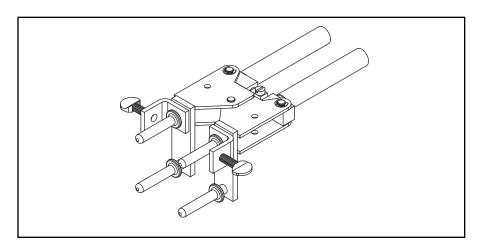

## B40-0106-75 HANDLE ATTACHMENT

This Handle Attachment is used to hold Price Key-14 molds in position. It easily attaches to the B-106 Handle Clamp. This Handle Attachment can be used with weld types BCRE-1 and BCRE-4.


Catalog Number **B40-0106-75** 

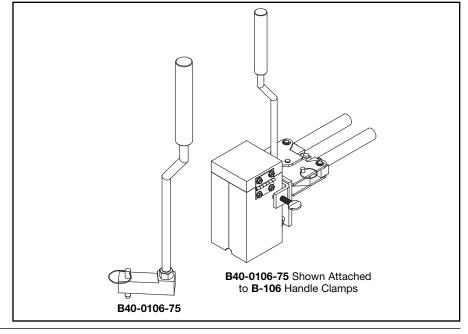


# MOLD SUPPORT CLAMP

The Mold Support Clamp is used to hold a mold in position on a vertical steel column or angle. It is easily attached to the Handle Clamps. The Mold Support Clamp can be used with weld types BCS-3, BCS-18, BCS-23 and BCS-27.

Catalog Number **B40-3657-00** 

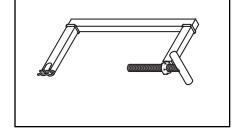


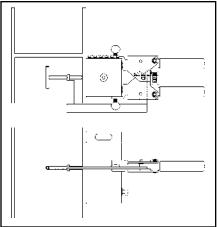

For mold types or BURNDYWeld® items not shown, please contact factory.

## VERTICAL MAGNETIC CLAMPS

Magnetic Clamps are used to hold a mold in position on a vertical steel surface. The magnetic clamp can be purchased complete with B-106 Handle Clamps or if you already have a set of handle clamps, you can order just the magnetic mounting assembly. The mounting assembly can easily be mounted on the prongs of your existing B-106 handle clamps. A minimum of 10" is required.

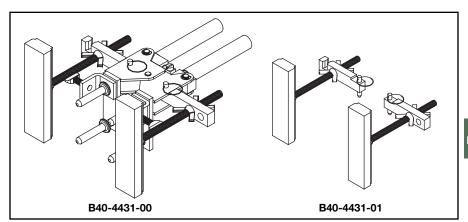



Magnetic Clamps With B106 Handle				
Catalog	Fits Molds	For Use With		
Number	W/Price Key	Weld Types		
B404431-00	4 & 17	BCS-3, 4, 7 & 23		


Magnetic Clamp Only				
Catalog	Fits Handle	For Use With		
Number	Clamps	Weld Types		
B40-4431-01	B-106 & B-107	BCS-3, 4, 7 & 23		

# HORIZONTAL & VERTICAL CHAIN CLAMPS

Chain Clamps are used to hold a mold in position on horizontal or vertical pipe up to 4" in diameter. For larger pipe a 20" chain extension is available to allow the chain clamps to be used on pipe up to 10" in diameter. The chain clamp can be purchased complete with B-106 or B-107 Handle Clamps or if you already have a set of handle clamps, you can order just the chain clamp and mounting assembly. The mounting assembly can easily attached to your existing handle clamps. 20" Chain Extension catalog number: **B40-0106-27**.

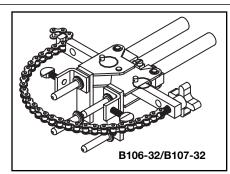

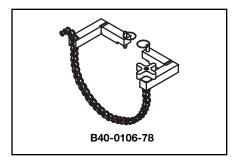


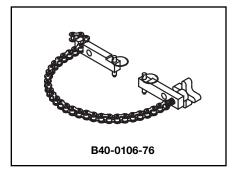



Chain Clamps				
Catalog Number	Fits Molds W/Price Key	For Use With Weld Types	Pipe Position	
B106-32	4, 17, 22 & 24	BCS-3, 4, 7, 23 & BCRE-6	Vertical	
B107-32	5, 6 & 23	BCS-3, 4, 7 & 23	Vertical	
B106-37	4, 17, 22 & 24	BCS-1, 2, 5, 8 & 9	Horizontal	
B107-37	5, 6 & 23	BCS-1, 2, 5, 8 & 9	Horizontal	
B106-41	4, 17	BCS-6, 18 & BCRE-3	Vertical	

Ch	Chain Clamp Only (Handle Clamps Not Included)					
Catalog	Fits Handle	For Use With				
Number	Clamp	Weld Types	Pipe Position			
B40-0106-76	B-106 & B-107	BCS-3, 4, 7, 23 & BCRE-6	Vertical			
B40-0106-78	B-106 & B-107	BCS-1, 2, 5, 8 & 9	Horizontal			
B40-0106-77	B-106 & B-107	BCS-6, 18 & BCRE-3	Vertical			

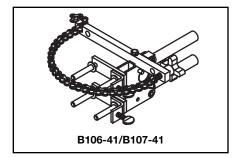


For mold types or BURNDYWeld® items not shown, please contact factory.

#### BURNDYWeld® ACCESSORIES

#### **B38-0330-00 CABLE CLAMP**

The BURNDYWeld® Cable Clamp is recommended for holding a wide range of cables properly in place in molds when welding cables that are under tension. This prevents the cables from pulling out of the mold when the weld is made.

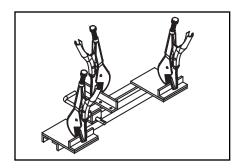


#### **CABLE CLEANING AND CARD CLOTH BRUSH**


The Cable Cleaning Brush is recommended for cleaning heavily oxidized cables. The V-shape brushes permit their use over a wide range of cable sizes. Brush assembly consists of a handle with two stiff wire bristle brushes that are rotatable, for longer life and are replaceable.

The Card Cloth Brush is used for cleaning large conductors and bus bar. It has short stiff bristles. These brushes are for cleaning cable only, not molds.

The Mold Cleaning Brush B38-3922-00 is used to clean the graphite mold without scratching the mold.

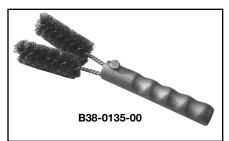

B38-0135-00 Cable Cleaning Brush Replacement Brush B38-0135-01 Card Cloth Brush B38-0306-00 Mold Cleaning Brush B38-3922-00

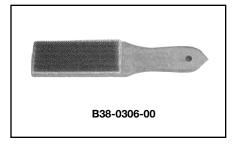



#### **MOLD CLEANERS**


Mold Cleaners are used to clean the slag from molds that are not split through the crucible.

B40-0319-01 for cartridge sizes #15

through #65

B40-0319-03 for cartridge sizes #90

through #500

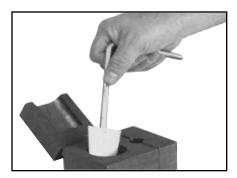


#### **PACKING MATERIAL**

Packing material is used to prevent the molten weld metal from leaking out of the mold. When the cable opening becomes worn from heavy use, the packing material may be used to prolong mold use. It is also used around 7 strand cable to prevent leaking. Packing material comes in a 1 lb. or 5 lb. package.

**Catalog Number** B38412900 B38412905

Description 1 lb. package 5 lb. package

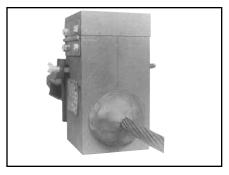

For mold types or BURNDYWeld® items not shown, please contact factory.

#### **BURNDYWeld® ACCESSORIES**



#### **BURNDYWeld® TOOL KIT**


B38-0302-00 Tool Kit with Tools Shown

except Rasp

B38-0302-02 Tool Kit with Tools Shown

and Rasp

**B38-0303-00** Tool Box only

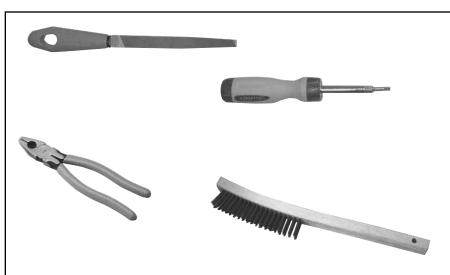

#### **BURNDYWeld® TOOLS**

 B38-0309-00
 Flint Ignitor

 B38-0304-00
 8" File

 B38-0307-00
 Crimping Tool


 B38-3922-00
 Mold Cleaning Brush

 B38-0308-00
 6" Screwdriver

 B38-0305-00
 Wire Brush

 B38-0101-00
 Rasp

B38-0306-00 Card Cloth Brush

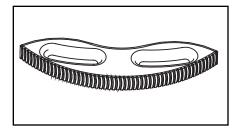

#### B38-0101-00 RASP

This tempered steel, curved rasp is recommended for removing rust and mill scale from steel and cast iron surfaces. The blade is replaceable. To order replacement rasp blade, specify catalog number **B38-0101-01**.

Not recommended for use on galvanized surfaces.



#### **B38-0309-00 FLINT IGNITOR**

The B38-0309-00 Flint Ignitor is used to ignite the starting powder. Each mold that is sold with a frame has a Flint Ignitor included. For added safety a Flint Ignitor extension is available, catalog number **B38-0904-00**, that attaches to the B38-0309-00 Flint Ignitor. This allows installers to stay approximately 36" away from the mold.


To order replacement flints, specify part number **B38-0309-01**.

For mold types or BURNDYWeld® items not shown, please contact factory.

## GROUND ROD DRIVING SLEEVES


Ground Rod Driving Sleeves are placed over the top of a ground rod while driving it into the ground. This prevents the top from mushrooming or flaring out. Ground rod driving sleeves are available in sizes to fit all standard unthreaded ground rods.

Catalog Number	For Use On
B38-3662-01	1/2" Copper Clad or Steel Ground Rod
	5/8" Copper Clad Ground Rod
B38-3662-05	5/8" Steel Ground Rod
B38-3662-03	3/4" Copper Clad Ground Rod
	3/4" Steel Ground Rod
B38-3662-04	1" Copper Clad Ground Rod

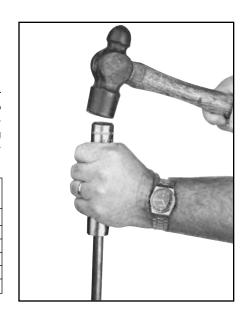

## SHIM STOCK AND ADAPTER SLEEVES

BURNDYWeld® molds designed for larger cable sizes can be used on smaller diameter cables if copper adapter sleeves or shim stock are utilized. The copper shim stock, .0108"  $\times$  1-1/2"  $\times$  3", is normally wrapped around cable until the diameter is about equal to the cable opening. A tight fit is not necessary as the shim stock will unwrap slightly and prevent leakage of weld metal. To order shim stock use part number B38-0329-00. Shim stock comes 100 pieces per box.

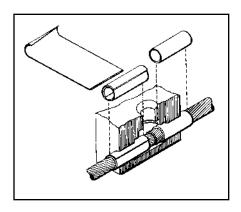

For Use on Cable Size		Part	Use in	Sleeve Dimensions		
Stranded	Solid	No.	Mold Size	0.D.	I.D.	Length
#12, #14	#10, #12, #14	BA-200	#6 Str & Sol	.156	.111	1.00
#9. #10	#8. #9. #10	BA-208	#4 Sol	.203	.140	1.00
#7, #8, #10	#6, #8	BA-201	#4	.227	.177	1.00
#6	#5	BA-202	#2	.292	.198	1.00
#4, #5	#3, #4	BA-207	#2	.302	.246	1.00
#4	#2	BA-204	#1	.340	.246	1.00
#2	#1	BA-203	1/0	.370	.307	1.00
#1	1/0	BA-209	2/0	.420	.359	1.00
1/0, #1	2/0	BA-205	3/0 & 4/0 Sol	.469	.385	1.00
2/0, 1/0	3/0	BA-240	4/0	.524	.437	1.50
4/0	_	BA-211	300 kcmil	.625	.545	1.25
250 kcmil	_	BA-212	350 kcmil	.677	.595	1.25
350,400 kcmil	_	BA-213	500 kcmil	.811	.762	1.50
250, 300, 350 kcmil	_	BA-214	500 kcmil	.811	.700	1.50
750,800 kcmil	_	BA-215	1000 kcmil	1.156	1.05	1.50

For mold types or BURNDYWeld® items not shown, please contact factory.

#### **TROUBLE SHOOTING TIPS**

PROBLEM PROBABLE CAUSE		CORRECTION TO MAKE		
Insufficient metal to make weld.	Worn mold resulting in leaking weld metal.	Replace mold. If only worn around conductor opening, use duct seal around conductor. Do not get duct seal into mold cavity.		
	Wrong size cartridge for mold.	Check ID plate for mold and compare with number on bottom of cartridge.		
	Too much spillage when dumping powder.	Carefully open lid while holding over crucible and dump.		
	Wrong mold for conductor being used.	Replace with correct mold. In some applications, shim stock or adapter sleeves can be used to enlarge cable to fit mold.		
Mold does not close tightly causing weld metal to leak out.	Handle clamps not properly adjusted.	Remove cotter pin between the handles of the mold and adjust handle tension by backing out the eye bolt.		
	Dirt or slag stuck in parting line of mold.	Clean mold thoroughly between connections.		
	Bent or out-of-round cable.	Straighten or cut out bad section of cable.		
Handle clamps will not lock closed.	Handle clamps not properly adjusted.	Remove cotter pin between the handles of the mold and adjust handle tension by backing out the eye bolt.		
Excessively high weld, bubbly or gassy appearance, poor weld.	Moisture in mold.	Pre-heat mold to above 220° F with a propane torch, or ignite a sacrificial shot in mold with pieces of scrap conductor in it. If it is a horizontally split mold, shoot 3/4 of the recommended cartridge to make sure you do not lock up mold.		
	Oil, grease, moisture or foreign material on conductors.	Pre-heat conductors with propane torch then use a clean wire brush on conductor to remove any residue left on conductors. If welding to cast iron or steel surface, weld area must be cleaned down to bright metal.		
	Duct seal in weld cavity.	Take special precautions to keep duct seal out of weld cavity.		
	Weld powder has gotten wet.	Replace with fresh, dry weld powder.		
Weld metal blows out top of mold.	Mold worn or chipped around disc seal allowing powder to leak into mold cavity.	Replace mold.		
	Forgot to use steel disc or did not seat it properly at bottom of crucible.	Make sure disc is seated at bottom of crucible before pouring the powder into crucible.		

## TROUBLE SHOOTING TIPS

(Continued)

	PROBLEM	PROBABLE CAUSE	CORRECTION TO MAKE		
	Cannot ignite powder.	Insufficient starting powder in ignition pocket on mold lid.	Place at least half of starting powder in ignition pocket of mold lid. Use all starting powder for each connection.		
		Flint ignitor not shooting enough spark.	Clean flint ignitor according to directions on box or replace flint ignitor.		
		Starting powder lumped together.	Break up starting powder on lid with edge of powder tube.		
	Starting powder has gotten wet.		Remove shot from mold and replace with a dry cartridge.		
	Mold wearing out too fast.	Improper cleaning of mold.	Use mold cleaner, soft natural bristle brush or clean rag to clean mold between shots. Do not use wire brush or screwdriver on molds.		
		Bent or out of round cable causes chipping and premature wear of the mold.	Use caution when closing mold. Do not force mold shut around bent, twisted or out of round conductors.		
	Poor weld to ground rod.	Weight of mold not supported during reaction causing mold to slip when cable melts.	Use locking pliers on ground rod under mold to support the weight of the mold during the reaction.		
	Moisture or contaminant on cable or ground rod.		Pre-heat conductors with propane torch then use a clean wire brush on conductors to remove any residue left on conductors.		
	Weld will not stick to steel surface.	Improperly cleaned area on steel.	An area larger than the weld area should be cleaned down to bright clean metal.		
		Moisture or contaminant on cable or ground rod.	Pre-heat conductors with propane torch then use a clean wire brush on conductors to remove any residue left on conductors.		
		Cable is improperly positioned in mold, blocking the flow of weld metal.	Position cable in mold in accordance with directions for mold. If directions are not available, position top of cable in the center of where the liquid weld metal hits the steel.		
	Weld will not stick to cast iron surface.	All of the causes listed under welding to steel surface also apply to this section.			
• • • • • • • • • • • • • • • • • • • •		Not using CI (Cast Iron) powder.	Specify "CI" behind cartridge when ordering powder (i.e., 25 CI).		
	Cable pulls out of mold when it is fired.	Cables are either twisted or under tension.	Use B38-0330-00 cable clamp or other method to remove tension. Cut out severely twisted cable.		